

Federal Lands Highway Road Inventory Program

Road Inventory and Condition Assessment



Gauley River National Recreation Area GARI

Cycle 5 Report

Prepared By: Federal Highway Administration Road Inventory Program (RIP) Data Collected: 11/2013 Report Date: 06/2014

Gauley River National Recreation Area in West Virginia

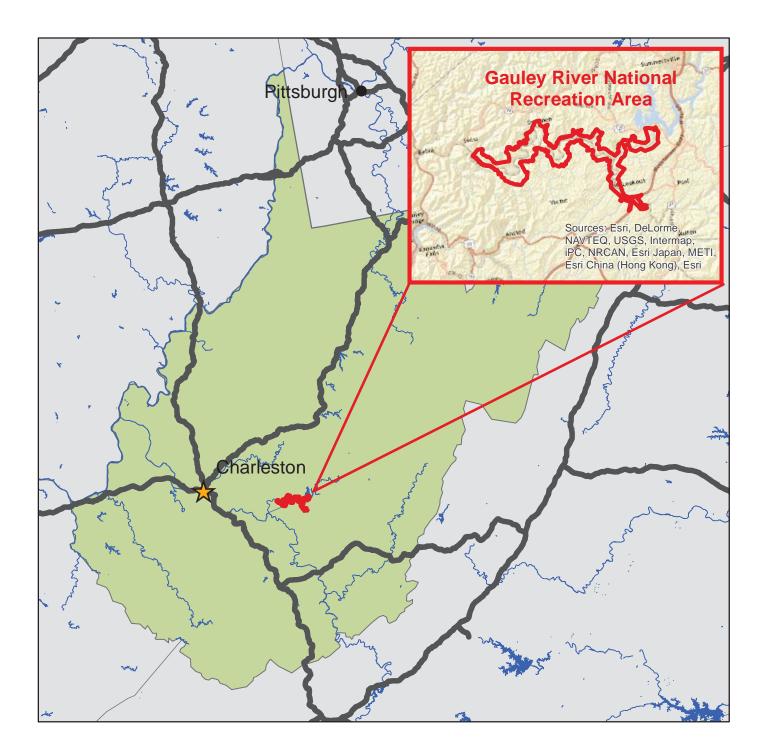




TABLE OF CONTENTS

	SECTION	PAGE
1.	INTRODUCTION	1 - 1
2.	PARK ROUTE INVENTORY Route IDs, Subcomponents & Changes Report (As Applicable)	2 – 1
3.	PARK SUMMARY INFORMATION Paved Route Miles and Percentages by Functional Class and PCR DCV Road Condition Summary Parkwide DCV Condition Summary	3 - 1 3 - 3 3 - 4
4.	PARK ROUTE LOCATION MAPS Route Location Key Map Route Location Area Map Route Condition Key Map – PCR Mile by Mile Route Condition Area Map – PCR Mile by Mile	4 - 1 4 - 2 4 - 4 4 - 5
5.	PAVED ROUTE CONDITION RATING SHEETS CRS Pages	5 – 1
6.	MANUALLY RATED PAVED ROUTE CONDITION RATING SHEETS MRR Pages	6 – 1
7.	PARKING AREA CONDITION RATING SHEETS Paved Parking Area Pages	7 – 1
8.	PARKWIDE / ROUTE MAINTENANCE FEATURES SUMMARIES Parkwide Maintenance Features Summary DCV Route Maintenance Features Summary Structure List	8 - 1 8 - 2 8 - 3
9.	ROUTE MAINTENANCE FEATURES ROAD LOGS Route Maintenance Features Road Logs	9 – 1
10.	APPENDIX Explanation of Changes to the RIP Index Equations and Determination of PCR Explanation of the Excellent, Good, Fair and Poor Condition Descriptions Description of Rating System Surface Distresses Index Formulas Data Collection Vehicle Subsystems Geodatabase – Background and Metadata Glossary of Terms and Abbreviations	10 - 110 - 210 - 310 - 510 - 1210 - 1610 - 1910 - 20

Section 1 Introduction





INTRODUCTION

The Federal Highway Administration, (FHWA), in the mid 1970s, was charged with the task of identifying surface condition deficiencies and corrective priorities on National Park Service (NPS) roads and parkways. Additionally, FHWA was tasked with establishing an integrated maintenance features inventory, locating features such as culverts, guardrails, and signs, among others, along NPS roads and parkways. As a result, in 1976 the NPS and FHWA entered into an MOA (Memorandum Of Agreement) which established the RIP (Road Inventory Program). This MOA was terminated and revised in 1980 to establish a new MOA aiming to update RIP data and develop a long-range program to improve and maintain NPS roads to designated condition standards and establish a maintenance management program.

The FHWA completed this initial phase of the RIP in the early 1980s. As a result of this effort, each NPS site included in the study received a RIP Report known as the "Brown Book" which included the information collected during this first RIP phase.

In the 1990s, the effort was again renewed to update and maintain the RIP data. By this time the computer age was upon us and a process was employed that relied heavily on electronic data collection and computer technology. A cyclical program was developed and the RIP completed two cycles of data collection from 1994 to 2001. Cycle 1, starting in 1994, was conducted in 44 "large parks" (parks containing 10 or more paved route miles). Cycle 2 began in 1997 and comprised 79 large parks and 5 small parks totaling 4,874 paved route miles. Each of these parks received a RIP Report known as the "Blue Book". Cycle 3, from 2001 to 2004, was conducted in all parks, large and small, that contained any paved routes, including parking areas and, again, each park received a RIP Report and associated electronic files.

Cycle 4 was initiated in the spring of 2006 covering 86 large parks and several associated small parks consisting of 5,553 paved route miles and 6,232 paved parking areas. Data collection has been completed for Cycle 4 and all data has been delivered to the NPS.

In 2005, the FHWA began implementing the use of a Pavement Management System (PMS) to assist the NPS in prioritizing Pavement Maintenance and Rehabilitation activities. The PMS used by FHWA is the Highway Pavement Management Application (HPMA) and this software has the ability to store inventory and condition data from RIP and forecast future performance using prediction models. Outputs include performance and condition reports at the National, Regional, Park, or Route level. A regional prioritized list and optimization have been produced for most regions and the Federal Highway Deferred Maintenance is calculated via the HPMA.

In an effort to improve the accuracy of treatment recommendations and pavement condition descriptions, an extensive study was completed throughout 2010 that has resulted in changes to the RIP condition reporting method, specifically the distresses and indexes that comprise the Pavement Condition Rating (PCR). It was determined that a better representation of PCR could

be achieved by modifying the relative impact certain distresses would have on the overall rating. The changes that were implemented were endorsed by management at both the FHWA and NPS in October 2010. These changes will allow greater use of RIP and HPMA data for not simply condition data reporting, but also as a reliable tool for project identification and selection. Because of these changes, the PCR Condition ratings reported in Cycle 5 do not directly relate to the condition ratings reported in previous cycle RIP Reports. For more detailed information about the changes, see Section 3 and Section 10 in this RIP Report.

Cycle 5 has launched in the summer of 2010 and will again comprise all parks, large and small, that are served by paved roads and/or parking areas. For Cycle 5, the decision was made to collect condition data in large parks on Functional Class 1, 2, and 7 paved routes only, as well as any new routes that were previously not collected. In small parks, all paved routes and parking areas will be collected. As a result, this will include 81 large parks with 4,459 paved route miles and 231 small parks with 529 paved route miles and associated paved parking areas.

Since 1984, the Road Inventory Program has been funded through the Federal Lands Highway Park Roads and Parkways (PRP) Program. Currently, coordination of the RIP with FLH is under the NPS Washington Headquarters Park Facility Management Division. The FLH Washington office coordinates policy and prepares national reports and needs assessment studies for Congress.

In 1998, the Transportation Equity Act for the 21st Century (TEA-21) amended Title 23 U.S.C., and inserted Section 204(a)(6) requiring the FHWA and NPS, to develop by rule, a Pavement Management System (PMS) applied to park roads and parkways serving the National Park System.

FLH is responsible for the accuracy of all data presented in this report. Any questions or comments concerning the contents of this report should be directed to the national RIP Coordinator located in Sterling, Virginia.

Respectfully,

FHWA RIP Team

FHWA/Eastern Federal Lands 21400 Ridgetop Circle Sterling, VA 20166 (703) 404-6371 FHWA/Central Federal Lands 12300 West Dakota Ave Lakewood, CO 80228 (720) 963-3556

Section 2 Park Route Inventory





Road Inv	entory	Program 06	5/04/2	014	Cycle 5 NPS	S/RIP Route	-	ort					Pa	ige 1 of 4
Shadin	g Color k	(ey: Whi	ite = Pa	ved Routes, DCV Driven	Yellow = Unpaved Rout	tes, DCV not Driven	Blue = All Paved Parki	ng Areas		Green = All U	Inpaved Pa	arking Areas		
	t denote mileage	Gro	ey = Pav	ved Routes, DCV not Driven	Black = State, Local or	Private non-NPS Routes	= Conces	sion Route Flag	g ON					
G	ARI	** D	DCV - Da	route data was obtained from ata Collection Vehicle Y RIVER NATIONAL R	NPS and was not inventoried by NC - Not Collected	the Road Inventory Program	(RIP).							
Rte. No.	Cycle Collected	FMSS No.	Concess Route	Route Name	Route De From	scription To	Maint. District	Paved Miles	Un- Paved Miles	Total Route Length	Func. Class	Manual Rated SQ/FT	Surf. Type	Area Maps
0100	5	3217		GAULEY TAILWATERS ACCESS ROAD	FROM STATE ROUTE 129	TO ROUTE 0200 (GAULEY TAILWATERS CAMPGROUND ROAD) AND ROUTE 0900 (GAULEY TAILWATERS PARKING AREA)	N/A	1.15	0.00	1.15	2		AS	1
0101	5	104772		HYDROPLANT ROAD	FROM ROUTE 0100 (GAULEY TAILWATERS ACCESS ROAD)	TO PARK BOUNDARY / GATE	N/A	0.04	0.00	0.04	2		AS	1
0102	5	116047		MASONS BRANCH ACCESS ROAD	FROM STATE ROUTE 22	TO ROUTE 0975 (MASONS BRANCH LOWER PARKING AREA)	N/A	1.09	0.00	1.09	2	50,646	AS	2
0103	NC			UPPER SWISS RIVER ACCESS ROAD	FROM STATE ROUTE 19/25	TO RIVER	N/A	0.00	0.10	0.10	2		GR	
0200	NC	104778		GAULEY TAILWATERS CAMPGROUND ROAD	FROM END OF ROUTE 0100 (GAULEY TAILWATERS ACCESS ROAD) ON RIGHT	TO END OF LOOP	N/A	0.00	0.10	0.10	3		GR	
0201	NC	99235		LEGG CEMETERY ROAD	FROM STATE ROUTE 22	TO END	N/A	0.00	1.00	1.00	3		GR	
0202	NC	115957		WOODS FERRY ACCESS ROAD	FROM STATE ROUTE 22/2	TO ROUTE 0979 (WOODS FERRY PRIVATE BOATER'S PARKING)	N/A	0.00	1.00	1.00	1		GR	
0900	NC	104781		GAULEY TAILWATERS PARKING AREA	FROM END OF ROUTE 0100 (GAULEY TAILWATERS ACCESS ROAD) ON LEFT	TO PARKING	N/A	0.00	0.00	0.00		16,250	GR	
0971	NC	50325		GAULEY TAILWATERS ROAD UPPER PARKING AREA	ADJACENT TO ROUTE 0101 (HYDROPLANT ROAD)		N/A	0.00	0.00	0.00		4,800	GR	
0972	NC	50328		GAULEY TAILWATERS RIVER ACCESS PARKING AREA	FROM ROUTE 0101 (HYDROPLANT ROAD)	TO PARKING	N/A	0.00	0.00	0.00		2,475	GR	
0973	NC	50331		GAULEY TAILWATERS CAMPGROUND PARKING AREA	ADJACENT TO ROUTE 0200 (GAULEY TAILWATERS CAMPGROUND ROAD)		N/A	0.00	0.00	0.00		25,332	GR	
0974	NC	50333		GAULEY TAILWATERS CAMPGROUND RESTROOM PARKING AREA	ADJACENT TO ROUTE 0200 (GAULEY TAILWATERS CAMPGROUND ROAD)		N/A	0.00	0.00	0.00		10,650	GR	
0975	NC	116137		MASONS BRANCH LOWER PARKING AREA	FROM ROUTE 0102 (MASONS BRANCH ACCESS ROAD)	TO PARKING	N/A	0.00	0.00	0.00		5,040	GR	

Chadin	a Color k		ito – D	aved Doutoo DCV/ Driven		Yellow = Unpaved Routes, DCV not Driven Blue = All Paved Parking Areas					Green = All Unpaved Parking Areas			
	g Color k kt denote	s L	_	aved Routes, DCV Driven	·					Green = All U	inpaved Pa	Irking Areas		
approx. mileage Grey = Paved Routes, DCV not Driven			,	,		= Concessio	n Route Flag	J ON						
				route data was obtained fron ata Collection Vehicle	n NPS and was not inventoried by th NC - Not Collected	e Road Inventory Progra	m (RIP).							
			JCV - L		NC - NOI COllected									
G/	ARI	G	, I II E	Y RIVER NATIONAL R										
			AULL											
Rte.	e	FMSS	is ss		Route Desc	cription	Maint.	Paved	Un- Paved	Total Route	Func.	Manual	Surf.	Are
No.	Cycle Collected	No.	Concess Route	Route Name	From	То	District	Miles	Miles	Length	Class	Rated SQ/FT	Туре	Мар
0976	NC	116138		MASONS BRANCH MIDDLE PARKING AREA	FROM ROUTE 0102 (MASONS BRANCH ACCESS ROAD)	TO PARKING	N/A	0.00	0.00	0.00		4,240	GR	
977	NC	116048		MASONS BRANCH UPPER PARKING AREA	FROM ROUTE 0102 (MASONS BRANCH ACCESS ROAD)	TO PARKING	N/A	0.00	0.00	0.00		9,300	GR	
978	NC	115959		WOODS FERRY OVERFLOW PARKING	FROM ROUTE 0202 (WOODS FERRY ACCESS ROAD)	TO PARKING	N/A	0.00	0.00	0.00		8,200	GR	
979	NC	116045		WOODS FERRY PRIVATE BOATER'S PARKING	FROM ROUTE 0202 (WOODS FERRY ACCESS ROAD)	TO PARKING	N/A	0.00	0.00	0.00		6,325	GR	
980	NC	50600		GAULEY TAILWATERS BONEYARD	FROM STATE ROUTE 129	TO PARKING	N/A	0.00	0.00	0.00		13,500	GR	
981	5			GAULEY	ADJACENT TO 0100		N/A	0.00	0.00	0.00		10,583	AS	1

TAILWATERS

OVERFLOW PARKING

(GAULEY TAILWATERS

ACCESS ROAD)

Road Inventory Progra	•	cle 5 NPS/RI	P Route	ID Report		Page 3 of 4		
Shading Color Key:	White = Paved Routes, DCV Driven	ellow = Unpaved Routes, DCV n	ot Driven Blu	e = All Paved Parking Areas	Green = All Unpaved Parking Area	IS		
Red text denotes approx. mileage	Grey = Paved Routes, DCV not Driven	Black = State, Local or Private nor	n-NPS Routes	= Concession Route Flag ON				
	*Unpaved route data was obtained from NPS and ** DCV - Data Collection Vehicle NC - N	was not inventoried by the Road I ot Collected	nventory Program (RIF	⁵).				
	CYCLE 5 SUMMA	RY TOTALS FOR GA	ULEY RIVER	NATIONAL RECREATION	AREA			
	CYCLE 5 ROUTE TOTALS			CYCLE 5 CONCES	SION TOTALS			
	DCV Driven Route Mi	les 1.20	Concession Paved Route Miles					
	Manually Rated Route M	les 1.09		Conc	ession Unpaved Route Miles	0.00		
т	OTAL PARK ROUTE MILES COLLECTED IN CYCL	E 5 2.29	TOTAL CONCESSION ROUTE MILES			0.00		
	Manually Rated Routes (SQ	FT) 0.00	Concession Paved Parking Area SQ			0		
	TOTAL UNPAVED PARK ROUTE MI	LES 2.20		Concession	Unpaved Parking Area SQFT	0		
				SSION PARKING AREA SQFT	0			
				Concession N	Aanually Rated Routes SQFT	0		
	* CYCLE 5 PARKING AREA TOT	ALS		CYCLE 5 WEIGHTED AVI	ERAGE PARK VALUES			
	Paved Parking (SQ	FT) 10,583			DCV Driven PCR	97		
	Unpaved Parking (SQI	T) 106,112		**	Manually Rated Routes PCR	43		
	TOTAL PARKING (SQI	T) 116,695		**Parking PCR	45			
				***	*Total Equivalent Lane Miles	3.17		

* - The Parking Area Totals SQFT value represents all parking areas collected in Cycle 5, both park and concessionaire.

** - Parking and Manually Rated Routes are assigned the following PCR values based on their observed condition: Construction=-1, Excellent=97, Good=90, Fair=73, and Poor=45.

*** - Equivalent Lane Miles are calculated by route using the following equations : DCV and Manually Rated Lines Routes=(PAVE_WIDTHxPAVED_MI)/11 foot lane. Parking Areas=SQ_FEET/5280/11. Manually Rated Polygons=SQ_FEET/5280/11.

oad Inventory Prog	gram 06/04/2014	Cycle 5 NPS/RIP Rou (Numerical By Route	-	Page
Shading Color Key:	White = Paved Routes, DCV Driven	Yellow = Unpaved Routes, DCV not Driven	Blue = All Paved Parking Areas	Green = All Unpaved Parking Areas
Red text denotes approx. mileage	Grey = Paved Routes, DCV not Driven	Black = State, Local or Private non-NPS Routes	= Concession Route Flag	ON
	•	and was not inventoried by the Road Inventory Progra C - Not Collected	am (RIP).	
	<u>General Park Roa</u>	d Functional Classification Table		Surface Type Abbreviations:
		the main access route, circulatory tour, or thoroughfare for park visi umbered 1 - 9. State Routes Inventoried for Park. Route Numbers 50		AS - Asphaltic Concrete Pavement
				CO - Portland Cement Concrete Pavement
	nds, etc. Route Numbers 100-199.	park to areas of scenic, scientific, recreational or cultural interest, su	ich as overlooks,	BR - Brick or Pavers Road Bed
		n within public areas, such as campgrounds, picnic areas, visitor cen		CB - Cobble Stone Road Bed
concession	aire facilities, etc. These roads generally serve low-speed traffi	c and are often designed for one-way circulation. Route Numbers 20	0-299.	GR - Gravel Road Bed
		ugh remote areas and/or access to primitive campgrounds and unde e limited to specially equipped vehicles. Route Numbers 200-299.	veloped areas. These	SA - Sand Road Bed
	ctional Classes 3 and 4 have the same route numbers because,			NV - Native or Dirt Material Road Bed
	tive Access Road (Administrative Roads) - All public roads inter r utility areas. Route Numbers 400-499.	ded for access to administrative developments or structures such as	park offices, employee	OT - Other Materials Road Bed
Note: Fur	nctional Classes 5 and 6 have the same route numbers because	public, including patrol roads, truck trails, and other similar roads. R historically they were numbered similarly and often there is little dis e often closed to the public, this restriction would result in classificati	tinction between	
an urban a		nigh volumes of park and non-park related traffic and are restricted, arkways which serve as gateways to our nation's capital. Other majo		
		xtensions of the adjoining street system that are owned and maintair epted local engineering practice and local conditions. Route Number		

		r unit of the NPS which are administered by the NPS, or by the Servia ased on traffic volumes or design speed, but on the intended use or f		
nationwide which are des		retive roads, and a 500 series for one-way roads. There are approxin is will be maintained for reporting consistency. However, since these as will be discontinued for future use.		
5000 route numbe	ers are assigned to Non-NPS Routes that are State, County or C	ty owned which border, traverse, or provide access to Park Facilities	or Locations. 5000 Routes	

5000 route numbers are assigned to Non-NPS Routes that are State, County or City owned which border, traverse, or provide access to Park Facilities or Locations. 5000 Routes are driven for GPS and Video Log only.

	ROUTES ADDED FROM PREVIOUS INVENTORY:									
Route #	Route Name	Reason for Addition	Comments							
0102	MASONS BRANCH ACCESS ROAD	OTHER	PAVED ROUTE ADDED TO INVENTORY SINCE CYCLE 3. CONDITION DATA WAS COLLECTED MANUALLY SINCE THE ROAD CAN ONLY BE ACCESSED BY UNPAVED ROADS.							
0981	GAULEY TAILWATERS OVERFLOW PARKING	OTHER	PAVED PARKING AREA ADDED TO THE INVENTORY IN CYCLE 5. FMSS NUMBER NOT AVAILABLE AT THE TIME OF THIS REPORT PUBLICATION.							

Section 3 Park Summary Information





GARI: PAVED ROUTE MILES AND PERCENTAGES BY FUNCTIONAL CLASS AND PCR

	Pavement Condition Rating (PCR)									
	Poor (0-60)		Fair (61-84)		Good (85-94)		Excellent (95-100)		TOTAL	
F.C.	MILES	%	MILES	%	MILES	%	MILES	%	MILES	
1										
2			0.11	9.24%	0.04	3.36%	1.04	87.39%	1.19	
3										
4										
5										
6										
7										
8										
Totals	0.00	0.00%	0.11	9.24%	0.04	3.36%	1.04	87.39%	1.19	


Note: The information in this table is derived from the PMS_20 table in the Park database, which only contains processed data from routes collected with the Data Collection Vehicle (DCV). Information for Manually Rated Routes (MRR) and Parking Areas is not reported in this table. Only Functional Class 1, 2, & 7 routes, and any new routes not previously collected by RIP, are collected in Large Parks.

Explanation of the Excellent, Good, Fair and Poor Condition Descriptions

In addition to the RIP Index changes that have been implemented in Cycle 5, we will also aim to provide greater assistance in translating excellent/good/fair/poor categories into pavement needs categories. The PCR can be used to indicate the place in the Pavement Life Cycle and the types of treatments that should be considered now and into the future.

- Excellent/New: PCR of 95-100. Pavements in this range will require only spot repairs
- Good: PCR of 85-94. Pavements in this range will likely be candidates for Preventive Maintenance. Examples include Chip and Slurry Seals, Micro Surfacing and Thin Overlays.
- Fair: PCR of 61-84. Pavements in this range will likely be candidates of Light Rehabilitation (L3R). Examples include single-lift overlays up to 2.5 inches in total thickness, milling and overlays.
- Poor: PCR of 0-60. Pavements in this range will likely be candidates of Heavy Rehabilitation or Reconstruction (H3R or 4R). Examples include Pulverization, Multiple Lift Overlays, and Reconstruction.

At this time, specific Maintenance and Rehabilitation activities should be evaluated and recommended at the project level. Site-specific conditions that influence treatment type should be determined based on performing a subsurface investigation and/or pavement condition survey, and not be based solely on RIP data. Additionally, RIP produces a snapshot of conditions the year in which the data was collected. For further information or to obtain additional Pavement Management System's data from our Highway Pavement Management Application (HPMA) please contact the Eastern Federal Lands pavement team.

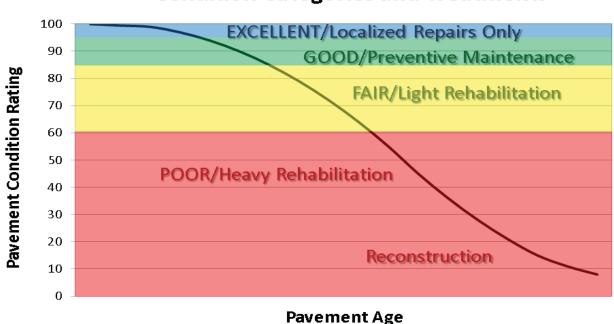


Condition Categories and Treatments

GARI: DCV ROAD CONDITION SUMMARY

DCV - Data Collection Vehicle

NOTE: Route 0102 was given a manual rating due to accessibility issues, so Route 0102 is not being included in the data on the Parkwide DCV Condition Summary page.

					AVERAGE	AVERAGE
					SURFACE	PAVEMENT
ROUTE		FUNCT	PAVED	SURFACE	CONDITION	CONDITION
NUMBER	ROUTE NAME	CLASS	LENGTH	TYPE	RATING (SCR)	RATING (PCR)
0100	GAULEY TAILWATERS ACCESS ROAD	2	1.15	ASPHALT	99	97
0101	HYDROPLANT ROAD	2	0.04	ASPHALT	99	99
0102	MASONS BRANCH ACCESS ROAD	2	1.09	ASPHALT	43	43

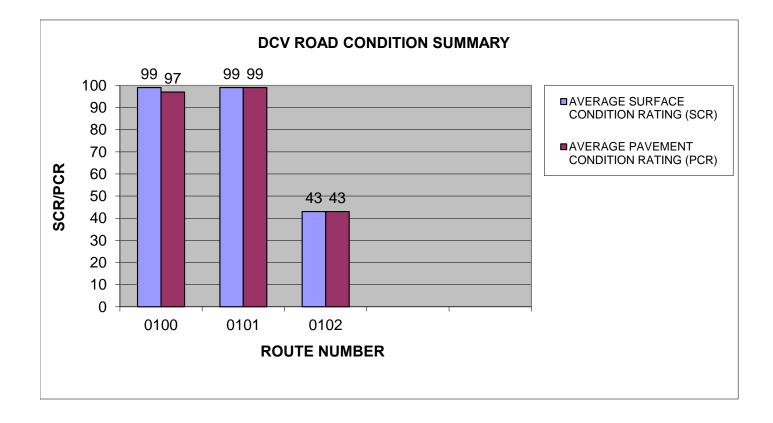


GARI: PARKWIDE DCV CONDITION SUMMARY

AVERAGE	AVERAGE	AVERAGE		AVERAGE	AVERAGE	AVERAGE	
PAVEMENT	ROUGHNESS	SURFACE		ALLIGATOR	LONGITUDINAL	TRANSVERSE	AVERAGE
CONDITION	CONDITION	CONDITION	AVERAGE	CRACKING	CRACKING	CRACKING	PATCHING
RATING (PCR)	INDEX (RCI)	RATING (SCR)	RUT INDEX	INDEX	INDEX	INDEX	INDEX
97	95	99	100	100	99	100	100

All Index values are based on Data Collection Vehicle (DCV) driven roads that were collected in Cycle-5.

Roughness data is only collected on routes with lengths greater than 0.5 miles and a posted speed limit of 25 MPH or greater.

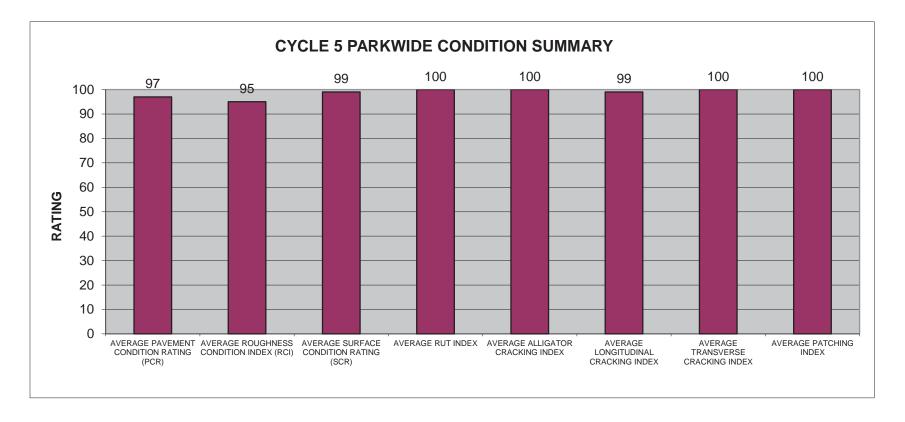


<u>Section 4</u> Park Route Location Maps






Gauley River National Recreation Area Route Location Map Key Map

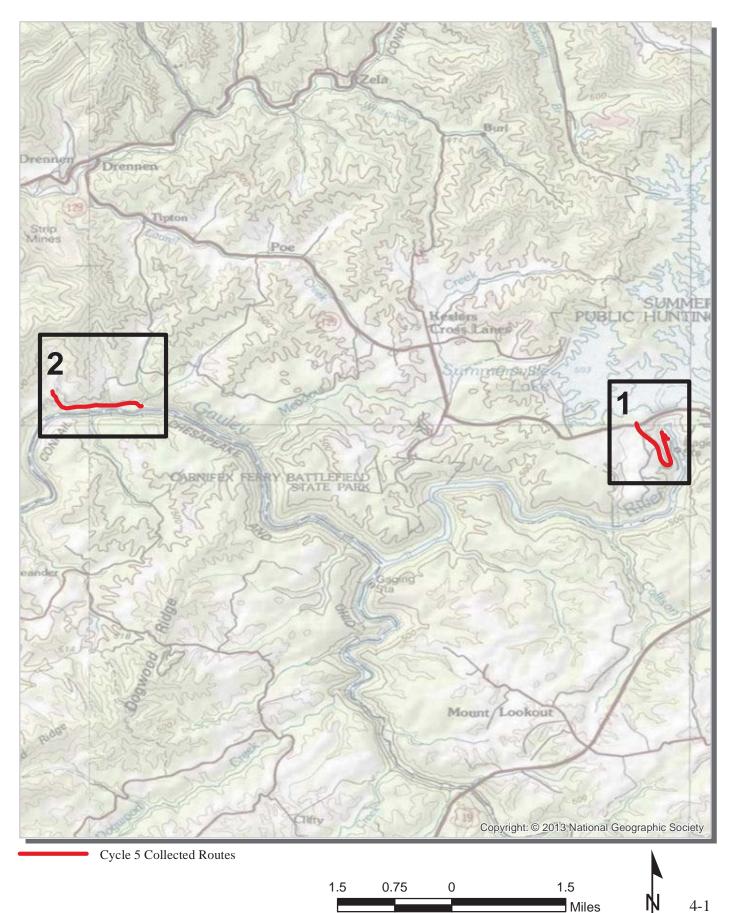


Gauley River National Recreation Area Route Location Map Area 1

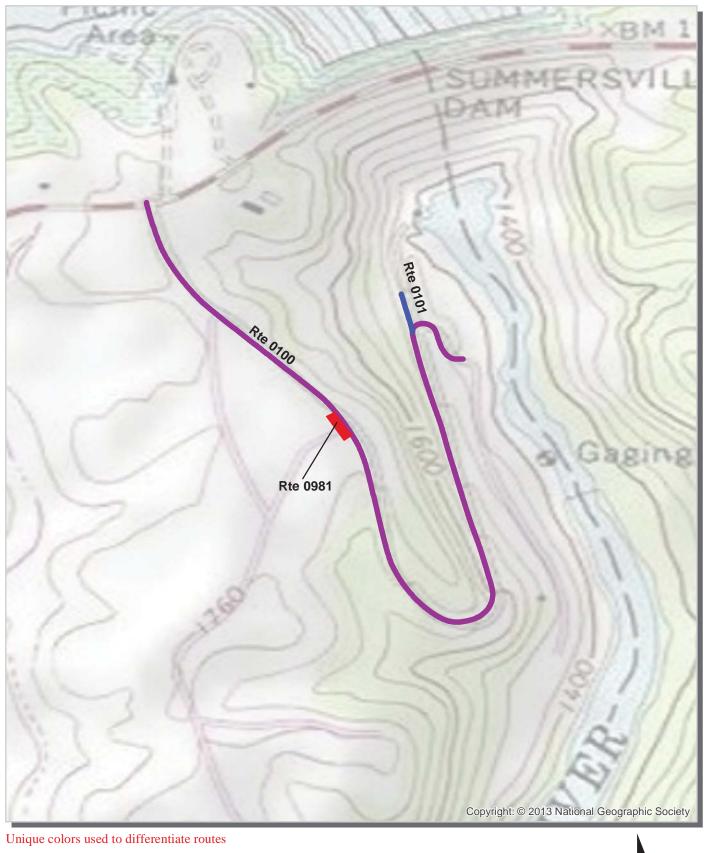




Gauley River National Recreation Area Route Location Map Area 2

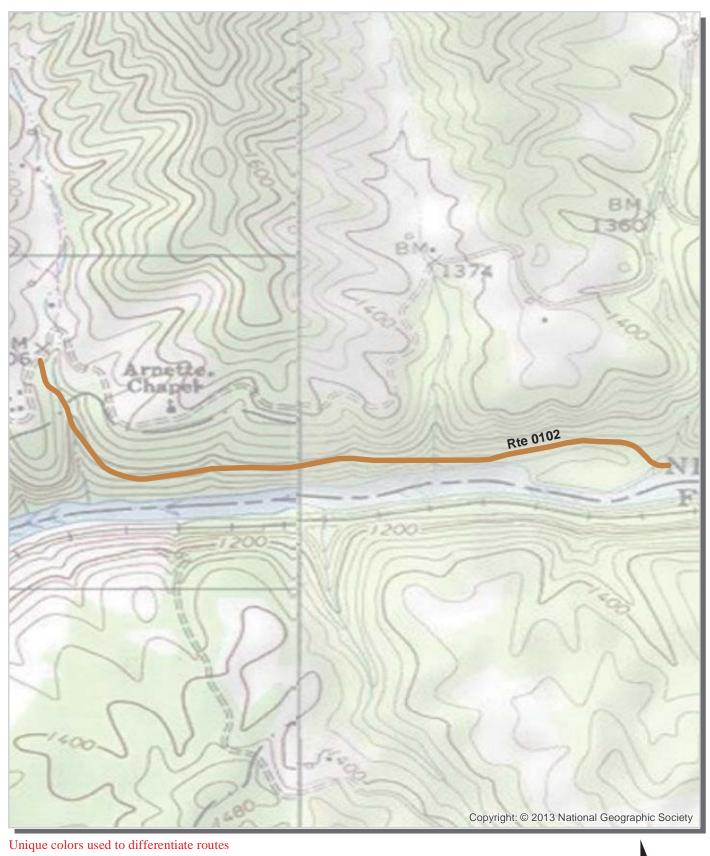




Gauley River National Recreation Area Route Condition Map PCR - Mile by Mile Key Map

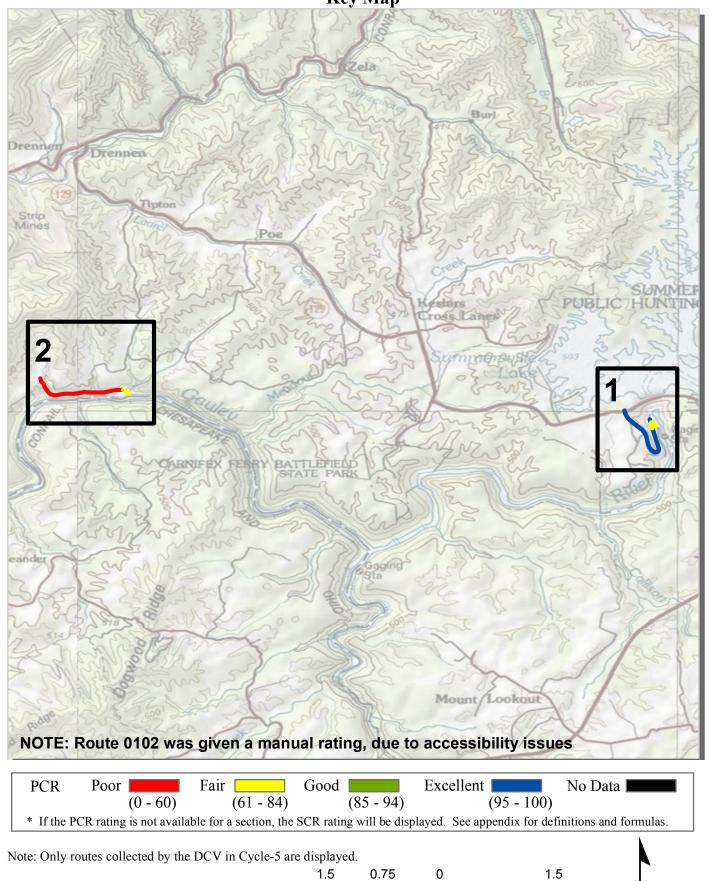


4-4

Miles

Gauley River National Recreation Area Route Condition Map PCR - Mile by Mile Area 1

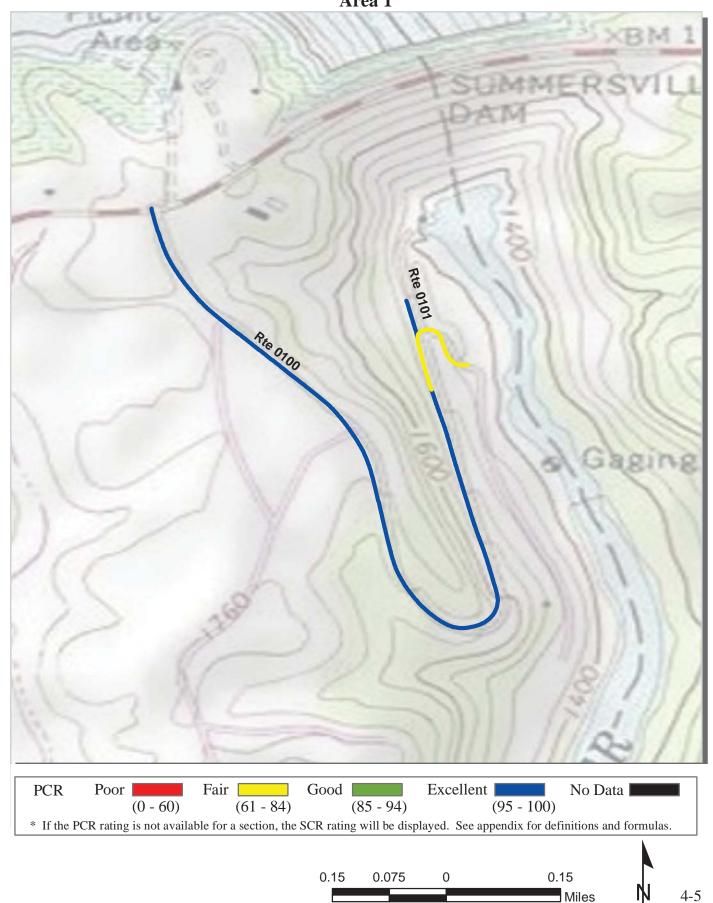


Gauley River National Recreation Area Route Condition Map PCR - Mile by Mile Area 2

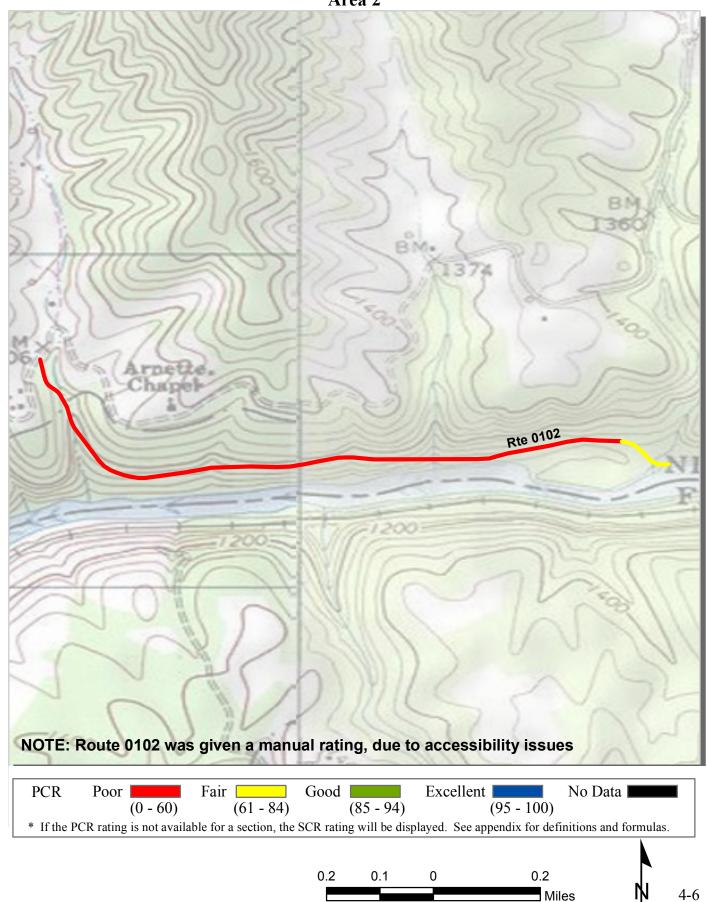

<u>Section 5</u> Paved Route Condition Rating Sheets





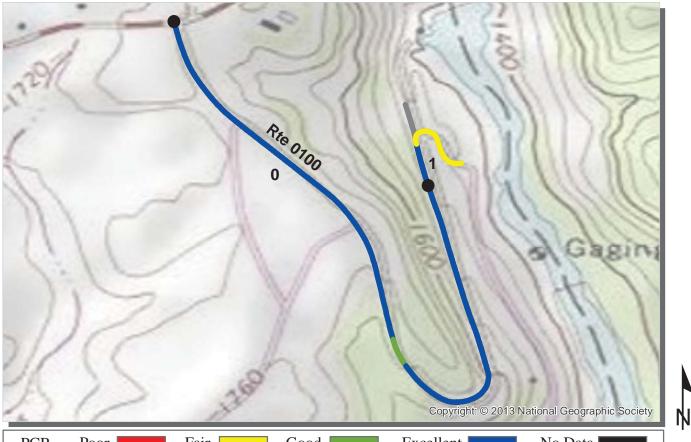

	PCR	Poor		Fair	Good	Excellent	No Data
			(0 - 60)	(61 - 84)	(85 - 94)	(95 - 10)0)
*	If the PCI	R rating i	s not availab	le for a section, the	SCR rating will be di	splayed. See appendix for	or definitions and formulas.

ROUTE: 0100 GAULEY TAILWATERS ACCESS ROAD GARI : GAULEY RIVER NATIONAL RECREATION AREA

			COLLECTED:	11/4/2013
NORTHEAST REGION			TOTAL LENGTH:	1.15 Miles
Section Number	0	1		
Section Length (mi)	1.00	0.15		
Cross Section Information				
Number of Lanes	2	2		
Paved Width (ft)	19	22		
Lane Width (ft)	9	9		
Roadway Condition Information				
SCR (Surface Condition Rating)	99	98		
PCR (Pavement Condition Rating)	99	84		
Distress Index Values				
Structural Crack Index	99	98		
Transverse Cracking Index	100	99		
Patching Index	100	100		
Rutting Index	100	99		
Roughness Condition Index (RCI)	100	63		

NOTES:

Structural Crack Index is a combination of the Longitudinal Cracking Index and Alligator Cracking Index.

See Section 10 for explanation of SCR, PCR, & all Distress Index Values.

0011



PCR	Poor		Fair	Good	Excellent	No Data
		(0 - 60)	(61 - 84)	(85 - 94)	(95 - 10)0)
* If the PC	R rating	is not availal	ble for a section, the	SCR rating will be di	splayed. See appendix for	or definitions and formulas.

ROUTE: 0101 HYDROPLANT ROAD GARI : GAULEY RIVER NATIONAL RECREATION AREA

NORTHEAST I	DECION
NUNTILASI	NEGIUN

COLLECTED: 11/4/2013

NORTHEAST REGION		TOTAL	LENGTH:	0.04 Miles
Section Number	0			
Section Length (mi)	0.04			
Cross Section Information				
Number of Lanes	2			
Paved Width (ft)	17			
Lane Width (ft)	9			
Roadway Condition Information				
SCR (Surface Condition Rating)	99			
PCR (Pavement Condition Rating)	99			
Distress Index Values				
Structural Crack Index	100			
Transverse Cracking Index	100			
Patching Index	100			
Rutting Index	99			
Roughness Condition Index (RCI)	NC			


NOTES:

Structural Crack Index is a combination of the Longitudinal Cracking Index and Alligator Cracking Index.

See Section 10 for explanation of SCR, PCR, & all Distress Index Values.

NC - Not Collected N/A - Not Applicable

ĥ

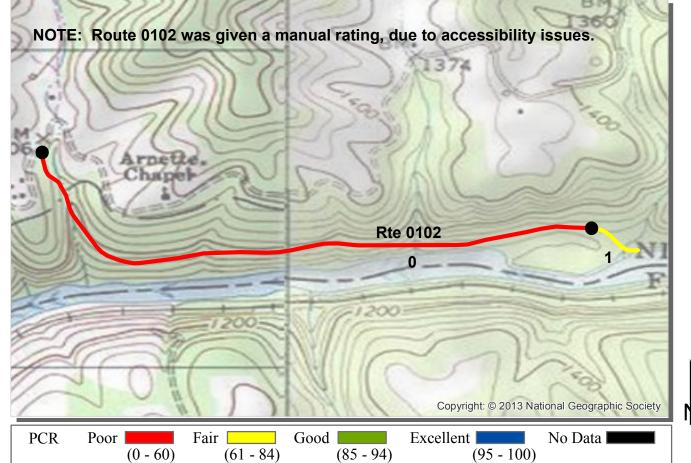

* If the PCR rating is not available for a section, the SCR rating will be displayed. See appendix for definitions and formulas.

COLLECTED

0/=/2012

ROUTE: 0102 MASONS BRANCH ACCESS ROAD GARI : GAULEY RIVER NATIONAL RECREATION AREA

			COLLECTED:	8/5/2013
NORTHEAST REGION			TOTAL LENGTH:	1.09 Miles
Section Number	0	1		
Section Length (mi)	1.00	0.09		
Cross Section Information				
Number of Lanes	1	1		
Paved Width (ft)	9	9		
Lane Width (ft)	9	9		
Roadway Condition Information				
SCR (Surface Condition Rating)	41	63		
PCR (Pavement Condition Rating)	41	63		
Distress Index Values				
Structural Crack Index	41	63		
Transverse Cracking Index	82	90		
Patching Index	59	73		
Rutting Index	59	73		
Roughness Condition Index (RCI)	NC	NC		

NOTES:

Structural Crack Index is a combination of the Longitudinal Cracking Index and Alligator Cracking Index.

See Section 10 for explanation of SCR, PCR, & all Distress Index Values.

NC - Not Collected N/A - Not Applicable

ROUTE: 0102 MASONS BRANCH ACCESS ROAD

Gauley River National Recreation Area GARI-0102 CONDITION PHOTOS



GARI_0102_5028



GARI_0102_5029



GARI_0102_5030



GARI_0102_5031



GARI_0102_5032



GARI_0102_5033

<u>Section 6</u> Manually Rated Paved Route Condition Rating Sheets





MANUALLY RATED ROUTE CONDITION RATING SHEETS

No data available for this section.

<u>Section 7</u> Parking Area Condition Rating Sheets





GAULEY RIVER NATIONAL RECREATION AREA Route 0981

GAULEY TAILWATERS OVERFLOW PARKING ADJACENT TO 0100 (GAULEY TAILWATERS ACCESS ROAD)

Route	Public /				
Number	NonPublic	Date Visited	Area (sq ft)	Lane Miles *	Surface Type
0981	PUBLIC	8/5/2013	10,583	0.18	AS
Culverts	Drop Inlets	Gates	Curb & Gutter	Curb	PCR
			NO CURB AND		
0	0	0	GUTTER	NO CURB	POOR/45

Rie 0700

* Lane miles are based on 11' lane widths








140

70

0

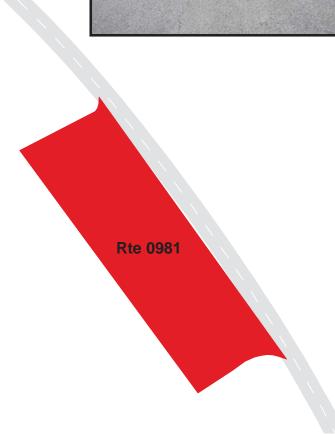

7-1

140

Feet

<u>Section 8</u> Parkwide/Route Maintenance Features Summaries





GARI: PARKWIDE MAINTENANCE FEATURES SUMMARY Includes DCV, MRL, MRP & PKG routes collected in Cycle-5

Notice: Culverts and drop inlets were marked by NPS and inventoried by RIP in Cycle 5 on all DCV driven routes. Culverts and drop inlets were also collected on all Manually Rated Routes and Paved Parking areas. Those totals are reflected below.

FEATURE	LINEAR FEET	COUNT	
BRIDGE		0	
CATTLE GUARD		0	
CULVERT		4	
CURB	0		
DROP INLET		2	
GATE		1	
GUARD/GUIDE RAIL	5,011		
CABLE	0		
NON-CABLE	5,011		
GUARD/GUIDE WALL	0		
BOLLARD	0		
TEMPORARY BARRIER	0		
NON TEMP/BOLLARD	0		
INTERSECTION		13	
LOW WATER CROSSING	0	0	
MILE MARKER		0	
OVERPASS		0	
PARK BOUNDARY		1	
PAVED DITCH	3,685		
PULLOUT	0	0	
RAILROAD CROSSING		0	
RETAINING WALL	0	0	
SIGN		17	
STATE BOUNDARY		0	
TRAFFIC LIGHT		0	
TUNNEL	0	0	
	v	<u> </u>	

GARI: DCV ROUTE MAINTENANCE FEATURES SUMMARY

Notice: Culverts and drop inlets were marked by NPS and inventoried by RIP in Cycle 5.

FEATURE	ROUTE 0100 GAULEY TAILWATERS ACCESS ROAD	ROUTE 0101 HYDROPLANT ROAD	UNIT
BRIDGE	0	0	EACH
CATTLE GUARD	0	0	EACH
CULVERT	1	0	EACH
CURB	0	0	LINEAR FEET
DROP INLET	2	0	EACH
GATE	0	0	EACH
GUARD/GUIDE RAIL	5,011	0	LINEAR FEET
CABLE	0	0	LINEAR FEET
NON-CABLE	5,011	0	LINEAR FEET
GUARD/GUIDE WALL	0	0	LINEAR FEET
BOLLARD	0	0	LINEAR FEET
TEMPORARY BARRIER	0	0	LINEAR FEET
NON TEMP/BOLLARD	0	0	LINEAR FEET
INTERSECTION	8	5	EACH
LOW WATER CROSSING	0	0	EACH
LOW WATER CROSSING	0	0	LINEAR FEET
MILE MARKER	0	0	EACH
OVERPASS	0	0	EACH
PARK BOUNDARY	0	1	EACH
PAVED DITCH	3,685	0	LINEAR FEET
PULLOUT	0	0	EACH
PULLOUT	0	0	LINEAR FEET
RAILROAD CROSSING	0	0	EACH
RETAINING WALL	0	0	EACH
RETAINING WALL	0	0	LINEAR FEET
SIGN	16	1	EACH
STATE BOUNDARY	0	0	EACH
TRAFFIC LIGHT	0	0	EACH
TUNNEL	0	0	EACH
TUNNEL	0	0	LINEAR FEET

STRUCTURE LIST

No data available for this section.

Section 9 Route Maintenance Features Road Logs



Gauley River National Recreation Area



GARI: ROUTE MAINTENANCE FEATURES ROAD LOG ROUTE 0100: GAULEY TAILWATERS ACCESS ROAD

Notice: Culverts and drop inlets were marked by NPS and inventoried by RIP in Cycle 5 on all paved routes.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.000	0.000	ROUTE BEGIN	N/A	FROM STATE ROUTE 129
0.000	0.000	INTERSECTION	RIGHT	STATE ROUTE 129
0.000	0.000	INTERSECTION	LEFT	STATE ROUTE 129
0.006	0.006	SIGN	LEFT	WARNING, GRAPHIC SIGN NO TEXT
0.008	0.008	SIGN	LEFT	REGULATORY, STOP
0.029	0.057	PAVED DITCH	RIGHT	N/A
0.036	0.117	GUARD/GUIDE RAIL	LEFT	N/A
0.038	0.038	SIGN	RIGHT	GUIDE, GAULEY RIVER NATIONAL RECREATION AREA
0.062	0.062	INTERSECTION	RIGHT	PAVED ROUTE
0.089	0.089	SIGN	RIGHT	REGULATORY, SPEED LIMIT 35
0.090	0.113	GUARD/GUIDE RAIL	RIGHT	N/A
0.107	0.107	SIGN	RIGHT	GUIDE, TAILWATER AREA OPEN 6:00 AM CLOSED 10:00 PM EXCEPT FOR CAMPGROUND
0.130	0.130	SIGN	RIGHT	GUIDE, CAMPING IN DESIGNATED AREAS ONLY
0.203	0.342	GUARD/GUIDE RAIL	LEFT	N/A
0.360	0.360	INTERSECTION	RIGHT	ROUTE 0981 (GAULEY TAILWATERS OVERFLOW PARKING)
0.362	0.362	INTERSECTION	LEFT	UNPAVED ROUTE
0.419	1.069	GUARD/GUIDE RAIL	RIGHT	N/A
0.475	0.475	SIGN	RIGHT	REGULATORY, SPEED LIMIT 25
0.476	0.476	SIGN	LEFT	REGULATORY, SPEED LIMIT 35
0.501	1.058	PAVED DITCH	LEFT	N/A
0.598	0.598	DROP INLET	LEFT	N/A
0.718	0.790	PAVED DITCH	RIGHT	N/A
0.728	0.728	DROP INLET	LEFT	N/A
0.999	0.999	SIGN	RIGHT	REGULATORY, SPEED LIMIT 15
1.020	1.020	SIGN	RIGHT	GUIDE, GAULEY RIVER NRA
1.042	1.042	SIGN	LEFT	REGULATORY, SPEED LIMIT 25
1.063	1.063	SIGN	RIGHT	REGULATORY, EXCEPT WHEN TURNING RIGHT
1.063	1.063	SIGN	RIGHT	REGULATORY, STOP
1.066	1.079	GUARD/GUIDE RAIL	LEFT	N/A

GARI: ROUTE MAINTENANCE FEATURES ROAD LOG ROUTE 0100: GAULEY TAILWATERS ACCESS ROAD

Notice: Culverts and drop inlets were marked by NPS and inventoried by RIP in Cycle 5 on all paved routes.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
1.074	1.074	SIGN	N/A	REGULATORY, DANGER WHEN HORN SOUNDS BEWARE OF RAPID RISE IN WATER LEVEL
1.080	1.080	INTERSECTION	LEFT	ROUTE 0101 (HYDROPLANT ROAD)
1.089	1.132	GUARD/GUIDE RAIL	LEFT	N/A
1.104	1.145	PAVED DITCH	RIGHT	N/A
1.146	1.146	SIGN	RIGHT	REGULATORY, SPEED LIMIT 15
1.150	1.150	CULVERT	N/A	N/A
1.152	1.152	INTERSECTION	LEFT	ROUTE 0900 (GAULEY TAILWATERS PARKING AREA)
1.152	1.152	SIGN	N/A	WARNING, WARNING WHEN HORN SOUNDS BEWARE OF RAPID RISE IN WATER LEVEL
1.152	1.152	INTERSECTION	RIGHT	ROUTE 0200 (GAULEY TAILWATERS CAMPGROUND ROAD)
1.152	1.152	ROUTE END	N/A	TO ROUTE 0200 (GAULEY TAILWATERS CAMPGROUND ROAD) AND ROUTE 0900 (GAULEY TAILWATERS PARKING AREA)

GARI: ROUTE MAINTENANCE FEATURES ROAD LOG ROUTE 0101: HYDROPLANT ROAD

Notice: Culverts and drop inlets were marked by NPS and inventoried by RIP in Cycle 5 on all paved routes.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.000	0.000	ROUTE BEGIN	N/A	FROM ROUTE 0100 (GAULEY TAILWATERS ACCESS ROAD)
0.000	0.000	INTERSECTION	N/A	ROUTE 0100 (GAULEY TAILWATERS ACCESS ROAD)
0.000	0.000	INTERSECTION	RIGHT	ROUTE 0100 (GAULEY TAILWATERS ACCESS ROAD)
0.006	0.006	SIGN	LEFT	REGULATORY, STOP
0.024	0.024	INTERSECTION	RIGHT	ROUTE 0971 (GAULEY TAILWATERS ROAD UPPER PARKING AREA)
0.040	0.040	INTERSECTION	RIGHT	ROUTE 0972 (GAULEY TAILWATERS RIVER ACCESS PARKING AREA)
0.043	0.043	INTERSECTION	N/A	PAVED ROUTE (HYDROPLANT ACCESS ROAD / NON NPS)
0.043	0.043	PARK BOUNDARY	N/A	N/A
0.043	0.043	ROUTE END	N/A	TO PARK BOUNDARY / GATE

Section 10 Appendix



Gauley River National Recreation Area



Explanation of Changes to the RIP Index Equations and Determination of PCR

In 2005, the FHWA began implementing the use of a Pavement Management System to assist the National Park Service in prioritizing Pavement Maintenance and Rehabilitation activities. The PMS used by FHWA is the Highway Pavement Management Application (HPMA) and this software has the ability to store inventory and condition data from RIP and forecast future performance using prediction models. Outputs include performance and condition reports at the National, Region, Park, or Route level. A regional prioritized list and optimization have been produced for most regions and the Federal Highway Deferred Maintenance is calculated via the HPMA as well.

In an effort to improve the accuracy of treatment recommendations and pavement condition descriptions in relation to the distresses and indexes that comprise the Pavement Condition Rating (PCR), an extensive study was completed throughout 2010 that resulted in changes to the Road Inventory Program condition reporting method and specifically, the calculation of PCR. It was determined that a better representation of PCR could be achieved by modifying the relative impact certain distresses would have on the overall rating.

Through the use of HPMA data, it was noted that false failure indicators existed with the existing PCR model, and that it would be necessary to reduce their impact. The distresses affected in this way were Rutting and Roughness. Conversely, experience showed that roadways with extensive cracking present were often shown to have a high PCR. Therefore, the crack index models were adjusted to be more sensitive to changes in crack severity or quantity. It was also determined that these issues were not due to a problem with data acquisition (i.e. the RIP "van"), but with the way the collected data was processed. The final change was to provide guidance on when to use the Roughness Condition Index (RCI) in the PCR calculation. Roughness data is of little value to determining overall condition on routes that, due to their length or geometrics, have lower vehicle operating speeds. Therefore, in Cycle 5, only routes that have lengths of one half mile or greater and posted speed limits of 25 mph or greater will have RCI reported and included in the PCR calculations.


The changes that were implemented were endorsed by management at both the FHWA and NPS. In order to show the effectiveness of these changes, several sites were ground truth tested to ensure that an improvement was achieved between the relationship of PCR and the actual Maintenance and Rehabilitation needs that were represented. These changes will allow greater use of RIP and HPMA data for not simply condition data reporting, but also as a reliable tool for project identification and selection.

Explanation of the Excellent, Good, Fair and Poor Condition Descriptions

In addition to the RIP Index changes that were implemented in Cycle 5, we will provide greater assistance in translating good/fair/poor categories into pavement needs categories. The PCR can be used to indicate the place in the Pavement Life Cycle and the types of treatments that should be considered now and into the future.

- Excellent/New: PCR of 95-100. Pavements in this range will require only spot repairs.
- Good: PCR of 85-94. Pavements in this range will likely be candidates for Preventive Maintenance. Examples include Chip and Slurry Seals, Micro Surfacing and Thin Overlays.
- Fair: PCR of 61-84. Pavements in this range will likely be candidates of Light Rehabilitation (L3R). Examples include single-lift overlays up to 2.5 inches in total thickness, milling and overlays.
- Poor: PCR of 60 or below. Pavements in this range will likely be candidates of Heavy Rehabilitation or Reconstruction (H3R or 4R). Examples include Pulverization, Multiple Lift Overlays, and Reconstruction.

Specific Maintenance and Rehabilitation activities should be evaluated and recommended at the project level. Site-specific conditions that influence treatment type should be determined based on performing a subsurface investigation and/or pavement condition survey, and not be based solely on RIP data. Additionally, RIP produces a snapshot of conditions the year in which the data was collected. For further information or to obtain additional Pavement Management System's data from our Highway Pavement Management Application (HPMA) please contact the Eastern Federal Lands pavement team.

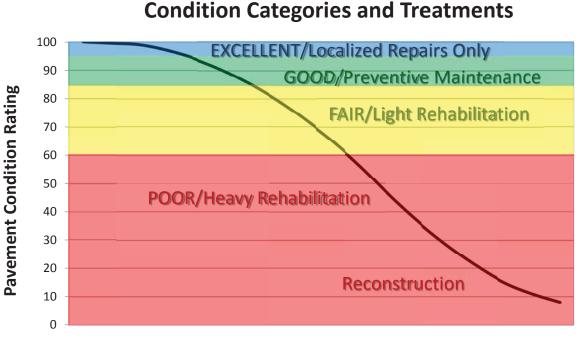

Pavement Age

DESCRIPTION OF RATING SYSTEM

The Federal Highway Administration (FHWA), National Park Service Road Inventory Program (NPS-RIP), collects condition data on paved roads, parkways, and parking areas in park units nationwide. Road surface condition data is collected using an automated Data Collection Vehicle (DCV). Roads having brick, cobblestone, or wood surfaces are not normally surveyed with the DCV, but are manually rated for the purpose of assigning a condition rating. Unpaved roads, parkways, and parking areas are not currently being evaluated for condition. Paved campground pads and driveways are also not currently being evaluated for condition.

The FHWA RIP is implemented based on the premise that an accurate pavement surface condition assessment can be accomplished using automated crack detection technology as applied to digital images. Various methods of pavement condition assessment have been developed over the years with varying degrees of accuracy and acceptance. The use of digital photography to record pavement images and subsequent crack detection and classification has undergone continuous improvements over the past decade. Digital cameras with increasingly superior resolution and high definition have been more affordable, and the proprietary programming code and algorithms have been improved in crack detection software.

With the use of high quality digital photography and automated crack detection software, FHWA RIP is tasked with executing a pavement condition assessment on about 5000 miles of National Park Service roads and parkways. Foremost in setting up the basis of pavement distress identification is employing the distress identification protocols used by FHWA. There is no single distress identification system that is universal among entities conducting a program of distress identification. For the purpose of the NPS-RIP, FHWA employs distress identification protocols that are specific to this program.

FHWA has referenced the "Distress Identification Manual for the Long-Term Pavement Performance Program", Publication No. FHWA-RD 03-031, June 2003, as the point-ofreference for distress types on NPS pavement. The FHWA RIP distress types are similar to those described in the LTPP manual with some modifications. The document, "Distress Identification Manual for the NPS Road Inventory Program, Cycle 5, 2010-2013" was developed using the "Distress Identification Manual for the Long-Term Pavement Performance Program" as a guideline. Definitions of severity levels based on crack width contained in this document adhere to the LTPP Distress ID Manual. Modifications have been made to the definition of Alligator and Longitudinal Cracking and determination of Alligator Cracking severity. This manual also addresses Rutting and Roughness and its application to NPS-RIP.

In 2010, FHWA RIP began the fifth cycle of data collection in national parks. For Cycle 5, data will be collected in approximately 81 large parks (10 or more paved route miles) on Functional Class 1, 2, and 7 routes plus any new routes or parking areas previously not collected, totaling an estimated 4,459 paved route miles. Additionally, 231 small parks will be collected comprising approximately 529 paved route miles and associated paved parking areas. The data is used to support the National Park Service road maintenance program and Pavement Management System (PMS) developed and maintained by FHWA.

This "Distress Identification Manual for the NPS Road Inventory Program, Cycle 5, 2010-2013" will be used as a reference resource in crack detection and classification, determination of distress severity and extent, and in the calculation of distress index values for the FHWA RIP Cycle 5.

SURFACE DISTRESSES

Surface Condition Rating - SCR

Surface distresses are measured in the primary lane only. In the classification and measurement of all paved surface condition data, results will be reported in the database in record intervals of 0.02 miles (105.6 feet) (smallest granularity) along the route.

Surface distresses determined from digital images

- Transverse Cracks
- Longitudinal Cracks
- Alligator Cracks
- Patching/Potholes

Surface distress measured by DCV (Data Collection Vehicle) LRMS (Laser Rut Measuring System)

• Rutting

Each of the five surface distresses is assigned a computed surface distress index

- Transverse Crack Index
- Longitudinal Crack Index
- Alligator Crack Index
- Patching/Pothole Index
- Rutting Index

Surface distress data are classified as listed above, measured for severity, and quantified for extent. Classification, severity, and extent of these five surface distresses comprise the three main elements for calculation of SCR (Surface Condition Rating).

In addition to the five surface distresses, a **Structural Crack Index** is computed, which is a combination of the Longitudinal Crack Index and the Alligator Crack Index. The Structural Crack Index is then used in lieu of the LC and AC indices to compute SCR.

Roughness Condition Index - RCI

Additional condition data measured by DCV (lasers and accelerometers)

• Roughness (IRI)

Roughness is measured by FHWA's DCV and reported as International Roughness Index (IRI) in inches/mile. Using IRI, the Roughness Condition Index (RCI) is computed.

Pavement Condition Rating - PCR

Using the SCR (computed from the five surface distresses) and the RCI, an overall Pavement Condition Rating (PCR) is computed. The formula for PCR is:

Asphalt PCR = (0.60 * SCR) + (0.40 * RCI)Concrete PCR = RCI

A detailed description of each distress index formula, roughness index formula, SCR and PCR is provided in this document beginning on page 8.

Each classified surface distress will fall into one or more *severity*...LOW, MEDIUM, or HIGH based on criteria listed. For each severity, an *extent* is established based on the measured quantity of the distress within that severity. Within each *severity* individual distresses are assigned a *Maximum Allowable Extent* (MAE). For example, LOW severity transverse cracking may be allowed up to 21.1 cracks within a 0.02 interval before it reaches MAE and fails.

The index formulas are based on a scale of 0-100. A PCR index value of 100 would indicate a "new" road with no measurable distresses or rough ride. A PCR value of 60 is determined to be *terminable serviceability* and the road is considered failed. The range of index values with condition descriptors is:

POOR (<=60), FAIR (61 - 84), GOOD (85 - 94), EXCELLENT (95 - 100)

Index values are generally computed based on cumulative deducts of the measured severities. As shown in the index formulas below, as any single severity reaches or exceeds MAE, the index computes to a value of 60 or less, and the road fails for that 0.02 interval.

Note: As a result of a unique combination of measured surface distresses and IRI, index values occasionally compute to less than 0 or greater than 100. In this instance, an index value < 0 defaults to 0. Index values > 100 default to 100. For all indices, a higher value indicates a better road condition, and a lower value indicates a poorer road condition.

On the following page, Table 1 summarizes the different types of distresses measured.

ASPHALT-SURFACED PAVEMENT DISTRESS TYPES with RUTTING and ROUGHNESS				
DISTRESS TYPE	UNIT OF MEASURE	CONVERTED TO	DEFINED SEVERITY LEVELS?	MEASURED BY
Alligator Cracking	Square Feet	Percent of Lane Per 0.02 Mile	Yes	Digital Image Crack Detection Software
Transverse Cracking	Linear Feet	Number of Cracks Per 0.02 Mile	Yes	Digital Image Crack Detection Software
Longitudinal Cracking	Linear feet	Percent of Lane Length Per 0.02 Mile	Yes	Digital Image Crack Detection Software
Patching/Potholes	Square Feet	Percent of Lane Per 0.02 Mile	No	Digital Image Crack Detection Software
Rutting	Inches	Rut Depth Per 0.02 Mile	Yes	DCV – Laser Rut Measuring System (LRMS)
Roughness	IRI	*RCI Per 0.02 Mile	No	DCV – Lasers /Accelerometers

*Note: Roughness is measured on concrete roadways, but surface distresses and rutting are not measured. For concrete, PCR = RCI

ALLIGATOR CRACKING

Description

Alligator cracking is considered a combination of fatigue and block cracking. It is a series of interconnected cracks in various stages of development. Alligator cracking develops into a many-sided pattern that resembles chicken wire or alligator skin. It can occur anywhere in the road lane. Alligator cracking must have a quantifiable area.

Severity Levels

LOW

An area of cracks with no or very few interconnecting cracks and the cracks are not spalled. Cracks are ≤ 0.25 in (6mm) in mean width. Cracks in the pattern are no further apart than 1 foot (0.328 m). May be sealed cracks with sealant in good condition and a crack width that cannot be determined.

MEDIUM

An area of interconnected cracks that form a complete pattern. Cracks may be slightly spalled. Cracks are >0.25 in. (6 mm) and <= 0.75 in. (19 mm) or any crack with a mean width <= 19 mm and adjacent low severity cracking. Cracks in the pattern are no further apart than 6 in. (150 mm).

HIGH

An area of interconnected cracks forming a complete pattern. Cracks are moderately or severely spalled. Cracks are >0.75 in (19mm) or any crack with a mean width <= 0.75 in (19mm) and adjacent medium to high severity random cracking.

A combination of observed crack width and crack pattern is used to determine overall severity of alligator cracking. Based on above description of each severity, the highest level of crack width and crack pattern determines overall severity. Table 2 illustrates this.

ALLIGATOR CRACKING SEVERITY LEVELS		Crack Pattern		
		LOW	MED	HIGH
	LOW	L	М	Н
ack	MED	М	М	Н
Cr.	HI	Н	Н	Н

TABLE 2: Alligator Crack Severity Levels

LONGITUDINAL CRACKING

Description

Longitudinal cracking occurs predominantly parallel to the pavement centerline. It can occur anywhere within the lane. Longitudinal cracks occurring in the wheelpath may be noteworthy.

Severity Levels

LOW

Cracks with a mean width of < 0.25 in. (6 mm). Sealed cracks with sealant in good condition and a width that cannot be determined.

MED

Cracks with a mean width > 0.25 in. (6 mm) and <= 0.75 in. (19 mm). Also, any crack with a mean width < 0.75 in. (19 mm) and adjacent random low severity cracking.

HIGH

Cracks with a mean width > 0.75 in. (19 mm). Also, any crack with a mean width < 0.75 in. (19 mm) and adjacent random medium to high severity cracking.

TRANSVERSE CRACKING

Description

Transverse cracking occurs predominantly perpendicular to the pavement centerline. It can occur anywhere within the lane.

Severity Levels

LOW

Cracks with a mean width of < 0.25 in. (6 mm). Sealed cracks with sealant in good condition and a width that cannot be determined.

MED

Cracks with a mean width > 0.25 in. (6 mm) and <= 0.75 in. (19 mm). Also, any crack with a mean width < 0.75 in. (19 mm) and adjacent random low severity cracking.

HIGH

Cracks with a mean width > 0.75 in. (19 mm). Also, any crack with a mean width < 0.75 in. (19 mm) and adjacent random medium to high severity cracking.

PATCHING AND POTHOLES

Description

Patching is an area of pavement surface that has been removed and replaced with patching material or an area of pavement surface that has had additional patching material applied. Patching may encompass partial-lane or full-lane width. On full-lane width patching; the total, contiguous length of a patch may not exceed 0.30 mi. (0.48 km). Any full-lane width patch exceeding 0.30 mi. in length is considered a pavement change, not a patch for the purposes of distress analysis. Patching must have a quantifiable area.

Potholes are bowl-shaped holes of various sizes occurring in the pavement surface.

Severity Levels

There are no stratified severities for Patching/Potholes. They either are present or they are not.

RUTTING

Description

Rutting is a longitudinal surface depression in the wheelpath.

Severity Levels

LOW Ruts with a measured depth ≥ 0.20 " and ≤ 0.49 "

MED Ruts with a measured depth ≥ 0.50 " and ≤ 0.99 "

HIGH

Ruts with a measured depth ≥ 1.00 "

Ruts < 0.20" are not included in the distress calculations.

ROUGHNESS

Description

Roughness is the measurement of the unevenness of the pavement in the direction of travel. It is measured in units of IRI (International Roughness Index), inches per mile, and is indicative of ride comfort.

Severity Levels

There are no stratified severity levels for roughness. The roughness (or smoothness) of a road surface can be defined by IRI in the following table.

TABLE 3: IRI	
IRI Descriptions	
Type of Road	Typical IRI (in/mile)
New Road, no noticeable roughness	<90
Small level of roughness	90 - 126
Road of average roughness	126 – 190
Road with above average roughness	190 – 253
Road with severe roughness	253 - 380
Nearly impassable	>380

INDEX FORMULAS

Note: All index formulas listed below contain MAE applicable to 0.02 mile (105.6 feet) interval.

Alligator Crack Index

 $AC_INDEX = 100 - 40 * [(\% LOW / 35) + (\% MED / 15) + (\% HI / 5)]$

Where:

The values %LOW, %MED and %HI report the percentage of the observed pavement (0.02 mile, primary lane) that contains alligator cracking within the respective severities. These values range from 0 to 100.

%LOW = Percent of total area (primary lane, 0.02 in length), low severity %MED = Percent of total area (primary lane, 0.02 in length), medium severity %HI = Percent of total area (primary lane, 0.02 in length), high severity

Percent of total area is computed as:

square foot area of alligator crack severity 0.02 mile * lane width

In AC_INDEX, the denominators 35, 15, and 5 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 35% of low severity alligator cracking for a 0.02 interval before failure, 15% for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Longitudinal Crack Index

 $LC_{INDEX} = 100 - 40 * [(\%LOW / 175) + (\%MED / 75) + (\%HI / 25)]$

Where:

The values %LOW, %MED, and %HI report the length of longitudinal cracking within each severity as a percent of the section length (0.02 mile, primary lane). These values are ≥ 0 and can exceed 100.

%LOW = Percent of interval length (primary lane, 0.02 in length), low severity %MED = Percent of interval length (primary lane, 0.02 in length), medium severity %HI = Percent of interval length (primary lane, 0.02 in length), high severity

Percent of interval length is computed as: <u>length of respective longitudinal cracking</u> 0.02 mile (105.6 feet) In LC_INDEX, the denominators 175, 75, and 25 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 175% of low severity alligator cracking for a 0.02 interval before failure, 75% for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Structural Crack Index

 $SC_{INDEX} = [100 - ((100 - AC_{INDEX}) + (100 - LC_{INDEX}))]$

Structural Crack Index is a combination of Alligator Cracking and Longitudinal Cracking, and is used in the SCR formula in lieu of AC and LC separately.

Transverse Crack Index

 $TC_INDEX = 100 - 40 * [(LOW / 21.1) + (MED / 4.4) + (HI / 2.6)]$

Where:

The values *LOW*, *MED* and *HI* report a count of the total number of transverse cracks (reported to three decimals) within each severity level, where one transverse crack is equal to the lane width. These values are ≥ 0 .

LOW = Number of cracks in interval (primary lane, 0.02 in length), low severity MED = Number of cracks in interval (primary lane, 0.02 in length), medium severity HI = Number of cracks in interval (primary lane, 0.02 in length), high severity

Number of cracks is computed as: <u>Total length of transverse cracks</u> Lane width

In TC_INDEX, the denominators 21.1, 4.4, and 2.6 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 21.1 low severity transverse cracks for a 0.02 interval before failure, 4.4 cracks for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Patching Index

PATCH_INDEX = 100 - 40 * (% PATCHING / 80)

Where:

The value *%PATCHING* reports the percentage of the observed pavement (0.02 mile, primary lane) that contains patching/potholes. This value ranges from 0 to 100.

%PATCHING = Percent of total area (primary lane, 0.02 in length)

Percent of total area is computed as:

square foot area of patching/potholes 0.02 mile * lane width

There are no severity levels for patching. It either exists or does not.

In PATCH_INDEX, the denominator 80 is the Maximum Allowable Extent (MAE) for each severity. In other words, we will allow up to 80% patching for a 0.02 interval before failure. As you can see, if patching/potholes reaches MAE the resulting index value is 60, or failure.

Rutting Index

RUT_INDEX = 100 - 40 * [(% LOW / 535) + (% MED / 205) + (% HI / 40)]

Where:

20 rut depth measurements are taken per 0.02 interval for each of 2 wheel paths (left and right), resulting in a total of 40 measurements taken for both wheel paths. *Each wheelpath is analyzed independently for rut severities*. The values %*LOW*, %*MED* and %*HI* are a *total percentage* of left wheelpath percentage and right wheelpath percentage added together for the respective severity. These values range from 0 to 200.

%LOW = Percent of LOW ruts in left wheelpath based on 20 ruts, plus percent of LOW ruts in right wheelpath based on 20 ruts.

%MED = Percent of MED ruts in left wheelpath based on 20 ruts, plus percent of MED ruts in right wheelpath based on 20 ruts.

%HI = Percent of HI ruts in left wheelpath based on 20 ruts, plus percent of HI ruts in right wheelpath based on 20 ruts.

Percent of rut measurements within each severity can also be computed as:

In RUT_INDEX, the denominators 535, 205, and 40 are the Maximum Allowable Extents for each severity. In other words, the formula allows up to 535% low severity

ruts for a 0.02 interval before. However, since 200 is the highest measurable percentage allowed, 535% is unattainable and therefore, no amount of LOW severity rutting will cause the RUT_INDEX to fail a road. Similarly, since the MAE for MED severity rutting is 205, no amount of MED severity rutting will cause the RUT_INDEX to reach 60 and fail the road. As you can see, LOW severity rutting reaches MAE the resulting index value is 60, or failure. This formula was intentionally designed to minimize the impact of LOW and MED severity rutting on RUT_INDEX.

Roughness Condition Index (Asphalt)

$$\mathbf{RCI} = 32 * [5 * (2.718282 \land (-0.0041 * AVG IRI))]$$

Where:

The value *AVG IRI* reports the average value of the Left IRI and Right IRI measurements for the interval (0.02 mile, primary lane). This value can range from approximately 40 to 999.0.

Average IRI is computed as:

Left wheelpath IRI + Right wheelpath IRI 2

There is no applicable threshold for failure for this index.

Roughness Condition Index (Concrete)

 $\mathbf{RCI} = -0.0012(\mathrm{IRI}^2) + 0.0499(\mathrm{IRI}) + 99.542$

For concrete, PCR = RCI

Surface Condition Rating Index

SCR = *Lowest* Index Value Of: [SC_INDEX, TC_INDEX, PATCH_INDEX, RUT_INDEX]

Note: The modified SCR equation above combines AC_INDEX and LC_INDEX, and considers that a single AC/LC index value of the Structural Crack Index (SC_INDEX). The lowest of the four computed index values (SC_INDEX, TC_INDEX, PATCH_INDEX, or RUT_INDEX) becomes the SCR.

Where:

See above for determinations of SC_INDEX, TC_INDEX, PATCH_INDEX and RUT_INDEX.

The threshold for failure for this index is SCR = 60.

Data Collection Vehicle Subsystems

Data on paved roads in Cycle 5 is collected by FHWA using a Pathway Services Inc. Data Collection Vehicle (DCV), called PathRunner. The DCV is driven in the primary-direction lane at posted speed limits and less.

CAMERAS

Forward-facing and rear-facing video is collected as .jpg digital imagery at a frequency of 26.4 feet.

Two forward-facing cameras are mounted above the vehicle cab, one pointed straight ahead and the other to the right shoulder providing seamless 120 degree viewing.

CAMERA SPECIFICATIONS	
Two Forward/ One Rear Facing	
Camera lens/type	FUJINON CCTV LENS H16x10B-Y41
Focal length	10 mm – 160 mm
Image size	8.8 mm x 6.6mm
Image format	*.jpg
Image resolution	HD 2000 X 1200
Image pixel size	depends on distance
Zoom ratio	16x
Max Relative Aperture	1:2.5
Iris range	F25-T800 (Equivalent to F800)

Pavement images are created using a Laser Scan Imaging System. This system is composed of a single high resolution line-scan camera and two lasers configured to image an approximate 11-foot wide lane with 1 mm resolution.

CAMERA SPECIFICATIONS Pavement Line Scan	
Image size	4280 pixels/line
Image width	4 meters (3950 mm nominal)
Laser class	3B
Power	250W
Vehicle speed limitations	62 mph
Environment	Dry pavement, day or night
Sensor size (approx)	300 mm(H) x 375 mm(L) x 200 mm(D)
Image frame length	26.4 feet

DMI (Distance Measuring Instrument)

The DMI (Distance Measuring Instrument) obtains road length measurements that are accurate to 0.1% for speeds up to 60 mph. The DMI is connected to the hub of the rear wheel on the driver's side, and is calibrated to the revolutions of the rear vehicle axle on a regular basis.

ROUGHNESS (IRI)

The collection system includes a South Dakota type laser profiler manufactured based on active Class 1 ASTM E950 standards. The dynamic profile of the pavement surface is collected from which the IRI roughness data is computed. The sensors include one accelerometer on each wheelpath, one height sensor (laser) on each wheelpath, and a distance transducer.

IRI SPECIFICATIONS	
Reported IRI units	Inches/mile
Vehicle speed limitations	12-62 mph
IRI equipment certification	Texas Transportation Institute (TTI)
Wavelengths accommodated	6 in. – 300 feet
IRI computed & reported	World Bank Technical Paper Number 46
Environment	Dry pavement, day or night, above 32 degrees F
Adherence to specifications	ASTM E950-98 (2004), ASTM E 1926-08,
	AASHTO MP 11-08, AASHTO PP 49-08

RUTTING

Rutting depths are measured using an INO Laser Rut Measurement System (LRMS). This system is a transverse profiling device that detects and characterizes pavement rutting. The LRMS can acquire full 4 meter width profiles of a pavement lane at normal traffic speeds and uses two laser profilers that digitize transverse sections of the pavement.

RUTTING SPECIFICATIONS	
Reported rut depth units	Inches
Vehicle speed limitations	Up to 62 mph
Sampling rate	30-150 profiles/second
Transverse resolution	1280 points/profile
Transverse field-of-view	4 m
Depth accuracy (nominal)	+/- 1 mm
Environment	Dry pavement, day or night, above 32 degrees F
Adherence to specifications	ASTM E1703M-95 (reapproved 2005)

GPS & INERTIAL SYSTEMS

GPS is collected by an onboard system employing OmniSTAR real-time correction and a gyroscope (spin-type) to provide accurate positioning data (pitch/roll/heading) in instances of satellite obstruction. All GPS coordinates are tied to image and linear distance measurements.

GPS SPECIFICATIONS	
Static accuracy	Sub-meter
Dynamic accuracy	2-3 meters
Receiver	12 satellite tracking
Coordinate system	Lat Lon WGS 84
Environment	Day or night
Cross-slope	+- 0.5 degrees
Grade	+- 0.5 degrees

GPS on Manually Rated Roads (MRR)

Parking areas, some roads, and other paved areas that are not fully drivable with the DCV are collected manually by field technicians. GPS is collected for these routes using portable Trimble GPS backpack units. Paved campground pads and driveways are not typically included in the inventory or GPS.

Geodatabase - Background and Metadata

In addition to this park report, a *geodatabase* containing both tabular and spatial data specific to this park has been provided. All data disseminated in the preceding report has been obtained from the tables and fields within said geodatabase. The geodatabase can be referenced for tabular data via Microsoft Access or for both tabular and spatial data via ESRI's ArcGIS Suite of software which consists of; ArcMap, ArcCatalog and ArcExplorer. Consolidating the RIP data into one database creates a seamless relationship of tabular and geographic data. It will allow RIP to facilitate easier updates and enhancements in the future.

A geodatabase can be thought of as simply a database containing spatial data. Many different tables are contained with the park's geodatabase. A complete and thorough description of the tables and fields contained within this geodatabase can be found in the *metadata*. The metadata is attached directly within the geodatabase and can be accessed via ESRI's ArcCatalog. The metadata portion of the geodatabase also includes data dictionary report functionality that formats the metadata into an easy to read report.

GLOSSARY OF TERMS AND ABBREVIATIONS

TERM ORABBREVIATIONDESCRIPTION OR DEFINITION

AC	Alligator Cracking
CRS	Condition Rating Sheets (Section 5)
DCV	Data Collection Vehicle
Excellent	Excellent rating with an index value of 95 to 100
Fair	Fair rating with an index value from 61 to 84
FUNCT_CLASS	Functional Classification (see Route ID, Section 2)
Good	Good rating with an index value from 85 to 94
IRI	International Roughness Index
Lane Width	Width from road centerline to fogline, or from centerline to edge- of-pavement when no fogline exists
LC	Longitudinal Cracking
MRR	Manually Rated Route
MRL	Manually Rated Line
MRP	Manually Rated Polygon
N/A	Not Applicable
NC	Not Collected
РАТСН	Patching and Potholes
Paved Width	Width from edge-of-pavement to edge-of-pavement
PCR	Pavement Condition Rating
PKG	Parking Area
Poor	Poor rating with an index value of 0 to 60
RCI	Roughness Condition Index
SC	Structural Cracking
SCR	Surface Condition Rating
TC	Transverse Cracking