

CANY Cycle 6

Final Report

Road Inventory and Condition Assessment of Paved Routes Canyonlands National Park




**Federal Lands Highway
Road Inventory Program**

Prepared By:

Federal Highway Administration
Eastern Federal Lands Highway Division
Road Inventory Program (RIP)

Report Date: November 2017

Canyonlands National Park in Utah

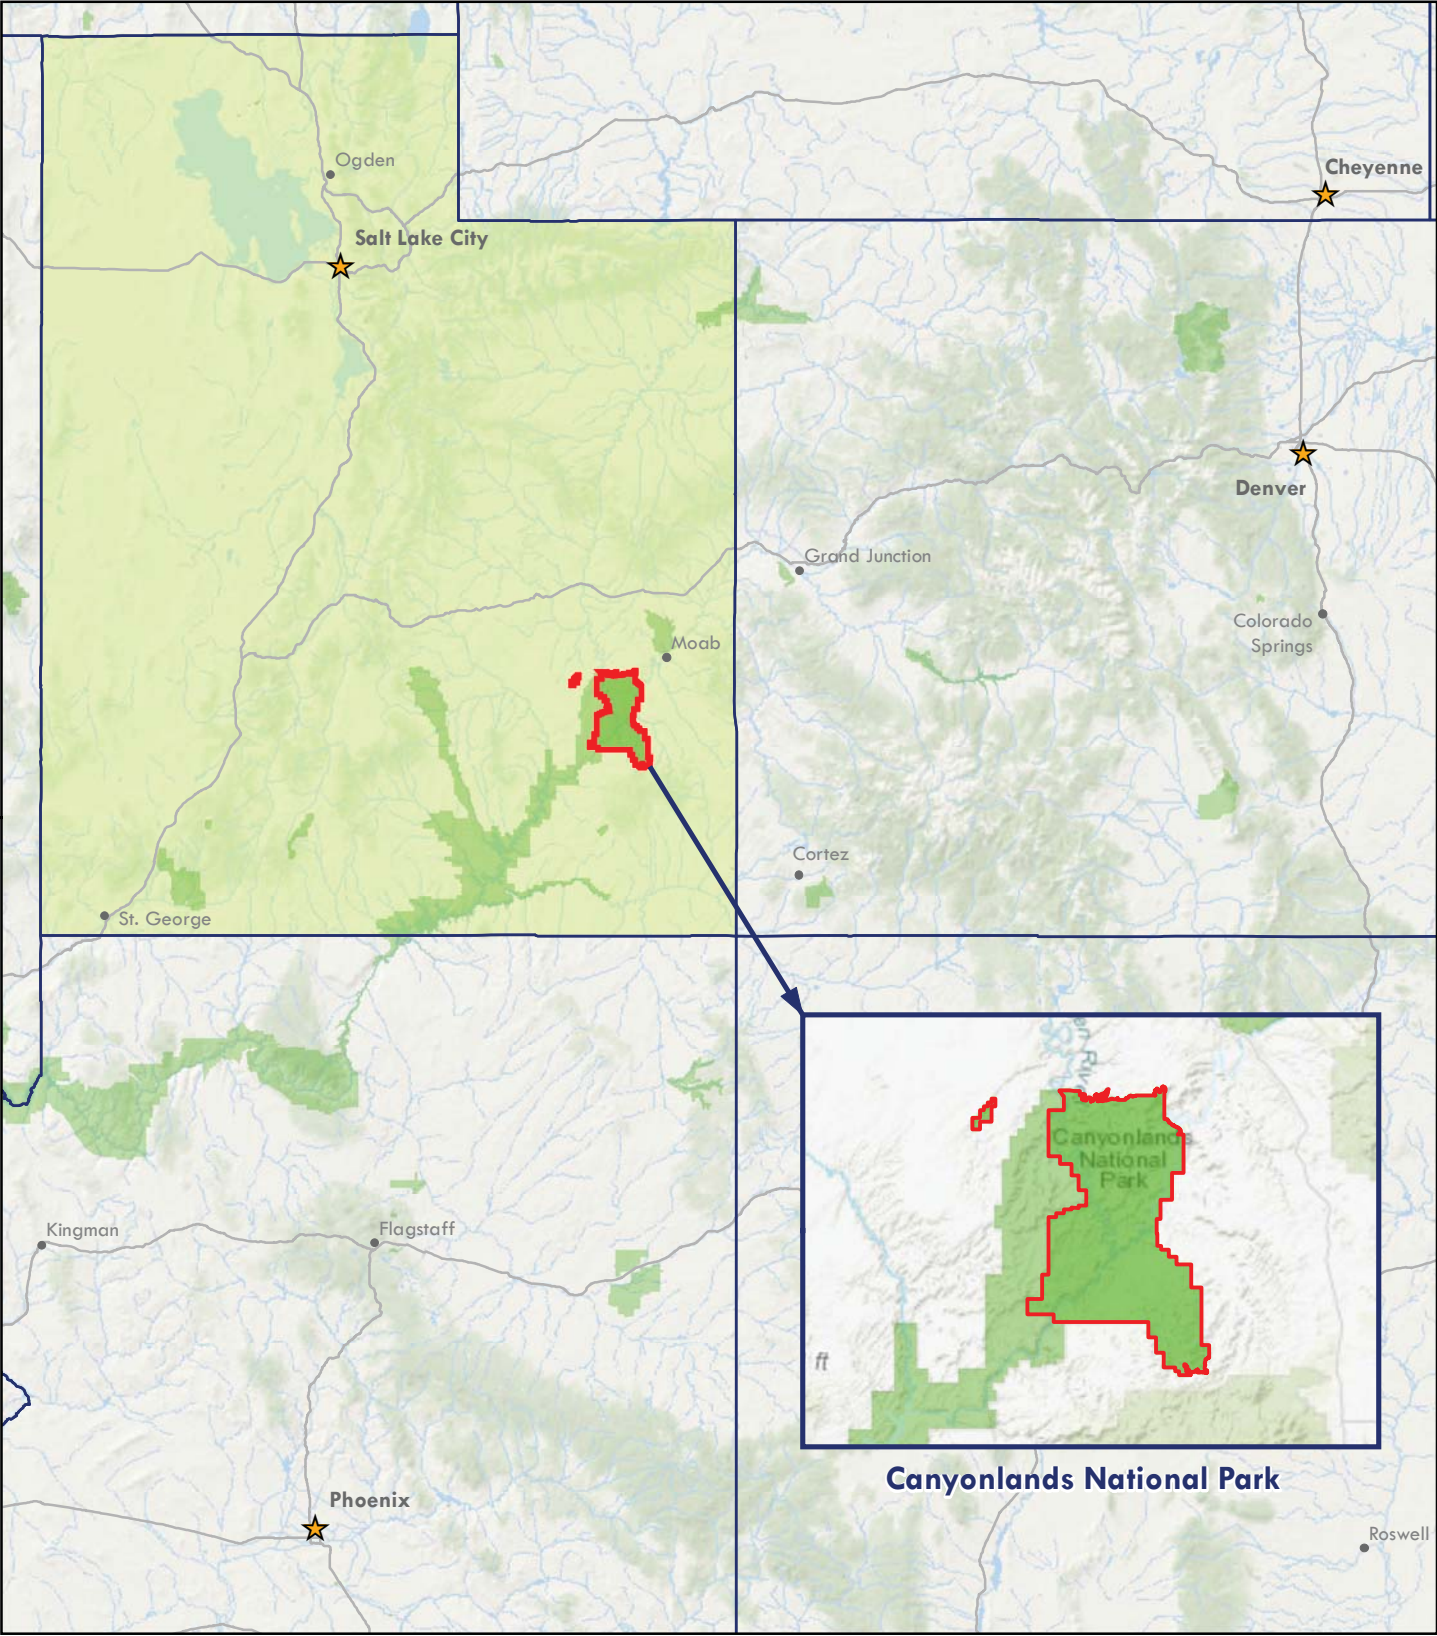

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community
Esri, DeLorme, GEBCO, NOAA NGDC, and other contributors



Table of Contents

SECTION	PAGE NO.
1. INTRODUCTION	1 - 1
2. PARK ROUTE INVENTORY Route ID Report, Subcomponent Report, and Changes Report (As Applicable)	2 - 1
3. PARK SUMMARY INFORMATION Parkwide Paved Route Condition Summary	3 - 1
Explanation of Condition Descriptions	3 - 2
Route-Level Condition Summary Reports for Data Collection Vehicle, Manually Rated, and Parking Area Routes (As Applicable)	3 - 3
4. PARK ROUTE LOCATION MAPS Route Location Key Map	4 - 1
Route Location Area Map(s)	4 - 2
Route Condition Key Map – PCR Mile by Mile	4 - 7
Route Condition Area Map(s) – PCR Mile by Mile	4 - 8
5. PAVED ROAD CONDITION RATING SHEETS Paved Road Pages	5 - 1
6. PAVED PARKING AREA CONDITION RATING SHEETS Paved Parking Area Pages	6 - 1
7. ROAD MILEPOST INFORMATION Road Milepost Information and Logs	7 - 1
8. APPENDIX Improvements to the RIP Index Equations and Determination of PCR	8 - 1
Description of the Rating System	8 - 2
Explanation of the Condition Descriptions	8 - 3
Description of Pavement Treatment Types	8 - 4
Appendix A: Methodology for Determining Condition Ratings with the Data Collection Vehicle (DCV)	8 - 5
Appendix B: Methodology for Determining Condition Ratings Using Manual Rating Procedures	8 - 20
Appendix C: Description of Cycle 6 Deliverables	8 - 29
Appendix D: Glossary of Terms and Abbreviations	8 - 33

Section 1 Introduction



Canyonlands National Park



**Federal Lands Highway
Road Inventory Program**

Introduction

The Federal Highway Administration’s (FHWA), Road Inventory Program (RIP) inventories all roads and parking areas in the National Park System, and performs condition inspections on all paved roads and parking areas for the National Park Service (NPS). This report contains the results of the Cycle 6 condition assessment of paved roads and parking lots for this park unit. This assessment was done using an automated, state-of-the-art pavement inspection vehicle as well as manual ratings. This information represents the condition of the paved assets at the time of the inspection. The pavement management system utilized by FHWA and the NPS uses these assessments to estimate future conditions and help prioritize pavement maintenance and rehabilitation projects. Further information about RIP data and its role in managing paved roads and bridges can be obtained by contacting the NPS Regional Transportation Program Manager.

A History of the Road Inventory Program:

The FHWA, in the mid-1970s, was charged with the task of identifying surface condition deficiencies and corrective priorities on NPS roads and parkways. Additionally, FHWA was tasked with establishing an integrated maintenance features inventory, locating features such as culverts, guardrails, and signs, among others, along NPS roads and parkways. As a result, in 1976 the NPS and FHWA entered into a Memorandum of Agreement (MOA) which established the RIP. This MOA was revised in 1980 to update RIP data collection standards and develop a long-range program to improve and maintain NPS roads to designated condition standards and establish a pavement management program.

The FHWA completed the initial phase of inventory in the early 1980s. As a result of this effort, each NPS unit included in the collection received a RIP Report known as the “Brown Book” which contained information that was inventoried during this first RIP phase. In the 1990s, a cyclical program was developed, and since then five cycles of collection have been completed. Cycle 6 is currently in progress. A summary of the RIP collection cycles is shown in the table below.

Cycle	Years	Parks Collected
Cycle 1	1994 - 1997	◦ 44 Large Parks
Cycle 2	1997 - 2001	◦ 79 Large Parks ◦ 5 Small Parks
Cycle 3	2001 - 2004	◦ All Large Parks ◦ All Small Parks
Cycle 4	2006 - 2010	◦ 86 Large Parks ◦ Several Small Parks
Cycle 5	2010 - 2014	◦ All Large Parks (Only functional class 1, 2, 7, and new/modified routes collected) ◦ All Small Parks (all roads and parking areas collected)
Cycle 6	2014 – 2020 (±)	◦ All roads and parking areas collected at all Parks ◦ Additional partial collections of functional class 1, 2, and 7 roads at Large Parks ◦ Cycle 6 is expected to last 6 years

Note: Large Parks have ≥ 10 Paved Miles; Small Parks have < 10 Paved Miles

Since 1984, the Road Inventory Program has been funded through the Federal Lands Highway Park Roads and Parkways (PRP) Program. Currently, coordination of the RIP with Federal Lands Highway (FLH) is under the NPS Washington Headquarters Park Facility Management Division. The FLH Washington office coordinates policy and prepares national reports and needs assessment studies for Congress.

In 1998, the Transportation Equity Act for the 21st Century (TEA-21) amended Title 23 U.S.C., and inserted Section 204(a)(6) requiring the FHWA and NPS, to develop by rule, a Pavement Management System (PMS) applied to park roads and parkways serving the National Park System.

In 2012, the Moving Ahead for Progress in the 21st Century Act (MAP-21) amended Title 23 U.S.C., and under Section 203(c)(1-2) stated that the National Park Service in cooperation with the DOT/FHWA, shall maintain a comprehensive national inventory of their transportation facilities, with the goal of quantifying transportation infrastructure needs within the National Park System.

A History of the Pavement Management System:

In 2005, the FHWA began implementing the use of a pavement management system to assist the NPS in prioritizing Pavement Maintenance and Rehabilitation activities. The system used by FHWA is the Highway Pavement Management Application (HPMA), which has the ability to store inventory and condition data from RIP and forecast future performance using prediction models. Outputs include performance and condition reports at the National, Regional, Park, or Route level. Regional prioritized lists and optimizations have been produced for most regions, and the Service's overall roadway Deferred Maintenance is calculated via the HPMA.

Overview of Cycle 6:

Cycle 6 launched in the spring of 2014 and will again comprise all NPS park units that are served by paved roads and/or parking areas. For Cycle 6, all paved roads (approximately 5,700 miles) and parking areas will be collected in all parks at least once, while the primary routes (functional class 1, 2, and 7 roads) at Large Parks will have additional collections. These multiple collections will provide updated condition data on a majority of the NPS's primary road network and help build a better pavement management system, allowing for more accurate pavement performance prediction models.

FLH is responsible for the accuracy of all data presented in this report. Any questions or comments concerning the contents of this report should be directed to the national RIP Coordinator located in Sterling, Virginia.

Respectfully,

FHWA RIP Team

FHWA/Eastern Federal Lands
21400 Ridgetop Circle
Sterling, VA 20166
(571) 434-1574

FHWA/Central Federal Lands
12300 West Dakota Ave
Lakewood, CO 80228
(720) 963-3556

Section 2 Park Route Inventory



Canyonlands National Park



Federal Lands Highway
Road Inventory Program

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

CANYON Canyonlands National Park

ROAD INVENTORY (1100 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Name	Route Description		Maintenance District	FLTP	Paved Miles	Unpaved Miles	Total Mileage	Functional Class	Area (SQ FT)	Surf. Type	Area Map
						From	To									
0010	6	1	45621		NEEDLES ACCESS ROAD	FROM DUGOUT RANCH CATTLEGUARD ON STATE ROUTE 211	TO ROUTE 0915 (BIG SPRINGS PARKING)	NEEDLES	YES	21.85	0.00	21.85	1		AS	2,2A,2B
0011	6	1	62479		ISLAND IN THE SKY ROAD	FROM "THE KNOLL" (INTERSECTION TO DEADHORSE STATE PARK)	TO ROUTE 0906 (GRAND VIEW POINT PARKING AREA)	I-SKY	YES	18.90	0.00	18.90	1		AS	1,1A
0100	NC		67878		CAVE SPRING ROAD	FROM ROUTE 0102 (WOODEN SHOE LOOP) AT MP 1.27 ON RIGHT	TO TRAILHEAD	NEEDLES	NO	0.00	1.06	1.06	2		GR	
0101	NC		67886		LAVENDER CANYON ROAD	FROM EAST PARK BOUNDARY	TO END AT CLEFT ARCH	NEEDLES	NO	0.00	4.16	4.16	4		NV	
0102	6	1	45624		WOODEN SHOE LOOP	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 17.93 ON LEFT	TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 16.15 ON LEFT	NEEDLES	YES	1.94	0.00	1.94	2		AS	2B
0103	NC		67887		HORSE CANYON ROAD	FROM ROUTE 0104 (SALT CREEK ROAD (INCLUDES OLD "ANGEL ARCH ROAD"))	TO END AT FORTRESS ARCH	NEEDLES	NO	0.00	6.05	6.05	4		NV	
0104	NC		67885		SALT CREEK ROAD (INCLUDES OLD "ANGEL ARCH ROAD")	FROM ROUTE 0100 (CAVE SPRING ROAD)	TO PEEK-A-BOO	NEEDLES	NO	0.00	12.40	12.40	4		NV	
0105	NC		45702		COLORADO RIVER OVERLOOK	FROM END OF ROUTE 0221 (NEEDLES VISITOR CONTACT STATION ACCESS ROAD)	TO OVERLOOK	NEEDLES	NO	0.00	7.22	7.22	4		NV	
0106	NC		47657		ELEPHANT HILL ACCESS ROAD	FROM ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B)) AT MP 0.25 ON RIGHT	TO EAST BASE OF ELEPHANT HILL (BEGIN JEEP ONLY TRAIL)	NEEDLES	NO	0.00	2.76	2.76	3		GR	
0107	NC		47952		DEVILS LANE	FROM SOUTH PARK BOUNDARY	TO CONFLUENCE TRAILHEAD OVERLOOK	NEEDLES	NO	0.00	11.91	11.91	4		NV	
0108	NC		67570		STANDING ROCKS ROAD	FROM WEST PARK BOUNDARY	TO SOUTHERNMOST CAMPSITE (#3)	MAZE	NO	0.00	9.77	9.77	4		NV	

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

CANYON Canyonlands National Park

ROAD INVENTORY (1100 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Name	Route Description		Maintenance District	FLTP	Paved Miles	Unpaved Miles	Total Mileage	Functional Class	Area (SQ FT)	Surf. Type	Area Map
						From	To									
0109	NC		47915		ELEPHANT HILL 4X4 ROAD	FROM ROUTE 0106 (ELEPHANT HILL ACCESS ROAD)	TO ROUTE 0107 (DEVILS LANE)(BEGINS AT WEST BASE NOT INCLUDING ELEPHANT HILL)	NEEDLES	NO	0.00	3.24	3.24	4		NV	
0110	NC		66843		ELEPHANT HILL RETURN ROAD	FROM ROUTE 0107 (DEVILS LANE)	TO ROUTE 0109 (ELEPHANT HILL 4X4 ROAD)	NEEDLES	NO	0.00	2.09	2.09	4		NV	
0111	NC		45709		WHITE RIM ROAD	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 5.85 ON LEFT	TO NORTH PARK BOUNDARY	I-SKY	NO	0.00	79.59	79.59	4		NV	
0112	NC		62499		POTASH SPUR ROAD	FROM ROUTE 0111 (WHITE RIM ROAD)	TO EAST PARK BOUNDARY	I-SKY	NO	0.00	1.79	1.79	4		NV	
0113	6	1	62552		GREEN RIVER OVERLOOK ROAD	FROM ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 0.27 ON LEFT	TO ROUTE 0922 (GREEN RIVER OVERLOOK PARKING)	I-SKY	YES	1.35	0.00	1.35	2		AS	1A
0114	6	1	62548		UPHEAVAL DOME ROAD	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 13.14 ON RIGHT	TO ROUTE 0909 (UPHEAVAL DOME PICNIC PARKING)	I-SKY	YES	4.78	0.00	4.78	2		AS	1A
0200	6	1	47991		SQUAW FLAT CAMPGROUND ROAD (LOOP A)	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 18.27 ON LEFT	TO END OF LOOP	NEEDLES	YES	1.13	0.00	1.13	3		AS	2A
0201	6	1	67847		SQUAW FLAT CAMPGROUND ROAD (LOOP B)	FROM ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.26 ON RIGHT	TO END OF LOOP	NEEDLES	YES	0.52	0.00	0.52	3		AS	2A
0202	6	1	67876		NEEDLES OUTPOST ROAD	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 14.33 ON RIGHT	TO NORTH PARK BOUNDARY (GATE)	NEEDLES	YES	0.36	0.00	0.36	3		AS	2
0203	NC		47911		LAVENDER CANYON RIGHT BRANCH	FROM ROUTE 0101 (LAVENDER CANYON ROAD)	TO END	NEEDLES	NO	0.00	2.47	2.47	4		NV	
0204	NC		67884		LOCKHART RIVER SPUR	FROM EAST PARK BOUNDARY	TO END AT COLORADO RIVER	NEEDLES	NO	0.00	0.30	0.30	4		NV	

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

CANYON Canyonlands National Park

ROAD INVENTORY (1100 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Name	Route Description		Maintenance District	FLTP	Paved Miles	Unpaved Miles	Total Mileage	Functional Class	Area (SQ FT)	Surf. Type	Area Map
						From	To									
0205	NC		67882		TOWER RUIN ROAD	FROM ROUTE 0103 (HORSE CANYON ROAD)	TO TRAILHEAD	NEEDLES	NO	0.00	0.71	0.71	4		NV	
0207	NC		47948		JOINT TRAIL ROAD	FROM ROUTE 0107 (DEVILS LANE)	TO END OF LOOP	NEEDLES	NO	0.00	0.52	0.52	4		NV	
0209	NC		67881		DEVIL KITCHEN CAMPGROUND ACCESS	FROM ROUTE 0109 (ELEPHANT HILL 4X4 ROAD)	TO CAMPGROUND	NEEDLES	NO	0.00	0.14	0.14	4		NV	
0210	NC		67856		SPLIT TOP GROUP CAMPSITE	FROM ROUTE 0100 (CAVE SPRING ROAD)	TO CAMPSITE	NEEDLES	NO	0.00	0.01	0.01	3		NV	
0211	NC		67869		WOODEN SHOE ROAD	FROM ROUTE 0102 (WOODEN SHOE LOOP) AT MP 0.17 ON LEFT	TO CAMPSITE	NEEDLES	NO	0.00	0.10	0.10	3		NV	
0212	NC		67569		MAZE OVERLOOK ROAD	FROM WEST PARK BOUNDARY	TO OVERLOOK AND CAMPSITE	MAZE	NO	0.00	5.12	5.12	4		NV	
0215	6	1	65197		WHITE RIM OVERLOOK PICNIC AREA	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 18.16 ON LEFT	TO ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 18.03 ON LEFT	I-SKY	YES	0.28	0.00	0.28	3		AS	1
0216	6	1	62550		WILLOW FLATS CAMPGROUND	FROM ROUTE 0113 (GREEN RIVER OVERLOOK ROAD) AT MP 1.17 ON LEFT	TO ROUTE 0113 (GREEN RIVER OVERLOOK ROAD) AT MP 1.05 ON LEFT	I-SKY	YES	0.21	0.00	0.21	3		AS	1A
0217	NC		62502		WALKING ROCKS SPUR	FROM ROUTE 0111 (WHITE RIM ROAD)	TO OVERLOOK	I-SKY	NO	0.00	0.17	0.17	4		NV	
0219	NC		62505		LATHROP CANYON ROAD	FROM ROUTE 0111 (WHITE RIM ROAD)	TO END AT RIVER	I-SKY	NO	0.00	3.66	3.66	4		NV	
0220	NC		62506		WHITE CRACK CAMPGROUND ACCESS ROAD	FROM ROUTE 0111 (WHITE RIM ROAD)	TO CAMPGROUND	I-SKY	NO	0.00	1.36	1.36	4		NV	
0221	6	1	45704		NEEDLES VISITOR CONTACT STATION ACCESS ROAD	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 15.50 ON RIGHT	TO END OF PAYEMENT/BEGIN ROUTE 0105 (COLORADO RIVER OVERLOOK)	NEEDLES	YES	0.16	0.00	0.16	3		AS	2B

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

CANYON Canyonlands National Park

ROAD INVENTORY (1100 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Name	Route Description		Maintenance District	FLTP	Paved Miles	Unpaved Miles	Total Mileage	Functional Class	Area (SQ FT)	Surf. Type	Area Map
						From	To									
0223	NC		62508		HARDSCRABBLE CAMPGROUND ACCESS ROAD	FROM ROUTE 0111 (WHITE RIM ROAD)	TO PRIMITIVE CAMPGROUND	I-SKY	NO	0.00	0.36	0.36	4		NV	
0224	NC		62509		TAYLOR CANYON ROAD	FROM ROUTE 0111 (WHITE RIM ROAD)	TO CAMPGROUND	I-SKY	NO	0.00	5.25	5.25	4		NV	
0226	NC		47660		BOBBY JO CAMP ROAD	FROM ROUTE 0107 (DEVILS LANE)	TO CAMPSITE	NEEDLES	NO	0.00	0.10	0.10	4		NV	
0227	NC		67883		HORSE HOOF CAMP ROAD	FROM ROUTE 0107 (DEVILS LANE)	TO CAMPSITE	NEEDLES	NO	0.00	0.30	0.30	4		NV	
0229	6	1	102669		SQUAW FLAT CAMPGROUND LOOP B	FROM ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B)) AT MP 0.36 ON LEFT	TO END OF LOOP	NEEDLES	YES	0.10	0.00	0.10	3		AS	2A
0401	6	1	47844		NEEDLES RESIDENCE ROAD	FROM ROUTE 0102 (WOODEN SHOE LOOP) AT MP 1.71 ON RIGHT	TO DEAD END	NEEDLES	YES	0.57	0.00	0.57	5		AS	2B
0402	NC		45728		GENERATOR BUILDING ROAD	FROM ROUTE 0102 (WOODEN SHOE LOOP) AT MP 1.03 ON RIGHT	TO END OF LOOP	NEEDLES	NO	0.00	0.14	0.14	5		GR	
0403	6	1	47596		NEEDLES MAINTENANCE AREA LOOP	FROM ROUTE 0102 (WOODEN SHOE LOOP) AT MP 0.92 ON LEFT	TO ROUTE 0102 (WOODEN SHOE LOOP) AT MP 0.77 ON LEFT	NEEDLES	YES	0.22	0.00	0.22	5		AS	2B
0404	NC		67879		FIRING RANGE ROAD	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 14.38 ON LEFT	TO WELL HOUSE (JUST ACROSS CREEK)	NEEDLES	NO	0.00	0.48	0.48	6		NV	
0405	NC		67874		NEEDLES BONEYARD ROAD	FROM ROUTE 0104 (SALT CREEK ROAD (INCLUDES OLD "ANGEL ARCH ROAD"))	TO FENCED BONEYARD	NEEDLES	NO	0.00	0.14	0.14	6		GR	
0406	6	1	62540		I-SKY RESIDENCE ROAD	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 6.74 ON RIGHT	TO END OF PAVEMENT	I-SKY	YES	0.11	0.24	0.35	5		AS	1

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

CANYON Canyonlands National Park

ROAD INVENTORY (1100 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Name	Route Description		Maintenance District	FLTP	Paved Miles	Unpaved Miles	Total Mileage	Functional Class	Area (SQ FT)	Surf. Type	Area Map
						From	To									
0407	NC		62543		I-SKY MAINTENANCE ROAD	FROM ROUTE 0406 (I-SKY RESIDENCE ROAD)	TO MAINTENANCE YARD	I-SKY	NO	0.00	0.16	0.16	6		GR	
0408	NC		62545		RADIO REPEATER STATION ROAD	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD)	TO REPEATER	I-SKY	NO	0.00	0.17	0.17	6		NV	
0409	NC		62547		I-SKY RESIDENCE SPUR	FROM ROUTE 0406 (I-SKY RESIDENCE ROAD)	TO END OF LOOP	I-SKY	NO	0.00	0.08	0.08	5		GR	
0410	6	1	62551		WILLOW FLATS SERVICE ROAD	FROM ROUTE 0113 (GREEN RIVER OVERLOOK ROAD) AT MP 0.78 ON RIGHT	TO END	I-SKY	NO	0.07	0.10	0.17	6		AS	1A
0450	NC		66237		I-SKY AIR QUALITY COMPLEX LOOP	FROM ROUTE 0407 (I-SKY MAINTENANCE ROAD)	TO END OF LOOP	I-SKY	NO	0.00	0.17	0.17	6		NV	
0451	NC		66243		I-SKY HELIBASE ROAD	FROM ROUTE 0406 (I-SKY RESIDENCE ROAD)	TO HELIBASE	I-SKY	NO	0.00	0.17	0.17	6		NV	

PARKING AREA INVENTORY (1300 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Name	Route Description		Maintenance District	FLTP	Access Level	Area (SQ FT)	Surf. Type	Area Map
						From	To						
0900	6	1	90336		ISLAND IN THE SKY VISITOR CENTER PARKING	ADJACENT TO ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 6.81 ON RIGHT		I-SKY	YES	PUBLIC	21,243	AS	1
0901	6	1	61946		SKY VISITOR CENTER EMPLOYEE PARKING	FROM ROUTE 0406 (I-SKY RESIDENCE ROAD) AT MP 0.09 ON LEFT	TO PARKING	I-SKY	NO	NONPUBLIC	3,676	AS	1
0902	6	1	66233		NECK SPRINGS TRAILHEAD PARKING	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 7.30 ON LEFT	TO PARKING	I-SKY	YES	PUBLIC	40,429	AS	1
0903	6	1	66232		MESA ARCH PARKING	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 12.87 ON LEFT	TO ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 12.95 ON LEFT	I-SKY	YES	PUBLIC	21,721	AS	1A
0904	6	1	66235		BUCK CANYON OVERLOOK PARKING	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 16.28 ON LEFT	TO PARKING	I-SKY	YES	PUBLIC	21,612	AS	1

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

CANYON Canyonlands National Park

PARKING AREA INVENTORY (1300 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Description		Maintenance District	FLTP	Access Level	Area (SQ FT)	Surf. Type	Area Map	
					Route Name	From							To
0905	6	1	66236		ORANGE CLIFFS OVERLOOK PARKING	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 18.81 ON RIGHT	TO ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 18.86 ON RIGHT	I-SKY	YES	PUBLIC	11,176	AS	1
0906	6	1	66234		GRAND VIEW POINT PARKING AREA	FROM END OF ROUTE 0011 (ISLAND IN THE SKY ROAD)	TO PARKING	I-SKY	YES	PUBLIC	37,800	AS	1
0907	6	1	66229		AZTEC BUTTE TRAILHEAD PARKING	FROM ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 0.83 ON RIGHT	TO ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 0.88 ON RIGHT	I-SKY	YES	PUBLIC	12,878	AS	1A
0908	6	1	66230		WHALE ROCK TRAILHEAD PARKING	FROM ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 4.00 ON RIGHT	TO ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 4.04 ON RIGHT	I-SKY	YES	PUBLIC	11,698	AS	1A
0909	6	1	66231		UPHEAVAL DOME PICNIC PARKING	FROM END OF ROUTE 0114 (UPHEAVAL DOME ROAD)	TO PARKING	I-SKY	YES	PUBLIC	19,975	AS	1A
0910	6	1	67880		INDIAN CREEK PARKING	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 7.63 ON RIGHT	TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 7.72 ON RIGHT	NEEDLES	YES	PUBLIC	9,351	AS	2
0911	6	1	45708		NEEDLES VISITOR CENTER PARKING	FROM ROUTE 0221 (NEEDLES VISITOR CONTACT STATION ACCESS ROAD) AT MP 0.08 ON RIGHT	TO ROUTE 0221 (NEEDLES VISITOR CONTACT STATION ACCESS ROAD) AT MP 0.15 ON RIGHT	NEEDLES	YES	PUBLIC	40,064	AS	2B
0912	6	1	67873		WOODEN SHOE PARKING	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 17.55 ON LEFT	TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 17.58 ON LEFT	NEEDLES	YES	PUBLIC	6,826	AS	2B
0913	6	1	67865		THE PICNIC AREA (NEEDLES)	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 19.97 ON LEFT	TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 20.00 ON LEFT	NEEDLES	YES	PUBLIC	6,866	AS	2A
0914	6	1	47627		POTHOLE HILL TRAILHEAD PARKING	FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 20.39 ON LEFT	TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 20.42 ON LEFT	NEEDLES	YES	PUBLIC	9,222	AS	2A
0915	6	1	67877		BIG SPRINGS PARKING	FROM END OF ROUTE 0010 (NEEDLES ACCESS ROAD)	TO PARKING	NEEDLES	YES	PUBLIC	16,951	AS	2A
0916A	6	1	67875		NEEDLES MAINTENANCE YARD COMPLEX AREA A	FROM ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.04 ON RIGHT	TO ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.09 ON RIGHT	NEEDLES	NO	NONPUBLIC	27,478	AS	2B
0916B	6	1	102708		NEEDLES MAINTENANCE YARD COMPLEX AREA B	ADJACENT TO ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.07 ON RIGHT		NEEDLES	NO	NONPUBLIC	1,055	AS	2B

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

CANYON Canyonlands National Park

PARKING AREA INVENTORY (1300 SERIES FMSS LOCATIONS)

Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concession	Route Description		Maintenance District	FLTP	Access Level	Area (SQ FT)	Surf. Type	Area Map
					Route Name	From To						
0916C	6	1	102710		NEEDLES MAINTENANCE YARD COMPLEX AREA C	ADJACENT TO ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.14 ON RIGHT	NEEDLES	NO	NONPUBLIC	1,544	AS	2B
0917	NC		47904		PAUL BUNYANS POTTY PARKING	FROM ROUTE 0103 (HORSE CANYON ROAD) TO RESTROOM	NEEDLES	NO	PUBLIC	1,000	NV	
0918	6	1	102711		SQUAW FLAT RESTROOM A PARKING	ADJACENT TO ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.77 ON RIGHT	NEEDLES	YES	PUBLIC	1,033	AS	2A
0919	6	1	102712		SQUAW FLAT TRAILHEAD PARKING	ADJACENT TO ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.91 ON LEFT	NEEDLES	YES	PUBLIC	9,057	AS	2A
0920	6	1	102715		SQUAW FLAT RESTROOM B PARKING	ADJACENT TO ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B)) AT MP 0.42 ON LEFT	NEEDLES	YES	PUBLIC	570	AS	2A
0921	6	1	102716		WHITE RIM OVERLOOK PARKING	ADJACENT TO ROUTE 0215 (WHITE RIM OVERLOOK PICNIC AREA) AT MP 0.14 ON RIGHT	I-SKY	YES	PUBLIC	959	AS	1
0922	6	1	90764		GREEN RIVER OVERLOOK PARKING	FROM END OF ROUTE 0113 (GREEN RIVER OVERLOOK ROAD) TO PARKING	I-SKY	YES	PUBLIC	19,417	AS	1A
0923	6	1	102755		WILLOW FLAT CAMPGROUND PARKING	ADJACENT TO ROUTE 0216 (WILLOW FLATS CAMPGROUND) AT MP 0.01 ON RIGHT	I-SKY	YES	PUBLIC	2,144	AS	1A
0924	6	1	102648		SQUAW FLAT GROUP SITE PARKING LOOP A	FROM ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.79 ON RIGHT TO ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.81 ON RIGHT	NEEDLES	YES	PUBLIC	6,882	AS	2A
0925	6	1	238082		SQUAW FLAT LOOP B PARKING	ADJACENT TO ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))	NEEDLES	YES	PUBLIC	2,657	AS	2A
0926	NC		62549		MURPHY POINT PARKING AREA	FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 15.59 ON RIGHT TO TRAILHEAD	I-SKY	NO	PUBLIC	2,500	GR	

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

Cycle 6 Summary Totals for Canyonlands National Park

Cycle 6 Route Totals

	NPS Maintained	Concessionaire Maintained	Park Totals
Paved Roads, Data Collection Vehicle Rated (Miles)	52.48	0	52.48
Paved Roads, Manually Rated Length (Miles)	0.07	0	0.07
Paved Roads, Manually Rated Area (Sq. Ft.)	0	0	0
Unpaved Roads (Miles)	164.46	0	164.46
Paved Parking (Sq. Ft.)	364,284	0	364,284
Unpaved Parking (Sq. Ft.)	3,500	0	3,500

Cycle 6 Lane Miles and Overall Pavement Condition

	Lanes Miles*	Pavement Condition Rating**
Data Collection Vehicle Routes	133.45	95
Manually Rated Roads	0.10	53
Parking Areas	6.27	81

* Equivalent Lane Miles are calculated by route using the following equations:
 - DCV and MRLs = (PAVE_WIDTH x PAVED_MI) / 11 foot lane
 - MRPs and PKGs = SQ_FEET / 5280 / 11 foot lane

**Parking and Manually Rated Routes are assigned the following PCR values based on the type of observed distresses:
 -Excellent = 97 -Good = 90 -Fair = 73
 -Poor = 53, 30, or 0 -Construction / Not Rated = -1

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

■ = Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

Red text denotes:

*Unpaved route data was obtained from the NPS and was not collected by the Road Inventory Program (RIP).

DCV = Data Collection Vehicle
 MRL = Manually Rated Line
 MRP = Manually Rated Polygon
 PKG = Parking Areas
 NC = Not Collected

General Park Road Functional Classification (FC) Table

FC	Type	User Access	Description	Route Numbers	Surface Types
1	Principal Park Road Rural Parkway	Public	Roads which constitute the main access route, circulatory tour, or thoroughfare for park visitors. Rural Parkways (e.g. Natchez Trace) are numbered 0001 - 0009.	0001 - 0009 0010 - 0099	AS - Asphaltic Concrete Pavement
2	Connector Park Road	Public	Roads which provide access within a park to areas of scenic, scientific, recreational or cultural interest, such as overlooks, campgrounds, etc.	0100 - 0199	BR - Brick or Pavers Road Bed CB - Cobble Stone Road Bed
3	Special Purpose Park Road	Public	Roads which provide circulation within public areas, such as campgrounds, picnic areas, visitor center complexes, concessionaire facilities, etc. These roads generally serve low-speed traffic and are often designed for one-way circulation.	0200 - 0299	CO - Portland Cement Concrete Pavement GR - Gravel Road Bed
4	Primitive Park Road	Public	Roads which provide circulation through remote areas and/or access to primitive campgrounds and undeveloped areas. These roads frequently have no minimum design standards and their use may be limited to specially equipped vehicles. Note: Functional Classes 3 and 4 have the same route numbers because, historically, they were numbered similarly.	0200 - 0299	NV - Native or Dirt Material Road Bed
5	Administrative Park Road	Public	All public roads intended for access to administrative developments or structures such as park offices, employee quarters, or utility areas.	0400 - 0499	OT - Other Materials Road Bed
6	Administrative Park Road (Restricted Access)	Nonpublic	All roads normally closed to the public, including patrol roads, truck trails, and other similar roads. Note: Functional Classes 5 and 6 have the same route numbers because historically they were numbered similarly and often there is little distinction between these routes. For example, because utility areas and employee housing are often closed to the public, this restriction would result in classification of FC 6 rather than FC 5.	0400 - 0499	
7	Urban Parkway	Public	These facilities serve high volumes of park and non-park related traffic and are restricted, limited-access facilities in an urban area. This category of roads primarily encompasses the major parkways which serve as gateways to our nation's capital. Other major park roads or portions thereof, however, may be included in this category.	0001 - 0009	
8	City Street	Public	City streets are usually extensions of the adjoining street system that are owned and maintained by the National Park Service. The construction and/or reconstruction should conform with accepted local engineering practice and local conditions.	0600 - 0699	
N/A	Non-NPS Roads	Public	State, County, or City owned roads which border, traverse, or provide access to Park Facilities or Locations. Non-NPS roads are not assigned functional classes and are driven for GPS and Video Log only.	5000 - 5999	

A park road system contains those roads within or giving access to a park or other unit of the NPS which are administered by the NPS, or by the Service in cooperation with other agencies. The assignment of a functional classification (FC) to a park road is not based on traffic volumes or design speed, but on the intended use or function of that road or route.

The historic route numbering system also included a 300 series for interpretive roads, and a 500 series for one-way roads. There are approximately 250 roads nationwide which are designated by the 300 and 500 series. The numbers for these roads will be maintained for reporting consistency. However, since these interpretive and one-way routes are not as clearly tied to a specific functional class, the 300 and 500 series will be discontinued for future use.

Section 3 Park Summary Information



Canyonlands National Park



Federal Lands Highway
Road Inventory Program

Parkwide Paved Route Condition Summary

Canyonlands National Park

Table 1: Paved Route Miles and Parking Area Square Footages by Access Level and PCR

Breakdown of Pavement Condition Rating (PCR) Based on Access Level

	POOR (PCR of 0 - 60)	FAIR (PCR of 61 - 84)	GOOD (PCR of 85 - 94)	EXCELLENT (PCR of 95 - 100)	
PAVED ROADS					
Functional Class	Length (miles)	Length (miles)	Length (miles)	Length (miles)	Total Mileage by FC
1	0.10	3.57	11.30	25.74	40.71
2		1.55	1.04	5.48	8.07
3	0.04	1.33	1.07	0.32	2.76
4					
5		0.43	0.33	0.14	0.90
6	0.07				0.07
7					
8					
Total Mileage by PCR	0.21	6.88	13.74	31.68	52.51
PAVED PARKING					
Access Level	Area (sq. ft.)	Area (sq. ft.)	Area (sq. ft.)	Area (sq. ft.)	Total Area
PUBLIC	39,123	97,444	193,964		330,531
NONPUBLIC	3,676	2,599	27,478		33,753
Total Area by PCR	42,799	100,043	221,442	0	364,284

NOTES:

1. Data are reported in the table only for paved roads and parking lots that received a condition rating.
2. Non-linear roads (MRP collected routes) are measured by area and converted to equivalent route miles based on a 22-ft pavement width in order to be included in the mileage totals for paved roads shown above.
3. Quantities in the table above are derived from the route condition data within the PMS_20, PMS_MRL, PMS_MRP, and PMS_PKG tables in the Park geodatabase.

Parkwide Condition Percentages


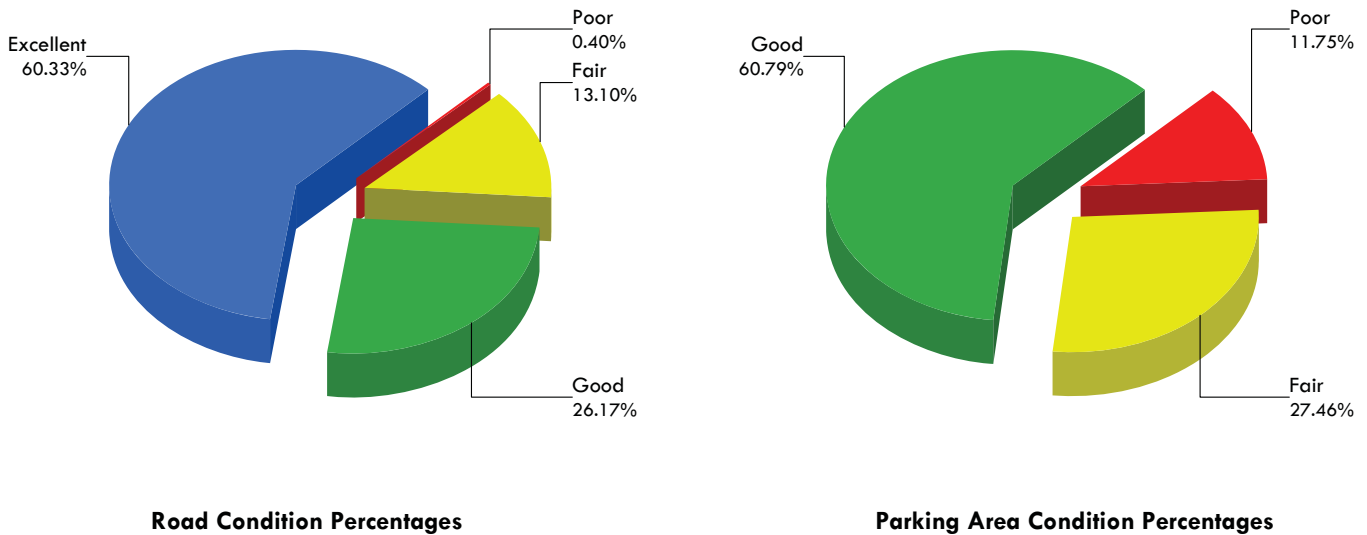


Figure 1: Pavement Condition Rating Breakdown for Paved Roads and Parking Areas

Explanation of the Excellent, Good, Fair, and Poor Condition Descriptions

The Road Inventory Program aims to provide assistance in translating the excellent / good / fair / poor rating categories into pavement needs categories. The PCR can be used to indicate the place in the Pavement Life Cycle and the type of treatments that should be considered now and into the future.

- Excellent / New: PCR of 95-100
 - o Pavements in this range will require only spot repairs
- Good: PCR of 85-94
 - o Pavements in this range will likely be candidates for Preventive Maintenance. Examples include Chip and Slurry Seals, Micro Surfacing and Thin Overlays.
- Fair: PCR of 61-84
 - o Pavements in this range will likely be candidates of Light Rehabilitation (L3R). Examples include singlelift overlays up to 2.5 inches in total thickness, milling and overlays.
- Poor: PCR of 0-60
 - o Pavements in this range will likely be candidates of Heavy Rehabilitation or Reconstruction (H3R or 4R). Examples include Pulverization, Multiple Lift Overlays, and Reconstruction.

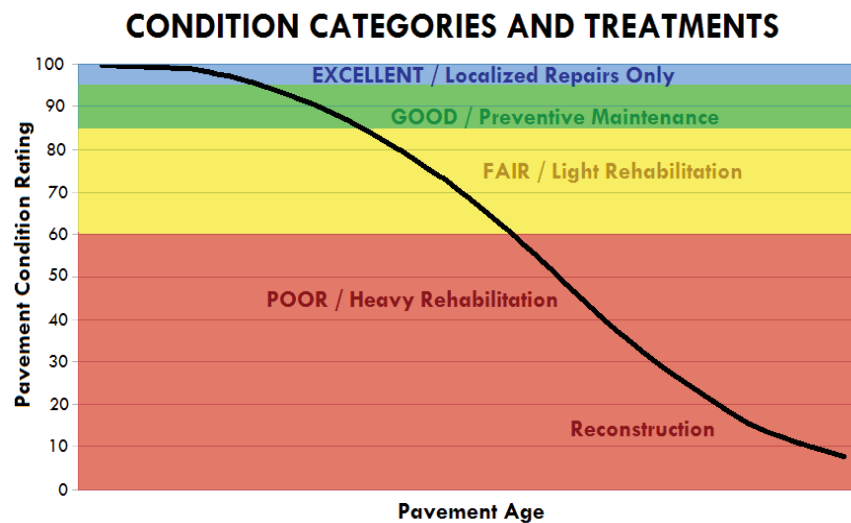

At this time, specific Maintenance and Rehabilitation activities should be evaluated and recommended at the project level. Site-specific conditions that influence treatment type should be determined based on performing a subsurface investigation and/or pavement condition survey, and not be based solely on RIP data. Additionally, RIP produces a snapshot of conditions at the time in which the data were collected. For further information or to obtain additional Pavement Management System's data from our Highway Pavement Management Application (HPMA) please contact the Eastern Federal Lands pavement team.



Federal Lands Highway
Road Inventory Program

Cycle 6 - Road Inventory Program Road Condition Summary Report for Data Collection Vehicle (DCV) Rated Roads

Canyonlands National Park

Condition (Rating / Index) Legend

EXCELLENT (95 - 100)
GOOD (85 - 94)
FAIR (61 - 84)
POOR (0 - 60)
NR = NOT RATED

- Notes:
- This condition summary report contains only the roads rated with the Data Collection Vehicle (DCV).
 - Condition on roads that were manually rated and parking areas are shown in separate reports.
 - Additional details on individual road ratings can be found in Section 5 of the Cycle 6 RIP Report.
 - Refer to the RIP Report Appendix for an explanation of the rating system and rating methods.

Route-Level Condition for Roads Rated with the Data Collection Vehicle (DCV)

Route No.	FMSS No.	Route Name	Functional Class	Surf. Type	Paved Length (Miles)	Pavement Condition Rating (PCR)	Roughness Condition Index (RCI)	Surface Condition Rating (SCR)	Structural Crack Index	Alligator Crack Index	Longitudinal Cracking Index	Transverse Cracking Index	Patch / Pothole Index	Rutting Index
CANY-0010	45621	NEEDLES ACCESS ROAD	1	AS	21.85	93	92	93	97	100	97	96	100	93
CANY-0011	62479	ISLAND IN THE SKY ROAD	1	AS	18.90	98	100	97	99	100	99	99	100	97
CANY-0102	45624	WOODEN SHOE LOOP	2	AS	1.94	80	69	87	93	100	93	87	100	96
CANY-0113	62552	GREEN RIVER OVERLOOK ROAD	2	AS	1.35	97	100	95	100	100	100	99	100	95
CANY-0114	62548	UPHEAVAL DOME ROAD	2	AS	4.78	99	100	98	100	100	100	99	100	98
CANY-0200	47991	SQUAW FLAT CAMPGROUND ROAD (LOOP A)	3	AS	1.13	83	66	94	98	100	98	95	100	94
CANY-0201	67847	SQUAW FLAT CAMPGROUND ROAD (LOOP B)	3	AS	0.52	76	NR	76	88	100	88	76	100	94
CANY-0202	67876	NEEDLES OUTPOST ROAD	3	AS	0.36	86	NR	86	99	100	99	91	100	86
CANY-0215	65197	WHITE RIM OVERLOOK PICNIC AREA	3	AS	0.28	91	NR	91	99	100	99	91	100	96
CANY-0216	62550	WILLOW FLATS CAMPGROUND	3	AS	0.21	80	NR	80	98	100	98	80	100	94
CANY-0221	45704	NEEDLES VISITOR CONTACT STATION ACCESS ROAD	3	AS	0.16	97	NR	97	99	100	99	97	100	97
CANY-0229	102669	SQUAW FLAT CAMPGROUND LOOP B	3	AS	0.10	74	NR	74	83	100	83	74	100	98
CANY-0401	47844	NEEDLES RESIDENCE ROAD	5	AS	0.57	88	NR	88	100	100	100	88	100	100
CANY-0403	47596	NEEDLES MAINTENANCE AREA LOOP	5	AS	0.22	81	NR	81	99	100	99	81	100	94
CANY-0406	62540	I-SKY RESIDENCE ROAD	5	AS	0.11	81	NR	81	85	100	85	81	99	99



Cycle 6 - Road Inventory Program Road Condition Summary Report for Manually Rated Roads

Canyonlands National Park

Condition (Rating / Index) Legend

EXCELLENT (95 - 100)
GOOD (85 - 94)
FAIR (61 - 84)
POOR (0 - 60)
NR = NOT RATED

- Notes:
- This condition summary report contains only the roads that were manually rated.
 - MRL = Manually Rated Line (a linear road)
 - MRP = Manually Rated Polygon (a non-linear road)
 - Condition on roads that were rated with the Data Collection Vehicle (DCV) are shown in a separate report.
 - A road is manually rated when it is determined to be unsuitable for the DCV to drive.
 - Additional details on individual road ratings can be found in Section 5 of the Cycle 6 RIP Report.
 - Refer to the RIP Report Appendix for an explanation of the rating system and rating methods.

Route-Level Condition for Manually Rated Line (MRL) Roads

Route No.	FMSS No.	Route Name	Functional Class	Surf. Type	Paved Length (Miles)	Pavement Condition Rating (PCR)	Roughness Condition Index (RCI)	Surface Condition Rating (SCR)	Structural Crack Index	Alligator Crack Index	Longitudinal Cracking Index	Transverse Cracking Index	Patch / Pothole Index	Rutting Index
CANY-0410	62551	WILLOW FLATS SERVICE ROAD	6	AS	0.07	53	NR	53	NR	53	53	53	53	53



Federal Lands Highway
Road Inventory Program

Cycle 6 - Road Inventory Program

Parking Area Condition Summary Report

Canyonlands National Park

Condition (Rating / Index) Legend

EXCELLENT (97)
GOOD (90)
FAIR (73)
POOR* (0, 30, 53)
NR = NOT RATED

- Notes:
- A PCR of 0 indicates a paved parking area in very poor condition. Individual distresses could not be identified.
 - Additional details on individual parking areas can be found in Section 6 of the Cycle 6 RIP Report.
 - Refer to the RIP Report Appendix for an explanation of the rating system and rating methods.

Asphalt Surface Distresses Concrete Surface Distresses

Condition Rating Details for Parking Areas

Route No.	FMSS No.	Route Name	User Access	Surf. Type	Area (Sq. Ft.)	Pavement Condition Rating (PCR)	Alligator Cracking	Longitudinal / Transverse Cracking	Rutting / Distortions	Potholes / Patching	HMA Patching	Surface Raveling / Bleeding	Joint Faulting	Slab Cracking	Joint Distresses	Delamination / Pop-Outs	Potholes / Patching
CANY-0900	90336	ISLAND IN THE SKY VISITOR CENTER PARKING	PUBLIC	AS	21,243	90	90	90	90	97	97	90					
CANY-0901	61946	SKY VISITOR CENTER EMPLOYEE PARKING	NONPUBLIC	AS	3,676	53	53	53	90	90	97	90					
CANY-0902	66233	NECK SPRINGS TRAILHEAD PARKING	PUBLIC	AS	40,429	73	97	90	97	97	97	73					
CANY-0903	66232	MESA ARCH PARKING	PUBLIC	AS	21,721	90	97	90	97	97	97	90					
CANY-0904	66235	BUCK CANYON OVERLOOK PARKING	PUBLIC	AS	21,612	90	97	90	90	97	97	97					
CANY-0905	66236	ORANGE CLIFFS OVERLOOK PARKING	PUBLIC	AS	11,176	53	97	53	90	97	97	97					
CANY-0906	66234	GRAND VIEW POINT PARKING AREA	PUBLIC	AS	37,800	90	97	90	97	97	97	97					
CANY-0907	66229	AZTEC BUTTE TRAILHEAD PARKING	PUBLIC	AS	12,878	90	97	90	97	97	97	97					
CANY-0908	66230	WHALE ROCK TRAILHEAD PARKING	PUBLIC	AS	11,698	90	97	90	97	97	97	90					
CANY-0909	66231	UPHEAVAL DOME PICNIC PARKING	PUBLIC	AS	19,975	90	97	90	97	97	97	97					
CANY-0910	67880	INDIAN CREEK PARKING	PUBLIC	AS	9,351	53	97	53	90	97	97	73					
CANY-0911	45708	NEEDLES VISITOR CENTER PARKING	PUBLIC	AS	40,064	73	97	90	97	97	97	73					
CANY-0912	67873	WOODEN SHOE PARKING	PUBLIC	AS	6,826	90	97	90	97	97	97	90					
CANY-0913	67865	THE PICNIC AREA (NEEDLES)	PUBLIC	AS	6,866	90	97	90	97	97	97	97					
CANY-0914	47627	POTHOLE HILL TRAILHEAD PARKING	PUBLIC	AS	9,222	90	97	90	97	97	97	90					
CANY-0915	67877	BIG SPRINGS PARKING	PUBLIC	AS	16,951	73	97	90	97	97	97	73					
CANY-0916A	67875	NEEDLES MAINTENANCE YARD COMPLEX AREA A	NONPUBLIC	AS	27,478	90	97	90	97	97	97	90					
CANY-0916B	102708	NEEDLES MAINTENANCE YARD COMPLEX AREA B	NONPUBLIC	AS	1,055	73	97	90	97	97	97	73					
CANY-0916C	102710	NEEDLES MAINTENANCE YARD COMPLEX AREA C	NONPUBLIC	AS	1,544	73	97	90	97	97	97	73					
CANY-0918	102711	SQUAW FLAT RESTROOM A PARKING	PUBLIC	AS	1,033	90	97	90	97	97	97	90					
CANY-0919	102712	SQUAW FLAT TRAILHEAD PARKING	PUBLIC	AS	9,057	53	97	53	97	97	97	73					
CANY-0920	102715	SQUAW FLAT RESTROOM B PARKING	PUBLIC	AS	570	90	97	90	97	97	97	90					
CANY-0921	102716	WHITE RIM OVERLOOK PARKING	PUBLIC	AS	959	90	97	90	97	97	97	90					
CANY-0922	90764	GREEN RIVER OVERLOOK PARKING	PUBLIC	AS	19,417	90	97	90	97	97	97	97					
CANY-0923	102755	WILLOW FLAT CAMPGROUND PARKING	PUBLIC	AS	2,144	90	97	90	97	90	97	97					
CANY-0924	102648	SQUAW FLAT GROUP SITE PARKING LOOP A	PUBLIC	AS	6,882	53	97	53	90	97	97	73					
CANY-0925	238082	SQUAW FLAT LOOP B PARKING	PUBLIC	AS	2,657	53	97	53	90	97	97	73					

Section 4 Park Route Location Maps



Canyonlands National Park




Federal Lands Highway
Road Inventory Program

Canyonlands National Park


ROUTE LOCATION MAP

Key Map

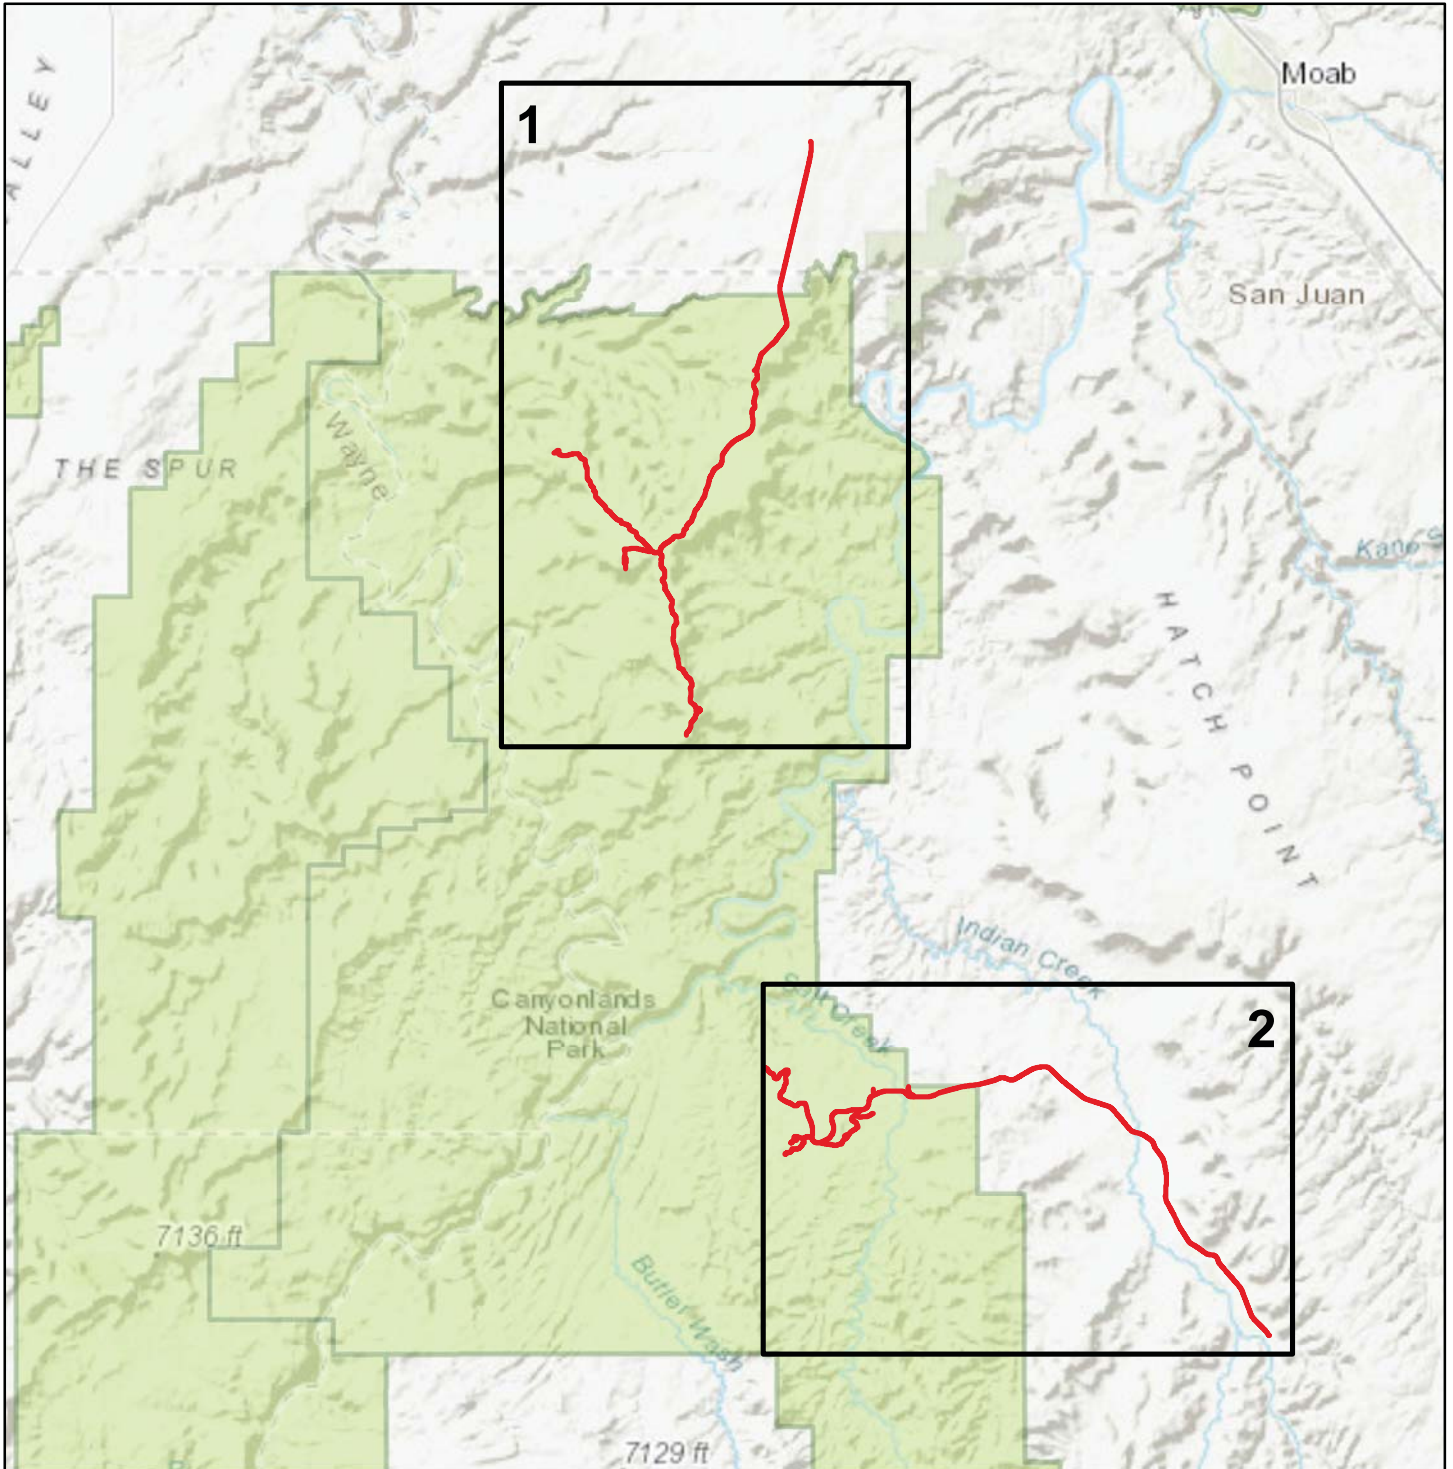

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community


Note: Unique colors are used to differentiate roads



Canyonlands National Park


ROUTE LOCATION MAP

Map 1

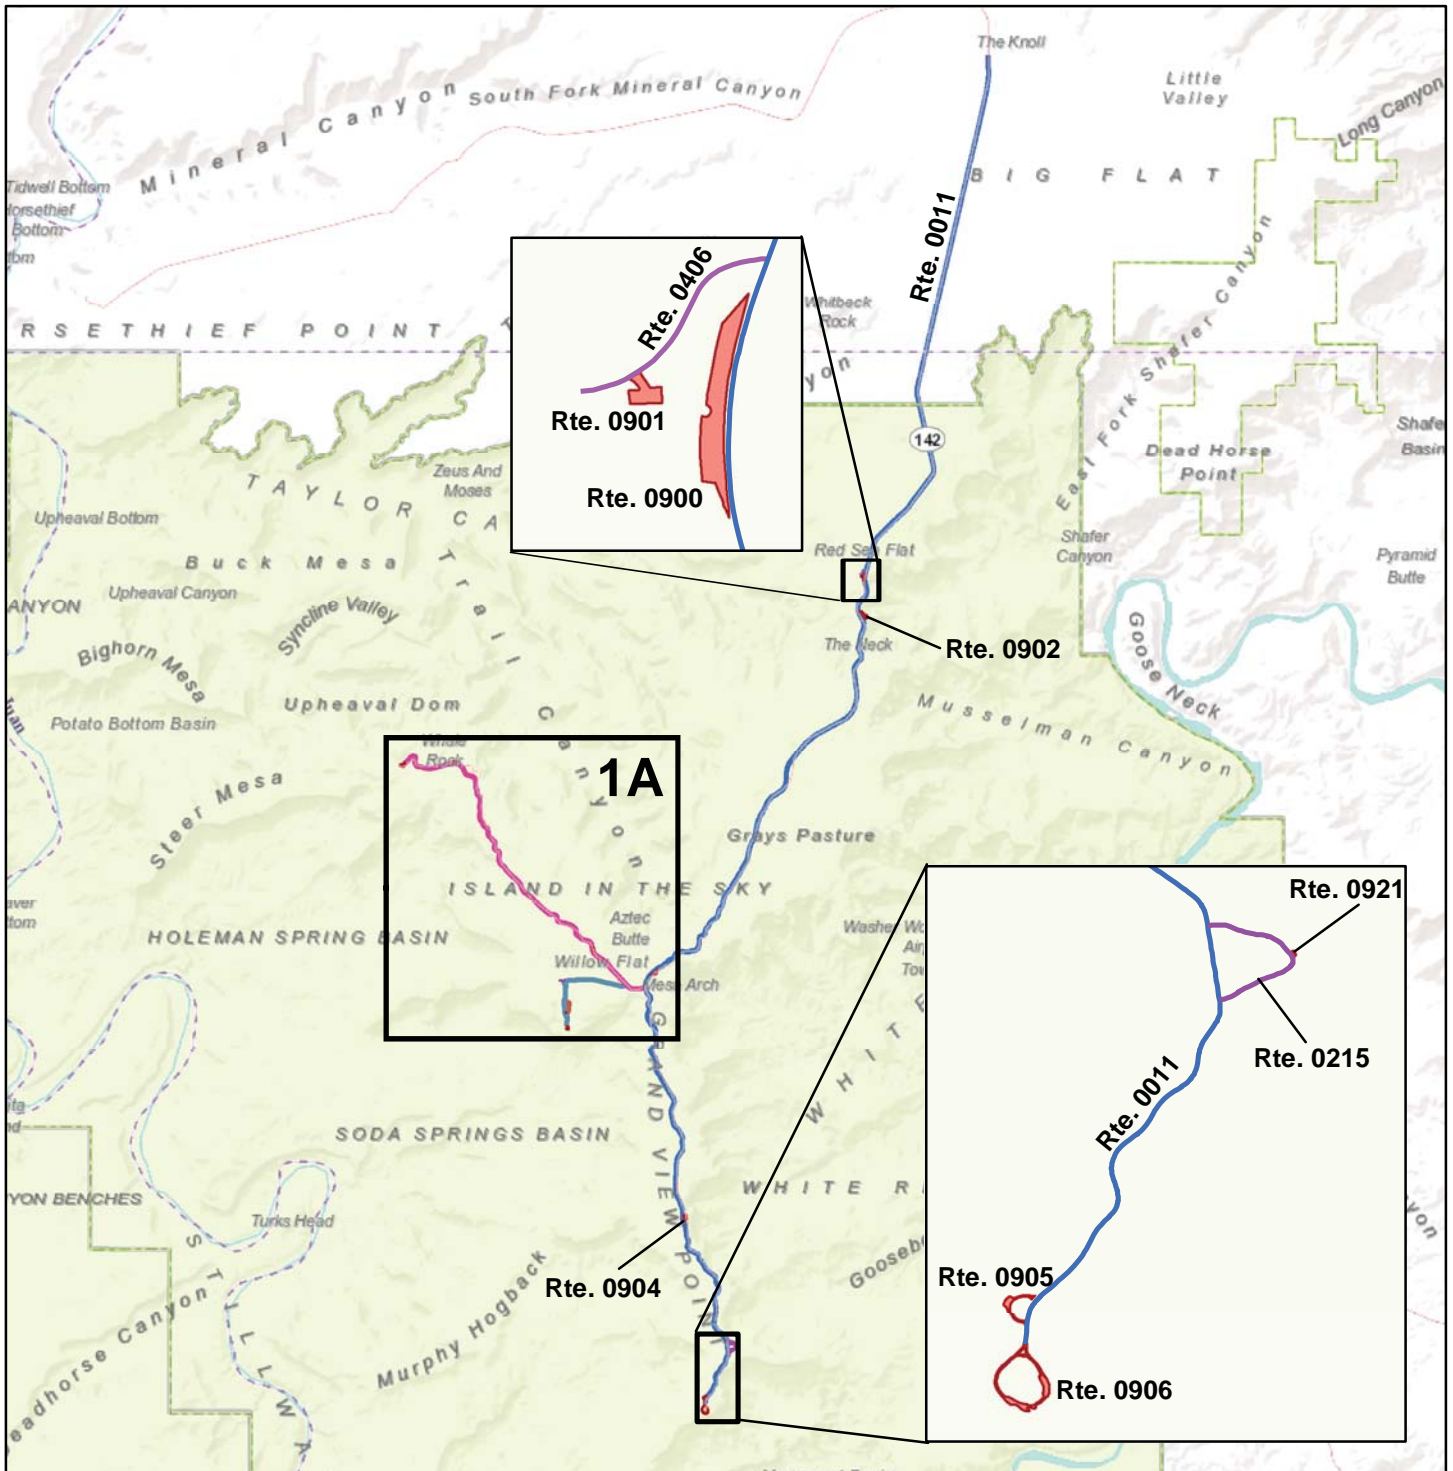

Sources: Esri, DeLorme, USGS, NPS
Sources: Esri, USGS, NOAA


Note: Unique colors are used to differentiate roads



Canyonlands National Park


ROUTE LOCATION MAP

Map 1A

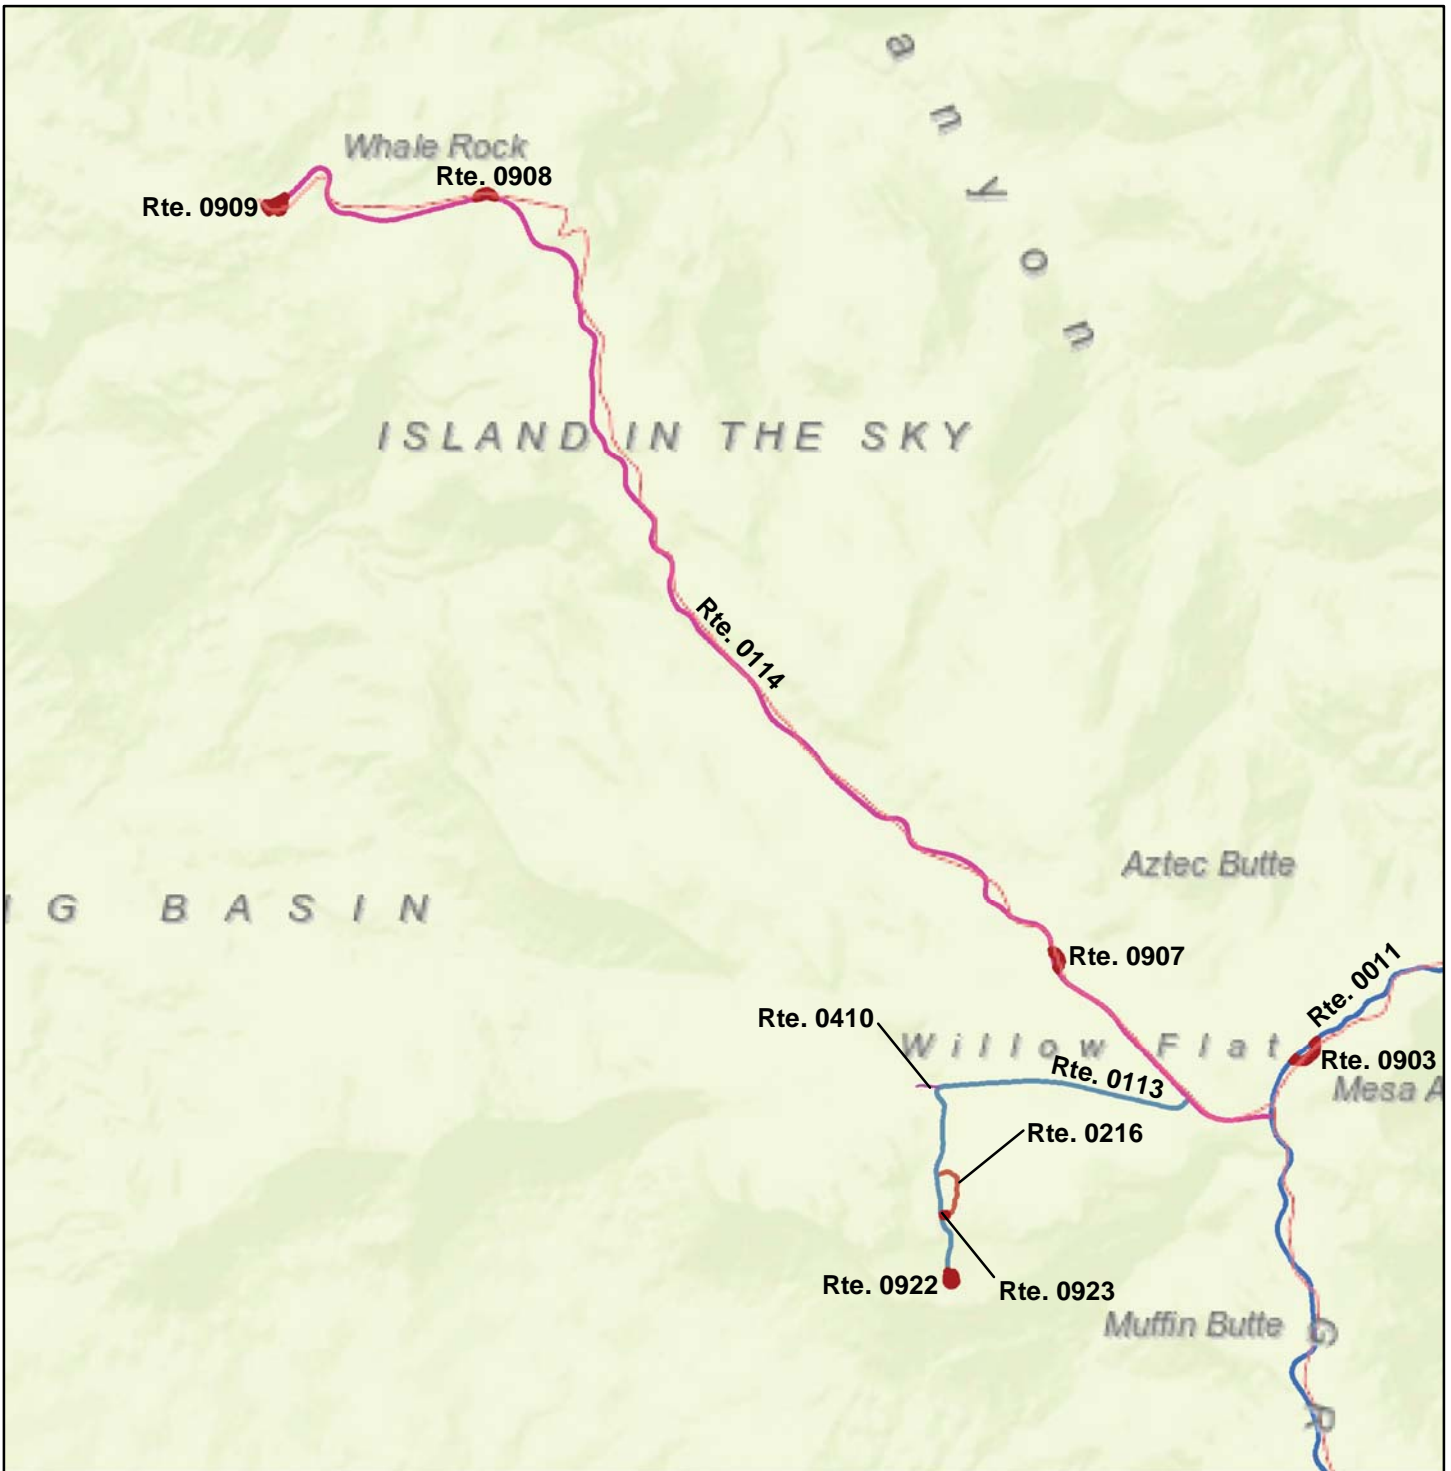

Sources: Esri, DeLorme, USGS, NPS
Sources: Esri, USGS, NOAA


Note: Unique colors are used to differentiate roads



Canyonlands National Park


ROUTE LOCATION MAP

Map 2

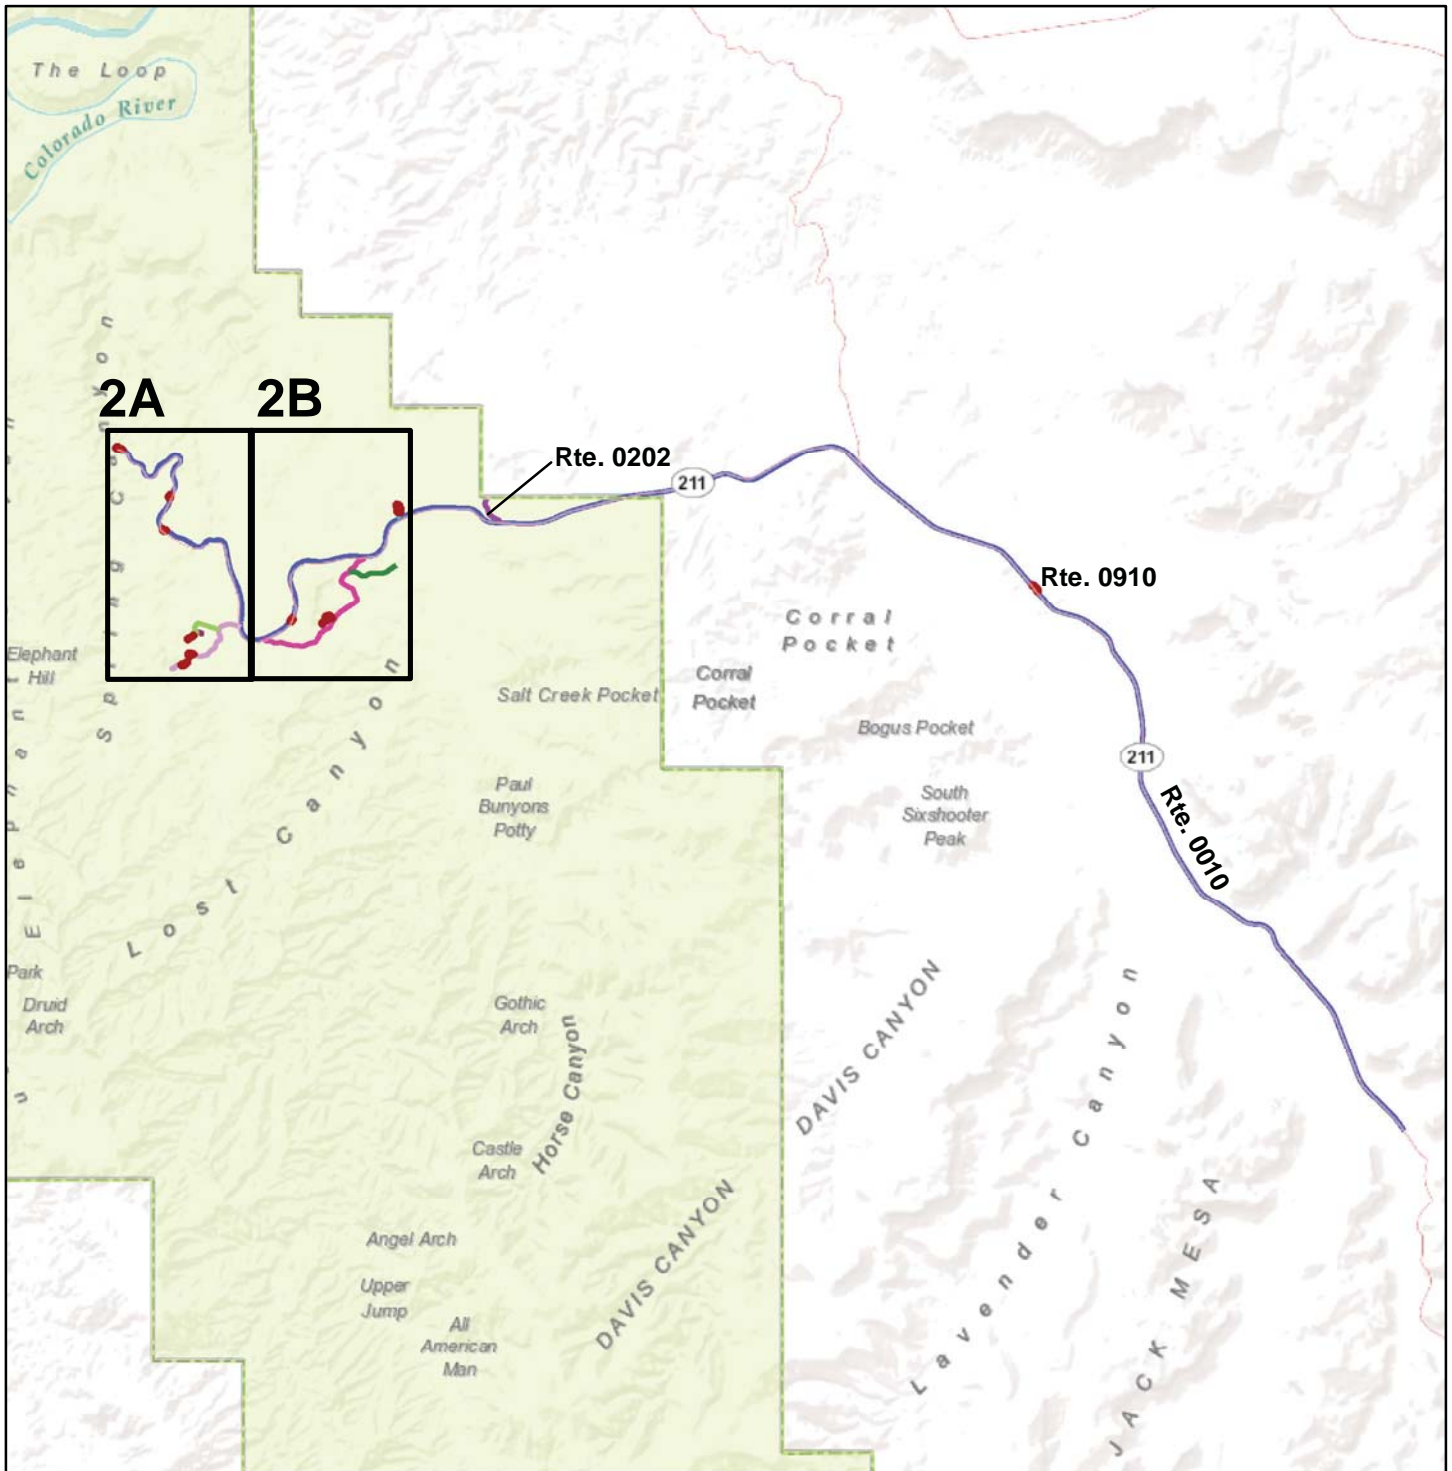

Sources: Esri, DeLorme, USGS, NPS
Sources: Esri, USGS, NOAA


Note: Unique colors are used to differentiate roads.



Canyonlands National Park


ROUTE LOCATION MAP

Map 2A

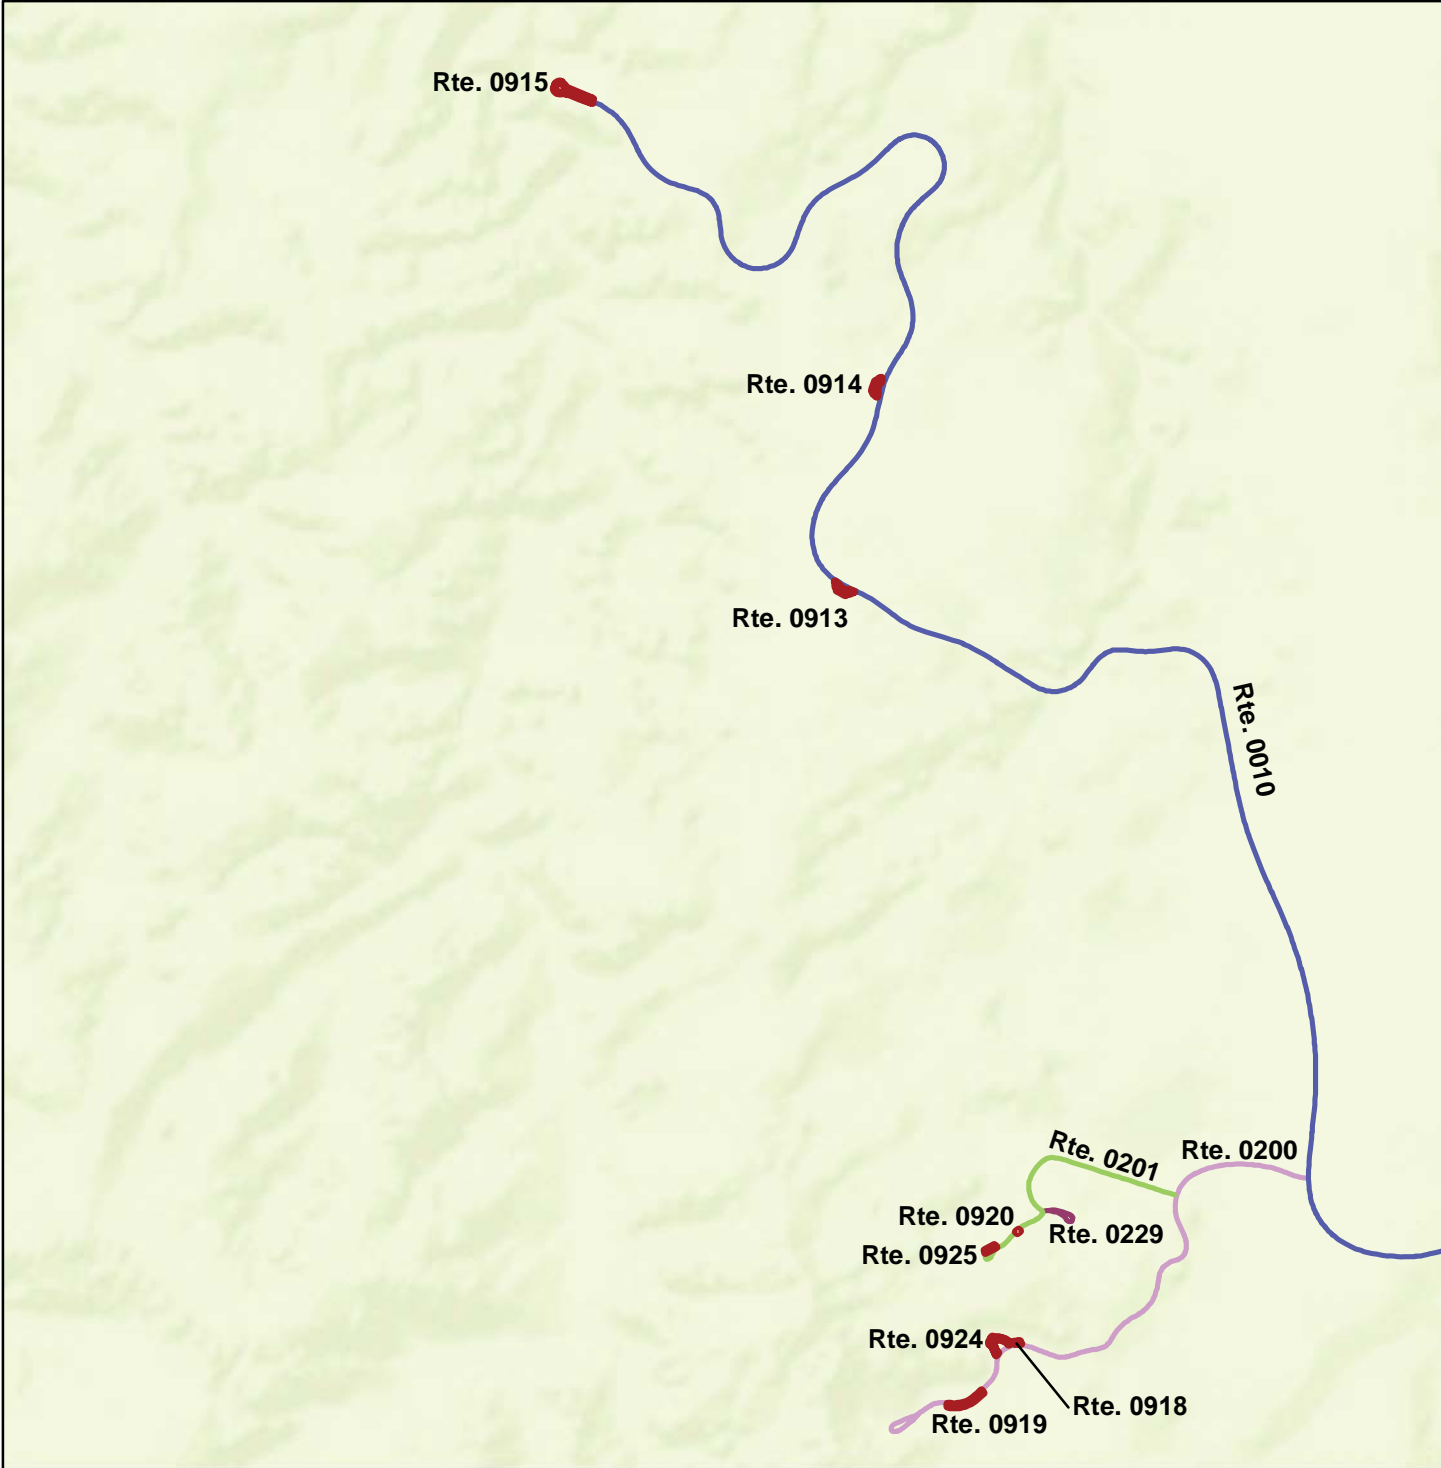

Sources: Esri, USGS, NOAA


Note: Unique colors are used to differentiate roads.



Canyonlands National Park


ROUTE LOCATION MAP


Map 2B

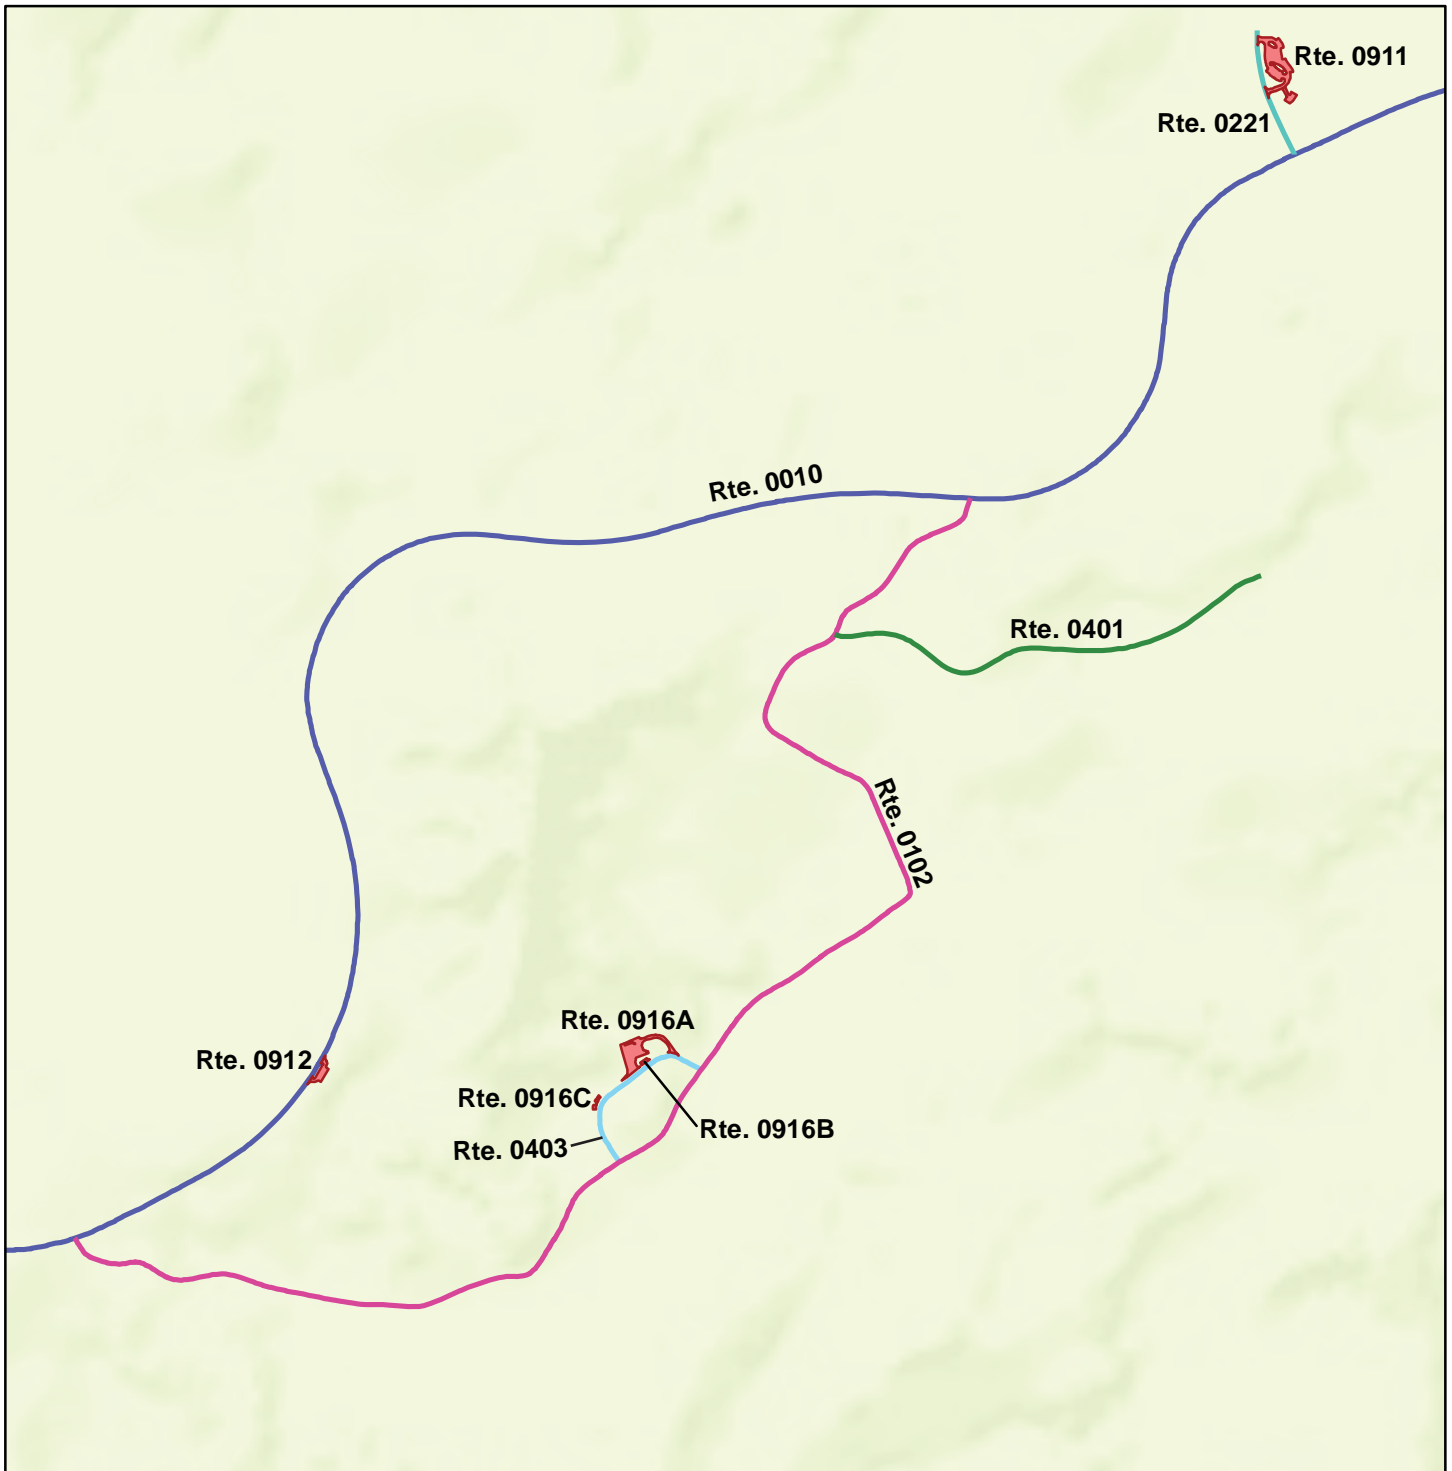

Sources: Esri, USGS, NOAA

 NPS Collected Routes

 Non-NPS Collected Routes




Canyonlands National Park

ROUTE CONDITION MAP

PCR - MILE BY MILE

Key Map

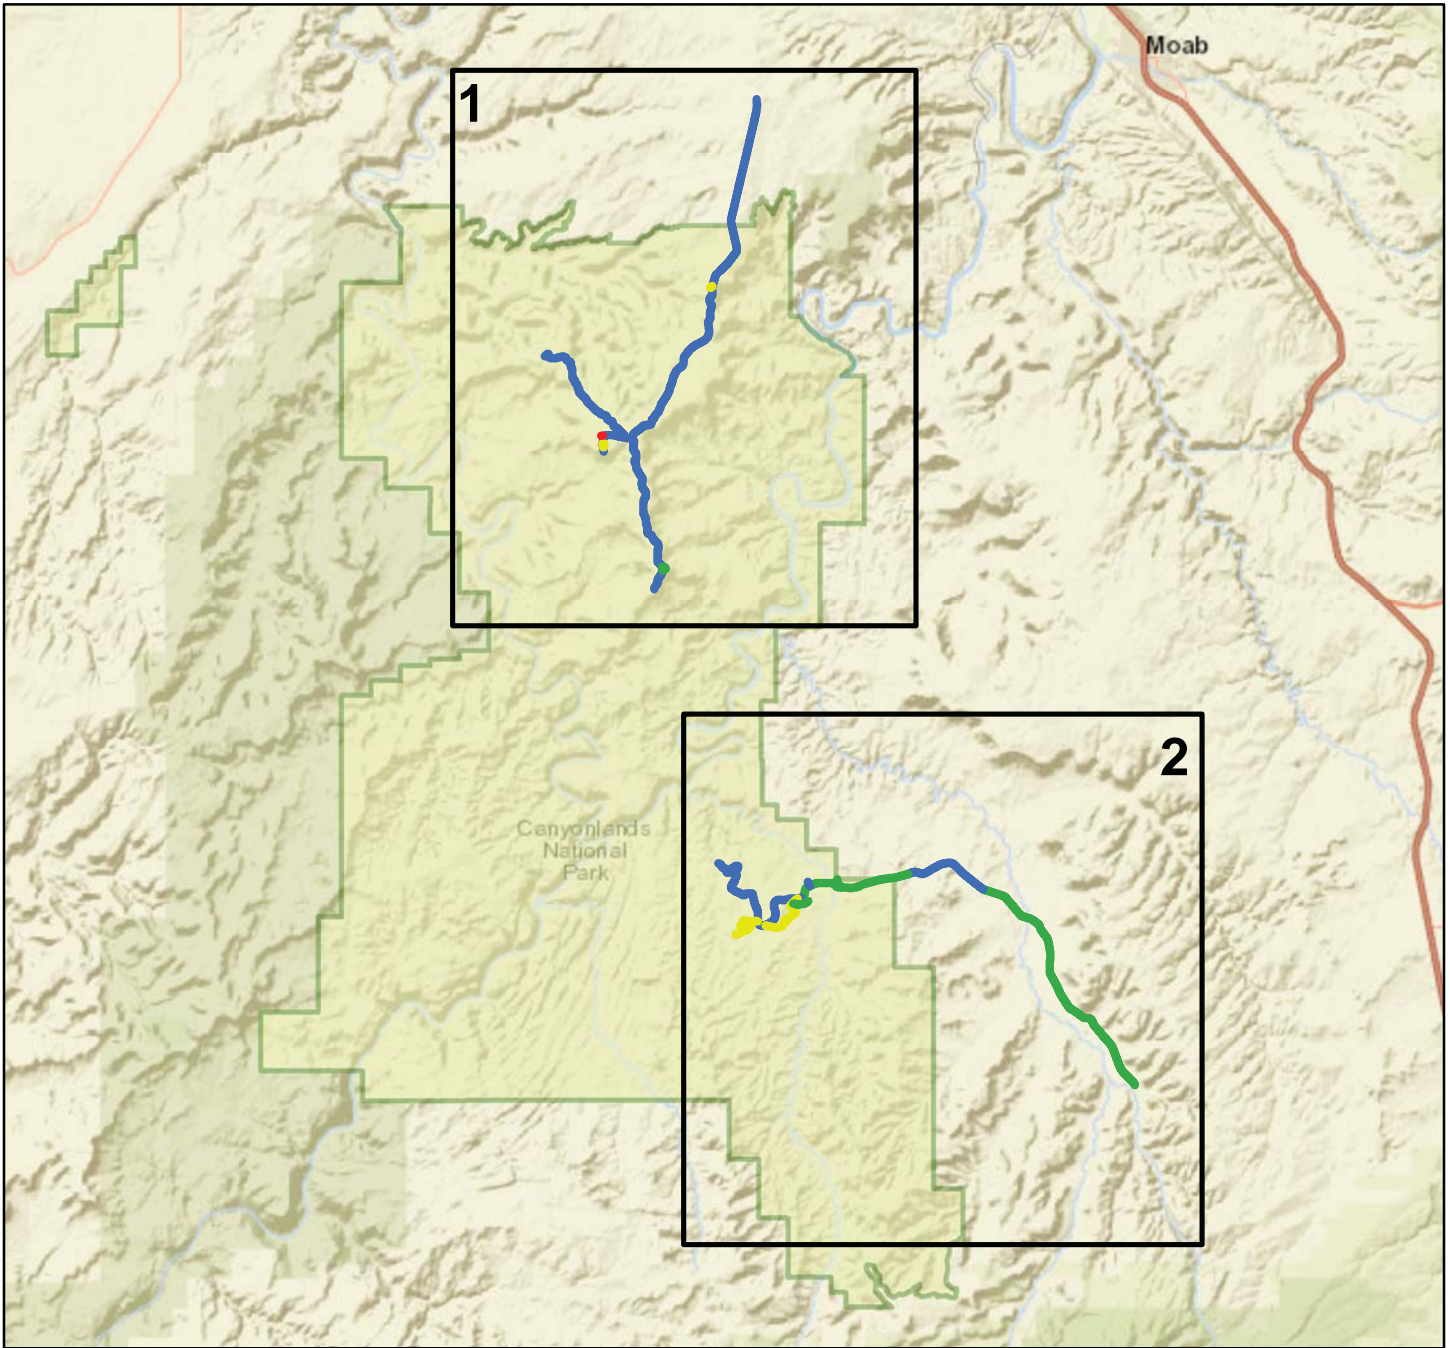

Sources: Esri, HERE, DeLorme, USGS, Intermap, increment P Corp., NRCAN, Esri Japan, METI, Esri China (Hong Kong), Esri (Thailand), TomTom, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)


Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

Only Data Collection Vehicle and Manually Rated Roads are displayed




Canyonlands National Park

ROUTE CONDITION MAP

PCR - MILE BY MILE

Map 1

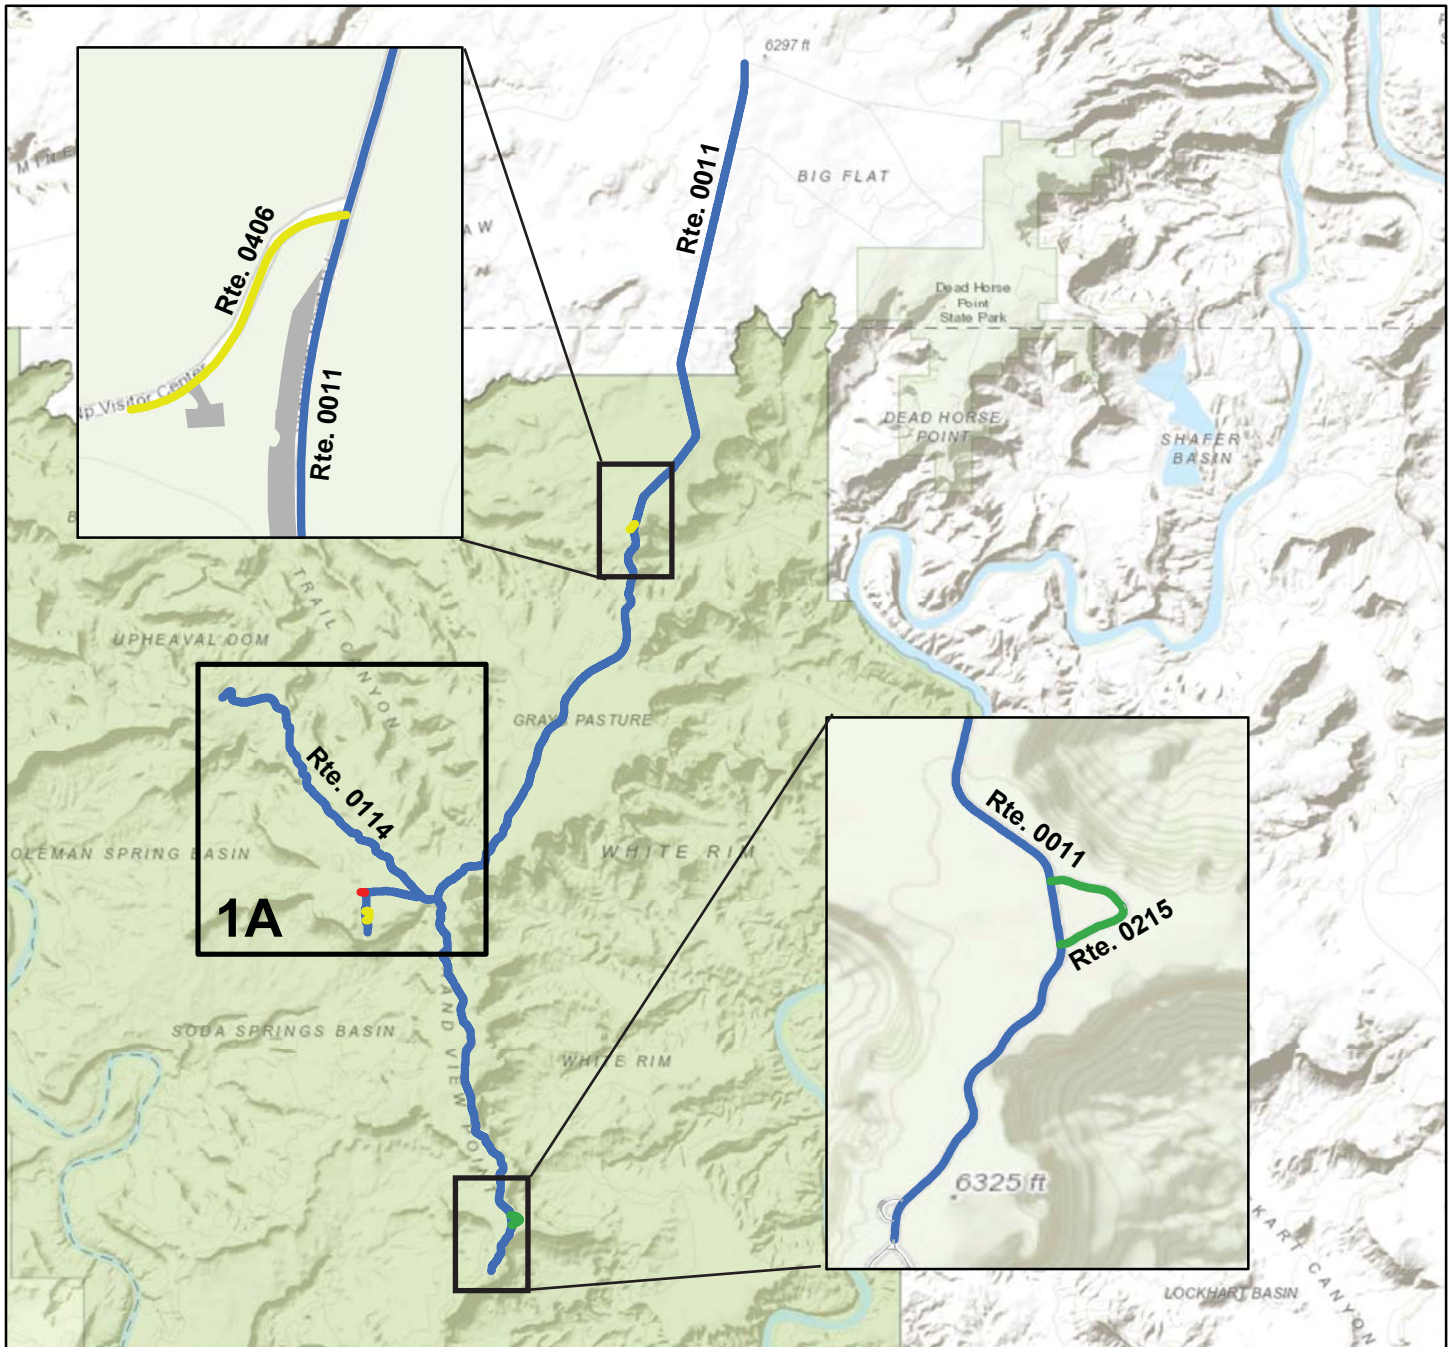


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)



See Appendix for definitions and formulas

Only Data Collection Vehicle and Manually Rated Roads are displayed



Canyonlands National Park

ROUTE CONDITION MAP

PCR - MILE BY MILE

Map 1A



Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)


Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

Only Data Collection Vehicle and Manually Rated Roads are displayed




Canyonlands National Park

ROUTE CONDITION MAP

PCR - MILE BY MILE

Map 2

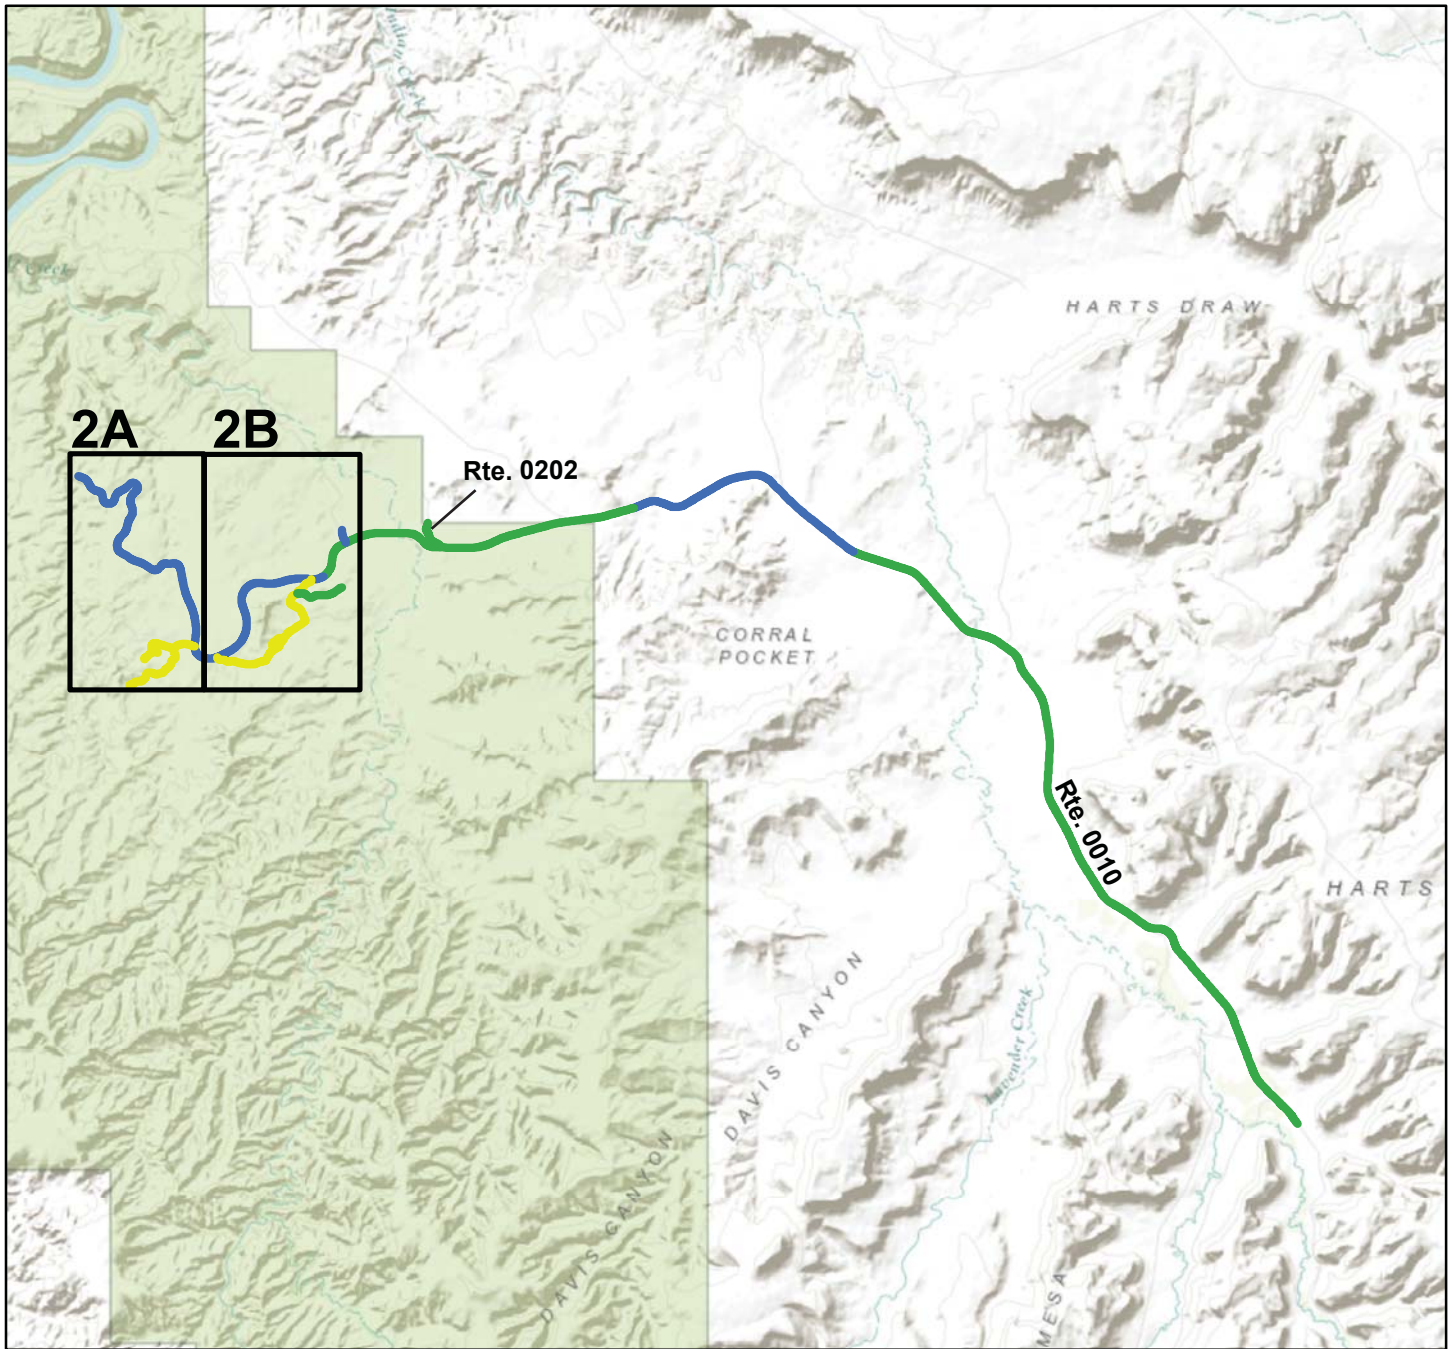

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)


Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

Only Data Collection Vehicle and Manually Rated Roads are displayed




Canyonlands National Park

ROUTE CONDITION MAP

PCR - MILE BY MILE

Map 2A

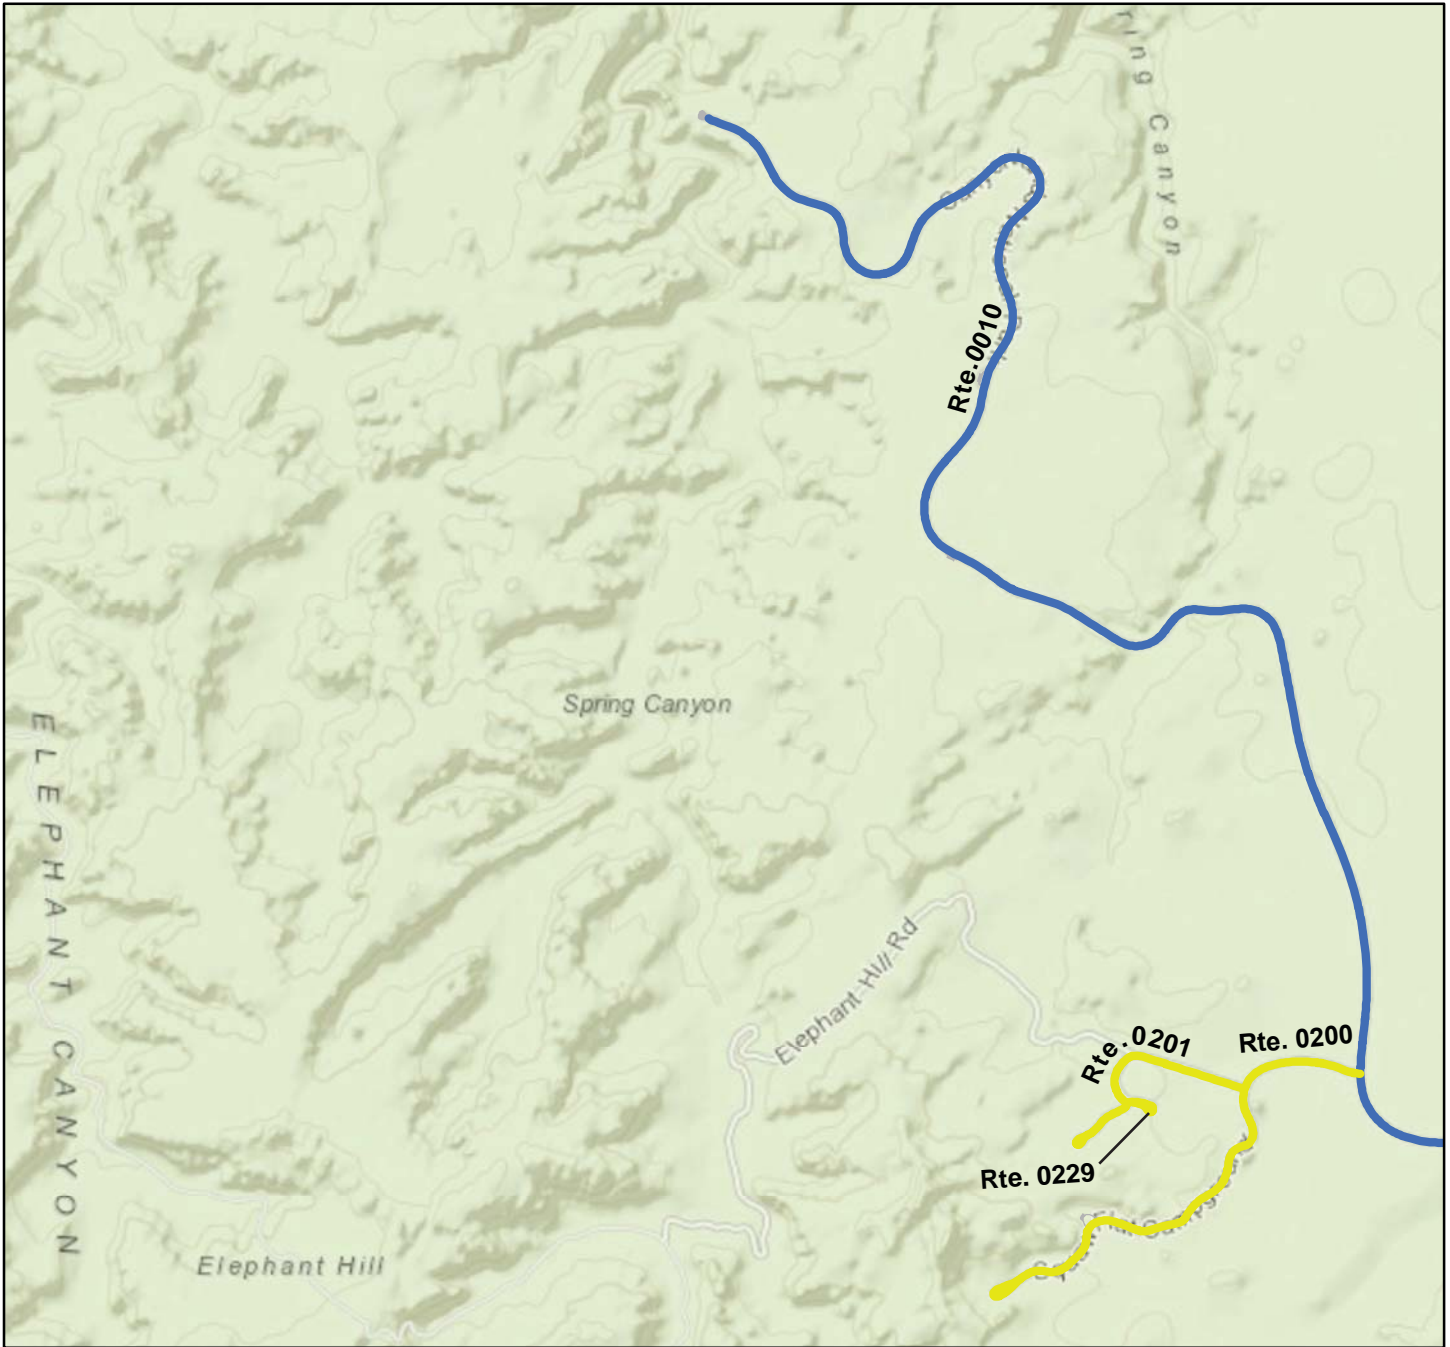

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)


Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

Only Data Collection Vehicle and Manually Rated Roads are displayed




Canyonlands National Park

ROUTE CONDITION MAP

PCR - MILE BY MILE

Map 2B

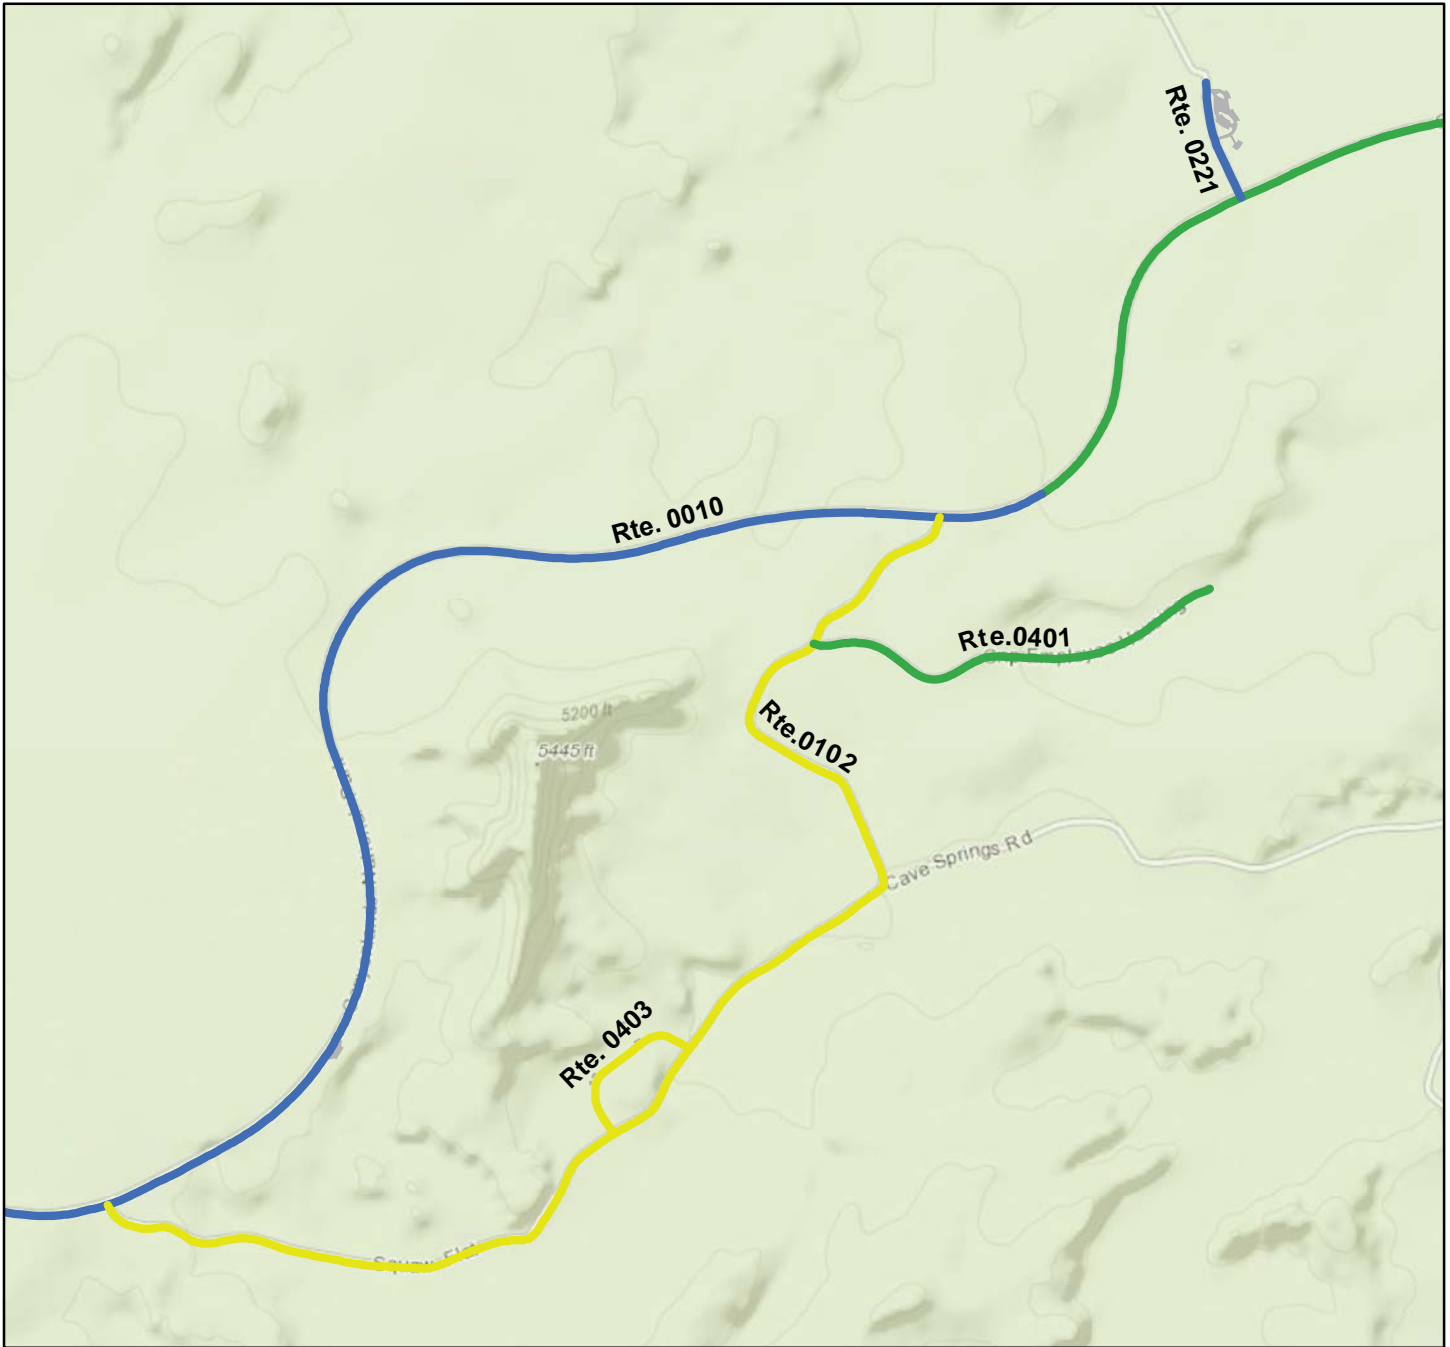

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)


Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

Only Data Collection Vehicle and Manually Rated Roads are displayed



Section 5 Paved Road Condition Rating Sheets



Canyonlands National Park




**Federal Lands Highway
Road Inventory Program**

Canyonlands National Park

ROUTE 0010: NEEDLES ACCESS ROAD

Data Collection Vehicle (DCV) Rating

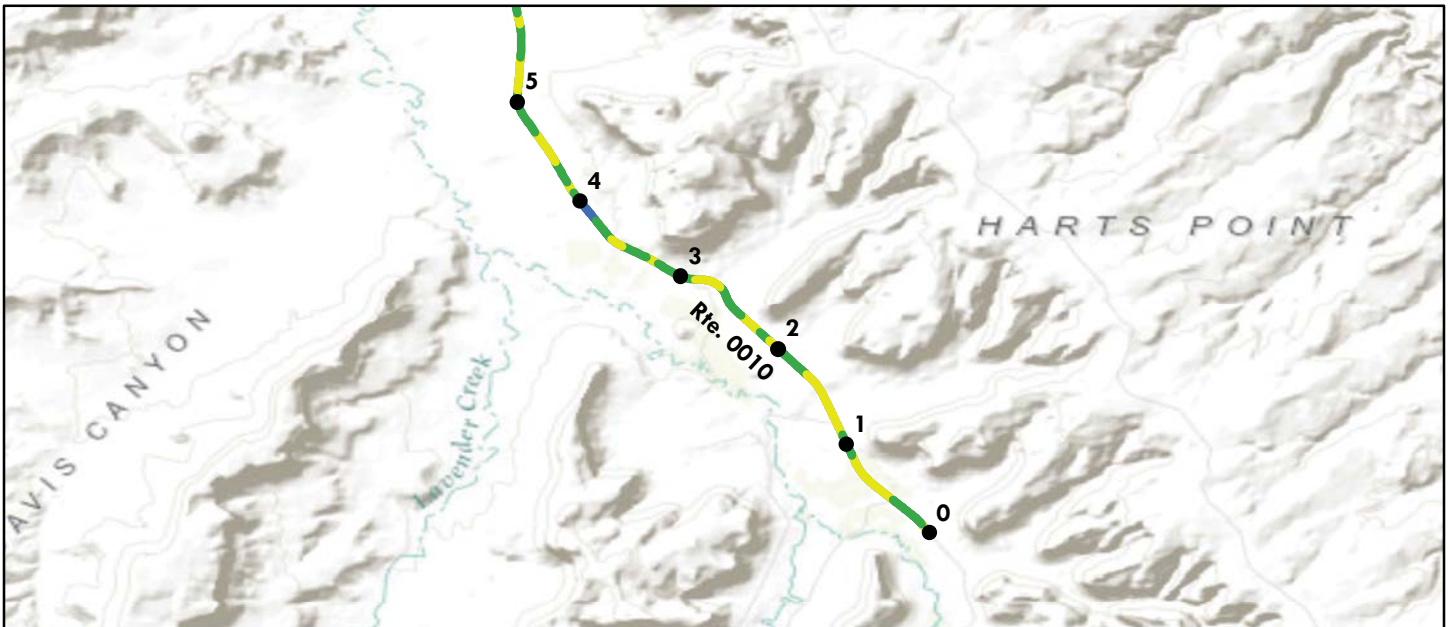


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0	1	2	3	4
Paved Length (Miles): 21.85	Section Length (MI)	1	1	1	1	1
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	93	85	86	85	90	88
Surface Condition Rating (SCR)	93	85	89	91	92	89
Roughness Condition Index (RCI)	92	84	81	76	86	87
Distress Index Values						
Structural Crack Index	97	91	90	94	93	93
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	97	91	90	94	93	93
Transverse Cracking Index	96	85	90	94	92	92
Patching Index	100	100	100	100	100	100
Rutting Index	93	94	89	91	92	89
International Roughness Index (IRI)	134	157	167	180	151	148
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	29.5	28.6	29.5	29	29.4	29.4
Lane Width (ft)	11.1	10.4	11	11	10.9	11.4

Canyonlands National Park

ROUTE 0010: NEEDLES ACCESS ROAD

Data Collection Vehicle (DCV) Rating

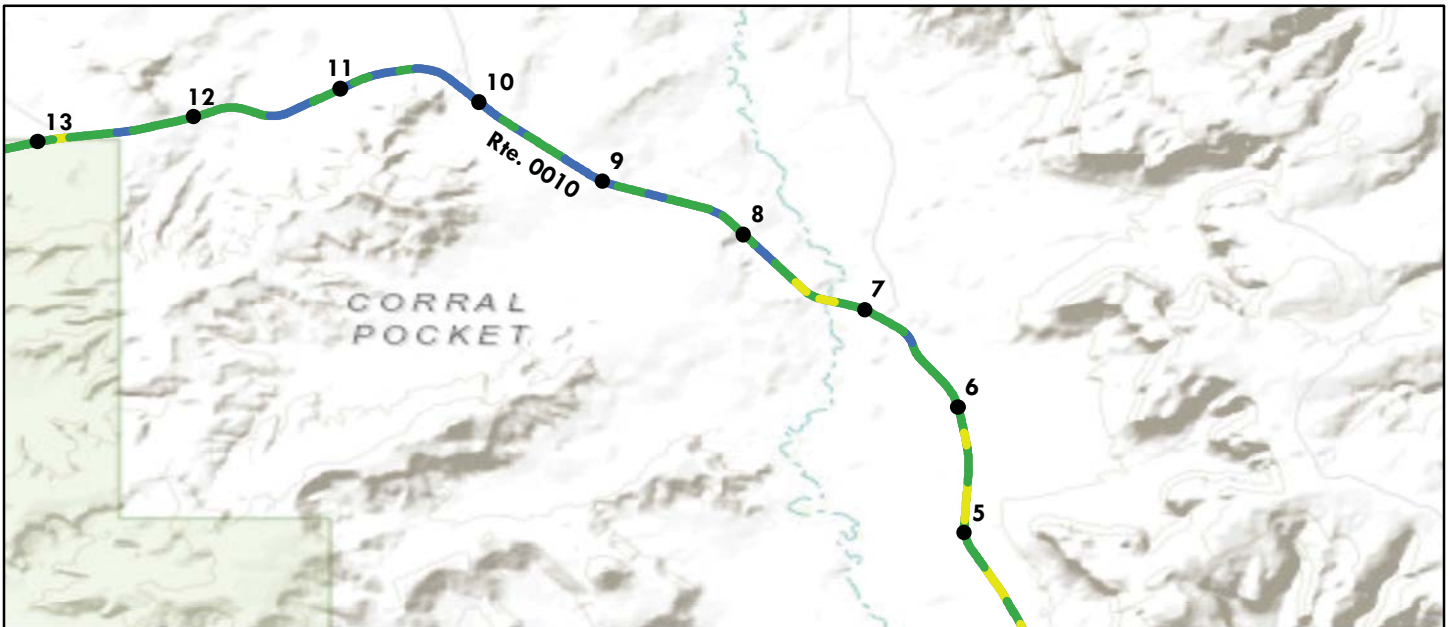


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	5	6	7	8	9
Paved Length (Miles): 21.85	Section Length (MI)	1	1	1	1	1
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	93	86	90	86	94	95
Surface Condition Rating (SCR)	93	90	91	89	90	92
Roughness Condition Index (RCI)	92	79	89	81	100	100
Distress Index Values						
Structural Crack Index	97	98	97	97	97	96
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	97	98	97	97	97	96
Transverse Cracking Index	96	95	94	96	96	94
Patching Index	100	100	100	100	100	100
Rutting Index	93	90	91	89	90	92
International Roughness Index (IRI)	134	173	142	165	108	112
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	29.5	29.9	29.9	30.1	30.1	29.8
Lane Width (ft)	11.1	11.7	11.6	11.4	11.5	11.1

Canyonlands National Park

ROUTE 0010: NEEDLES ACCESS ROAD

Data Collection Vehicle (DCV) Rating

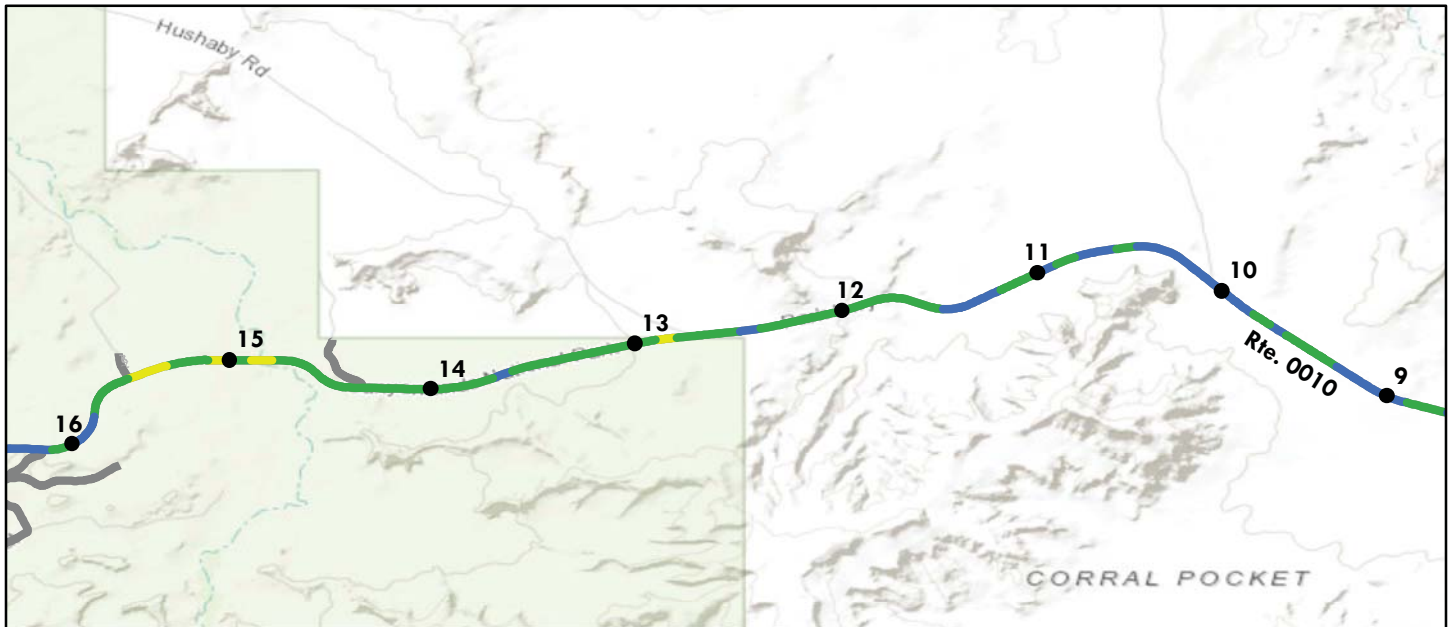


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	10	11	12	13	14
Paved Length (Miles): 21.85	Section Length (MI)	1	1	1	1	1
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	93	96	95	91	91	90
Surface Condition Rating (SCR)	93	94	94	90	91	92
Roughness Condition Index (RCI)	92	100	96	93	92	87
Distress Index Values						
Structural Crack Index	97	99	99	99	97	97
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	97	99	99	99	97	97
Transverse Cracking Index	96	99	98	98	96	94
Patching Index	100	100	100	100	100	100
Rutting Index	93	94	94	90	91	92
International Roughness Index (IRI)	134	112	126	132	135	148
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	29.5	29.4	30.8	30.6	30	30.1
Lane Width (ft)	11.1	11.1	11.4	11.5	11.2	11.2

Canyonlands National Park

ROUTE 0010: NEEDLES ACCESS ROAD

Data Collection Vehicle (DCV) Rating

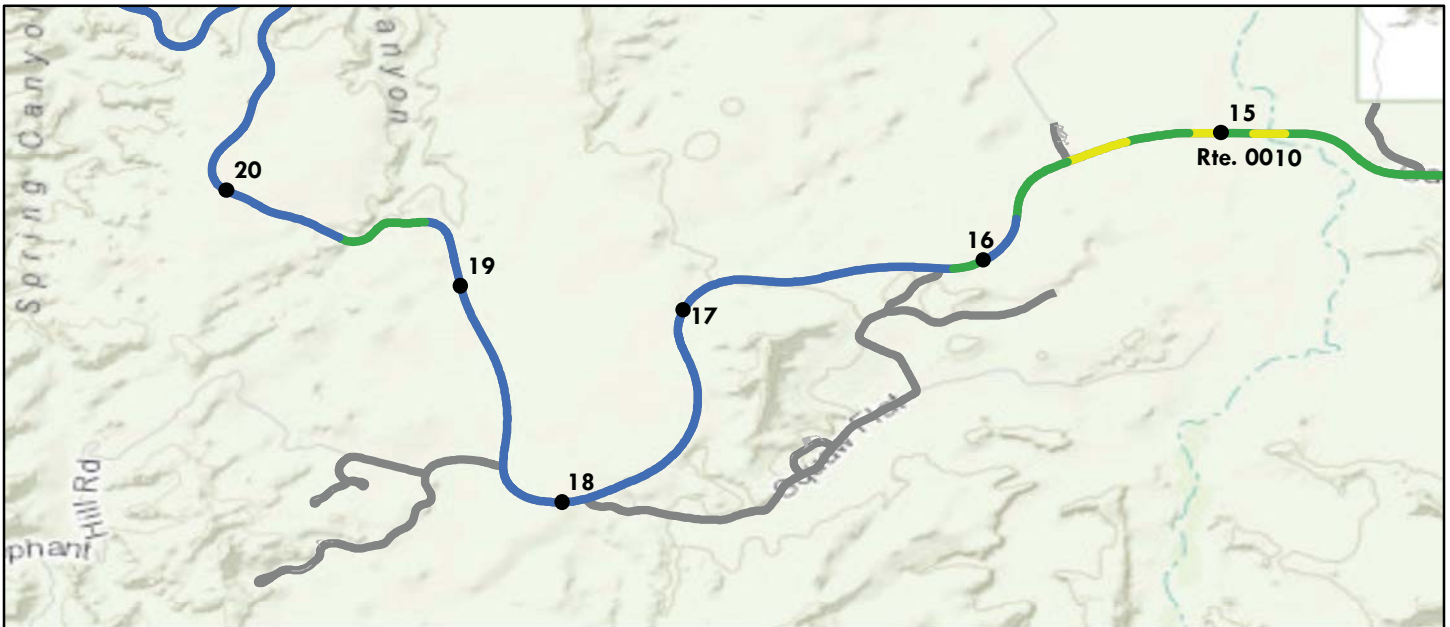


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	15	16	17	18	19
Paved Length (Miles): 21.85	Section Length (MI)	1	1	1	1	1
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	93	88	99	99	99	99
Surface Condition Rating (SCR)	93	92	98	99	99	99
Roughness Condition Index (RCI)	92	82	100	100	100	100
Distress Index Values						
Structural Crack Index	97	98	100	100	100	100
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	97	98	100	100	100	100
Transverse Cracking Index	96	96	99	99	99	99
Patching Index	100	100	100	100	100	100
Rutting Index	93	92	98	99	99	99
International Roughness Index (IRI)	134	164	93	91	115	115
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	29.5	30.5	29.8	29.4	28.6	27.9
Lane Width (ft)	11.1	11.1	10.8	11	10.9	9.8

Canyonlands National Park

ROUTE 0010: NEEDLES ACCESS ROAD

Data Collection Vehicle (DCV) Rating

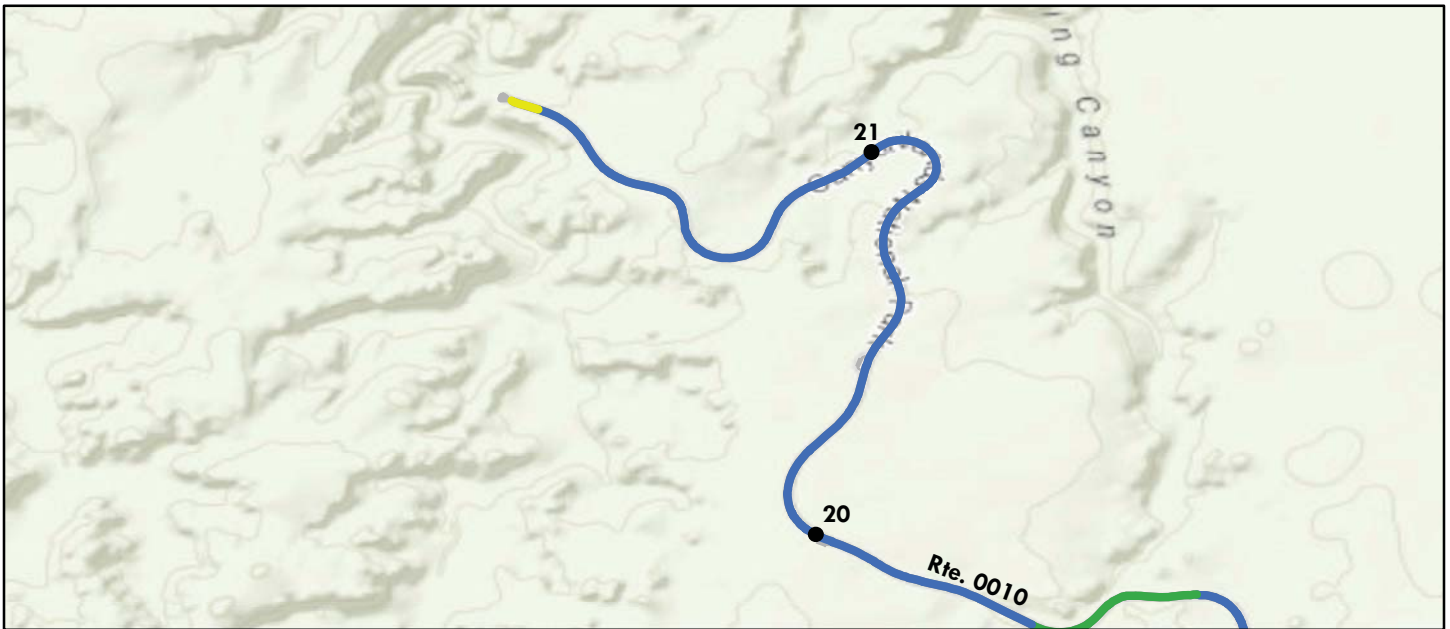


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)									
Poor (0 - 60)		Fair (61- 84)		Good (85 - 94)		Excellent (95 - 100)		Not Rated	
See Appendix for definitions and formulas									
Inspection Date:	6/5/2017	Beginning Section MP	20	21					
Paved Length (Miles):	21.85	Section Length (MI)	1	0.85					
Surface Type:	ASPHALT	Route Summary							
Roadway Condition Information									
Pavement Condition Rating (PCR)	93	99	99						
Surface Condition Rating (SCR)	93	99	99						
Roughness Condition Index (RCI)	92	100	98						
Distress Index Values									
Structural Crack Index	97	100	99						
Alligator Crack Index	100	100	100						
Longitudinal Crack Index	97	100	99						
Transverse Cracking Index	96	99	99						
Patching Index	100	100	100						
Rutting Index	93	99	99						
International Roughness Index (IRI)	134	103	120						
Lane & Width Information									
Number of Lanes	2	2	2						
Paved Width (ft)	29.5	28.3	28.2						
Lane Width (ft)	11.1	10.6	10.9						

Canyonlands National Park

ROUTE 0011: ISLAND IN THE SKY ROAD

Data Collection Vehicle (DCV) Rating

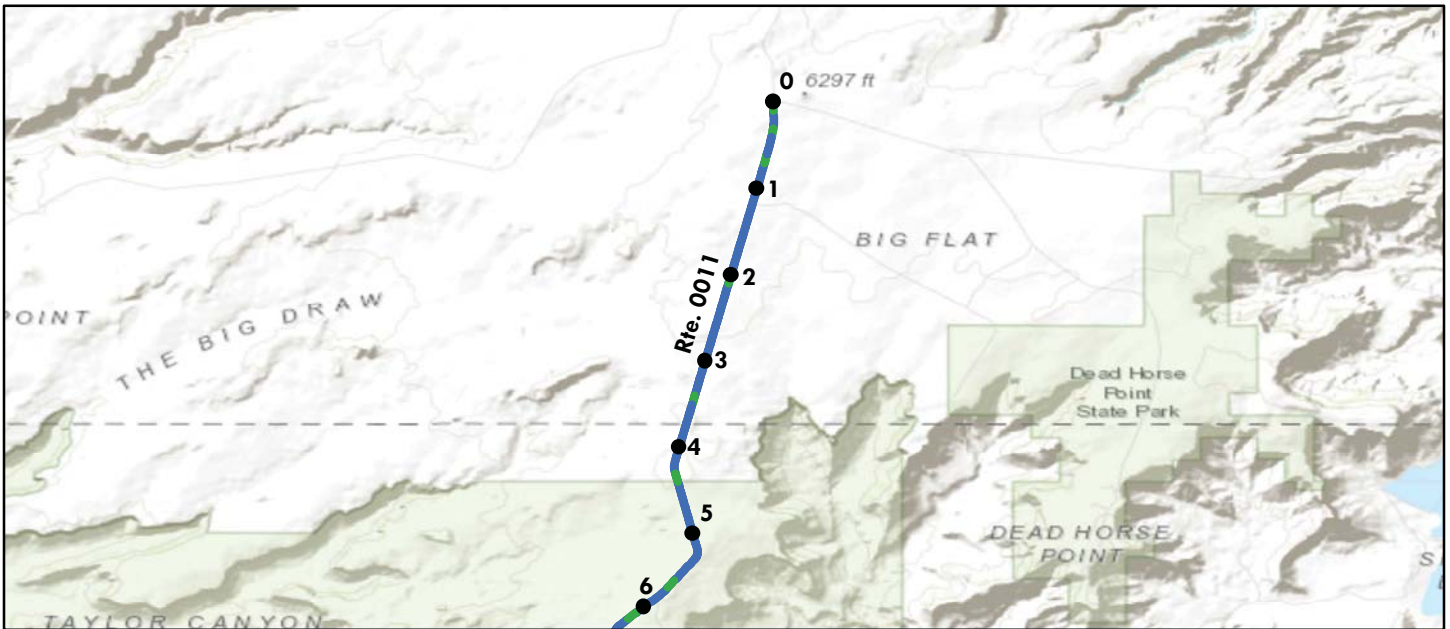

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0	1	2	3	4
Paved Length (Miles): 18.90	Section Length (MI)	1	1	1	1	1
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	98	96	98	98	98	99
Surface Condition Rating (SCR)	97	94	97	96	96	99
Roughness Condition Index (RCI)	100	100	100	100	100	100
Distress Index Values						
Structural Crack Index	99	98	98	97	98	99
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	99	98	98	97	98	99
Transverse Cracking Index	99	97	98	97	98	99
Patching Index	100	100	100	100	100	100
Rutting Index	97	94	97	96	96	99
International Roughness Index (IRI)	91	97	78	86	96	111
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	29	32.9	31.6	33.3	33.9	30.4
Lane Width (ft)	10.7	11	11	10.7	10.8	11.1

Canyonlands National Park

ROUTE 0011: ISLAND IN THE SKY ROAD

Data Collection Vehicle (DCV) Rating



Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	5	6	7	8	9
Paved Length (Miles): 18.90	Section Length (MI)	1	1	1	1	1
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	98	99	99	99	98	97
Surface Condition Rating (SCR)	97	98	98	99	97	95
Roughness Condition Index (RCI)	100	100	100	100	100	100
Distress Index Values						
Structural Crack Index	99	100	99	100	99	99
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	99	100	99	100	99	99
Transverse Cracking Index	99	99	99	100	98	98
Patching Index	100	100	99	100	100	100
Rutting Index	97	98	98	99	97	95
International Roughness Index (IRI)	91	96	96	87	86	88
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	29	29.6	28.4	32.7	27.8	26.4
Lane Width (ft)	10.7	11.1	11.1	10.9	10.8	11.1

Canyonlands National Park

ROUTE 0011: ISLAND IN THE SKY ROAD

Data Collection Vehicle (DCV) Rating




Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	10	11	12	13	14
Paved Length (Miles): 18.90	Section Length (MI)	1	1	1	1	1
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	98	97	98	99	99	99
Surface Condition Rating (SCR)	97	95	97	99	98	99
Roughness Condition Index (RCI)	100	100	100	100	100	100
Distress Index Values						
Structural Crack Index	99	99	100	100	100	100
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	99	99	100	100	100	100
Transverse Cracking Index	99	98	99	100	100	100
Patching Index	100	100	100	100	100	100
Rutting Index	97	95	97	99	98	99
International Roughness Index (IRI)	91	92	97	100	94	80
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	29	27.3	26.4	27.6	29.5	26.3
Lane Width (ft)	10.7	10.9	10.9	10.8	10.6	10.2

Canyonlands National Park

ROUTE 0011: ISLAND IN THE SKY ROAD

Data Collection Vehicle (DCV) Rating

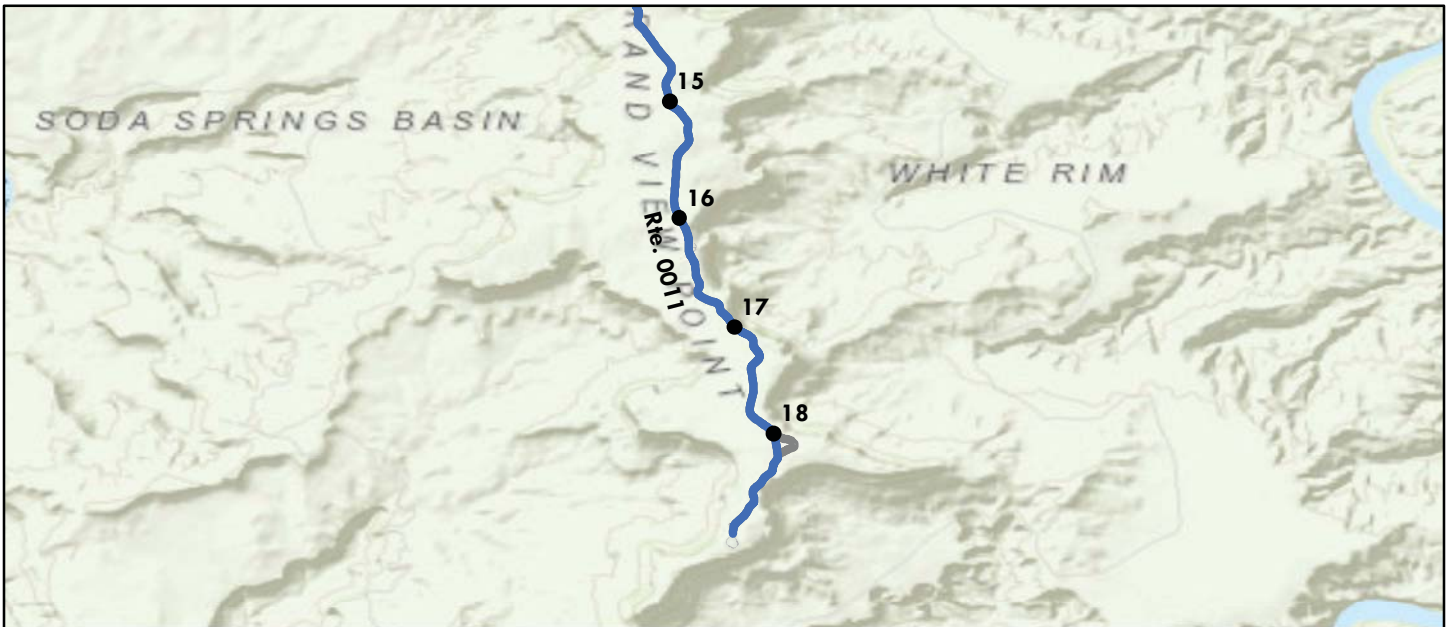


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	15	16	17	18	
Paved Length (Miles): 18.90	Section Length (MI)	1	1	1	0.90	
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	98	99	99	99	99	
Surface Condition Rating (SCR)	97	98	99	98	99	
Roughness Condition Index (RCI)	100	100	100	100	100	
Distress Index Values						
Structural Crack Index	99	100	100	100	100	
Alligator Crack Index	100	100	100	100	100	
Longitudinal Crack Index	99	100	100	100	100	
Transverse Cracking Index	99	99	100	100	99	
Patching Index	100	100	100	100	100	
Rutting Index	97	98	99	98	99	
International Roughness Index (IRI)	91	82	81	85	88	
Lane & Width Information						
Number of Lanes	2	2	2	2	2	
Paved Width (ft)	29	28	26.5	26.3	25.6	
Lane Width (ft)	10.7	10.2	10.3	10.2	10.2	

Canyonlands National Park

ROUTE 0102: WOODEN SHOE LOOP

Data Collection Vehicle (DCV) Rating

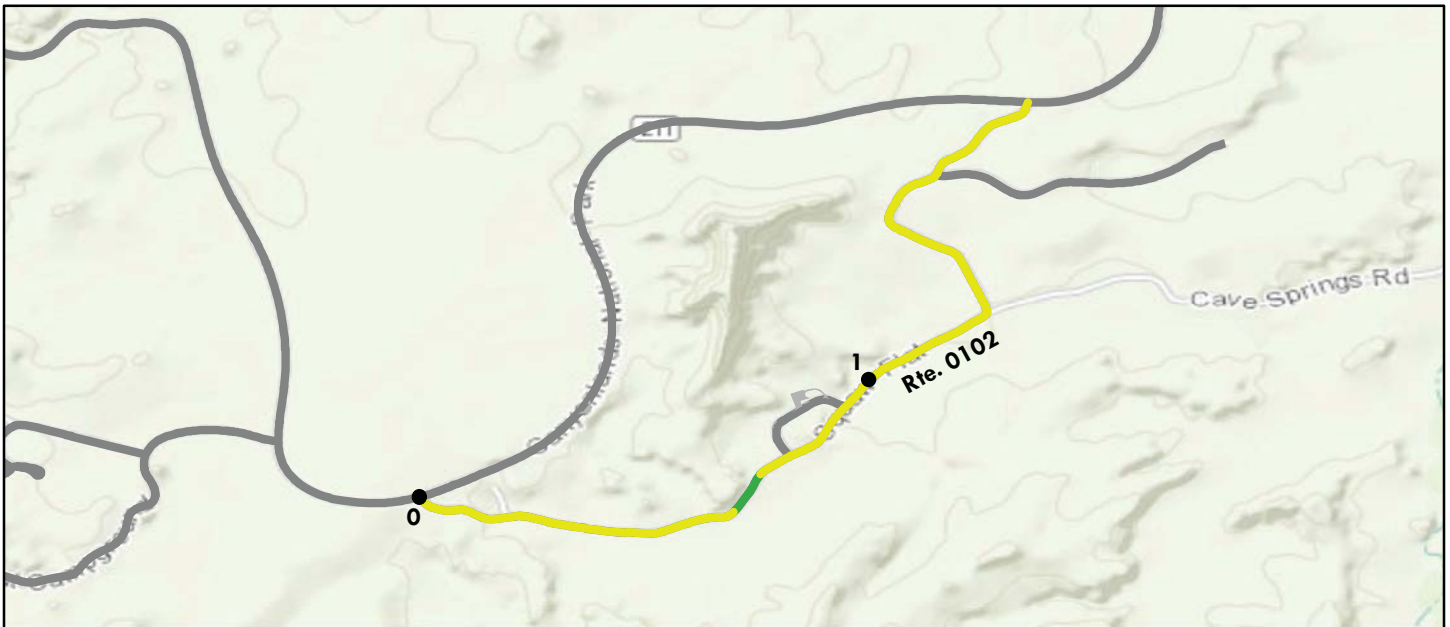

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0	1			
Paved Length (Miles): 1.94	Section Length (MI)	1	0.94			
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	80	79	80			
Surface Condition Rating (SCR)	87	85	88			
Roughness Condition Index (RCI)	69	69	69			
Distress Index Values						
Structural Crack Index	93	93	93			
Alligator Crack Index	100	100	100			
Longitudinal Crack Index	93	93	93			
Transverse Cracking Index	87	85	88			
Patching Index	100	100	100			
Rutting Index	96	96	96			
International Roughness Index (IRI)	205	204	206			
Lane & Width Information						
Number of Lanes	2	2	2			
Paved Width (ft)	23.5	23.3	23.8			
Lane Width (ft)	9.4	9.4	9.4			

Canyonlands National Park

ROUTE 0113: GREEN RIVER OVERLOOK ROAD

Data Collection Vehicle (DCV) Rating




Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0	1			
Paved Length (Miles): 1.35	Section Length (MI)	1	0.35			
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	97	97	95			
Surface Condition Rating (SCR)	95	95	96			
Roughness Condition Index (RCI)	100	100	93			
Distress Index Values						
Structural Crack Index	100	100	100			
Alligator Crack Index	100	100	100			
Longitudinal Crack Index	100	100	100			
Transverse Cracking Index	99	100	99			
Patching Index	100	100	100			
Rutting Index	95	95	96			
International Roughness Index (IRI)	107	98	132			
Lane & Width Information						
Number of Lanes	2	2	2			
Paved Width (ft)	22.6	22.4	23.1			
Lane Width (ft)	9.8	9.8	9.8			

Canyonlands National Park

ROUTE 0114: UPHEAVAL DOME ROAD

Data Collection Vehicle (DCV) Rating

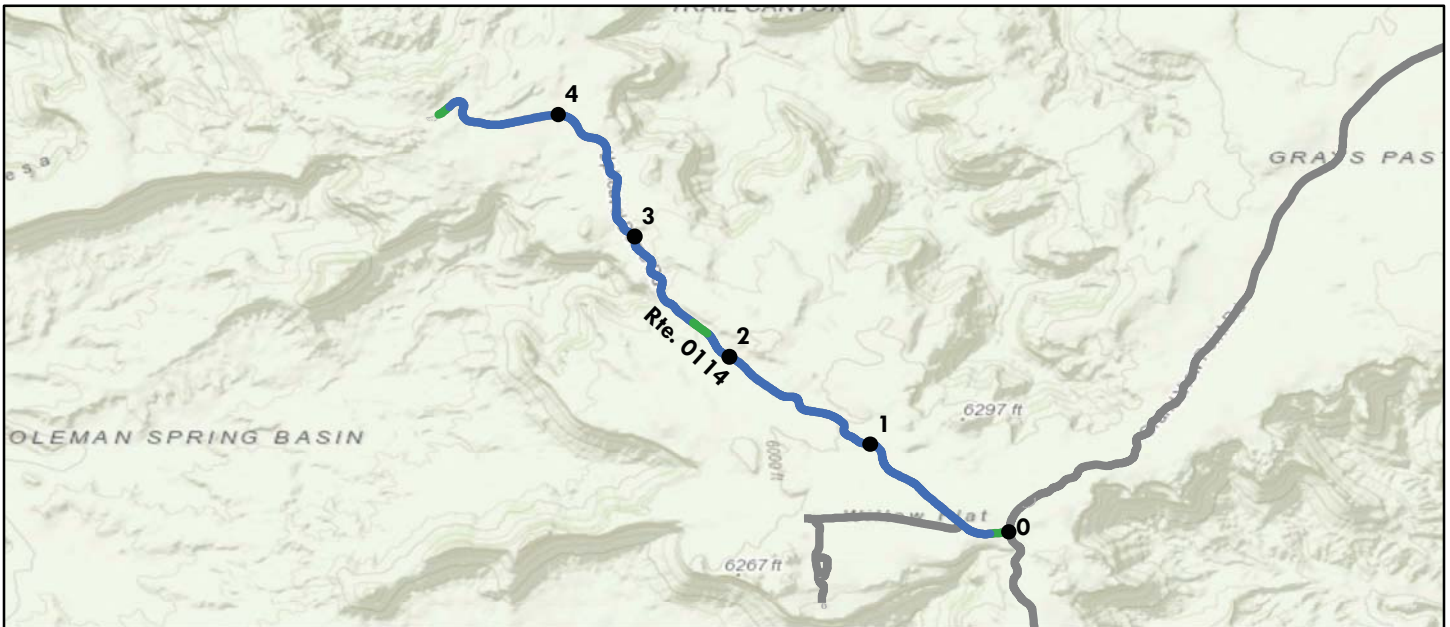

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0	1	2	3	4
Paved Length (Miles): 4.78	Section Length (MI)	1	1	1	1	0.78
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	99	98	99	99	100	99
Surface Condition Rating (SCR)	98	97	99	98	100	99
Roughness Condition Index (RCI)	100	100	100	100	100	100
Distress Index Values						
Structural Crack Index	100	100	100	100	100	100
Alligator Crack Index	100	100	100	100	100	100
Longitudinal Crack Index	100	100	100	100	100	100
Transverse Cracking Index	99	100	99	99	100	100
Patching Index	100	100	100	100	100	100
Rutting Index	98	97	99	98	100	99
International Roughness Index (IRI)	106	108	105	116	93	110
Lane & Width Information						
Number of Lanes	2	2	2	2	2	2
Paved Width (ft)	26.8	26.3	27.3	26	27.4	27.3
Lane Width (ft)	10.3	10.6	10.3	10.2	10.1	10.1

Canyonlands National Park

ROUTE 0200: SQUAW FLAT CAMPGROUND ROAD (LOOP A)

Data Collection Vehicle (DCV) Rating




Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0	1			
Paved Length (Miles): 1.13	Section Length (MI)	1	0.13			
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	83	83	84			
Surface Condition Rating (SCR)	94	94	92			
Roughness Condition Index (RCI)	66	66	72			
Distress Index Values						
Structural Crack Index	98	99	97			
Alligator Crack Index	100	100	100			
Longitudinal Crack Index	98	99	97			
Transverse Cracking Index	95	95	92			
Patching Index	100	100	100			
Rutting Index	94	94	95			
International Roughness Index (IRI)	215	217	194			
Lane & Width Information						
Number of Lanes	2	2	1			
Paved Width (ft)	21.7	22.5	15.4			
Lane Width (ft)	9.5	9.2	11.1			

Canyonlands National Park

ROUTE 0201: SQUAW FLAT CAMPGROUND ROAD (LOOP B)

Data Collection Vehicle (DCV) Rating

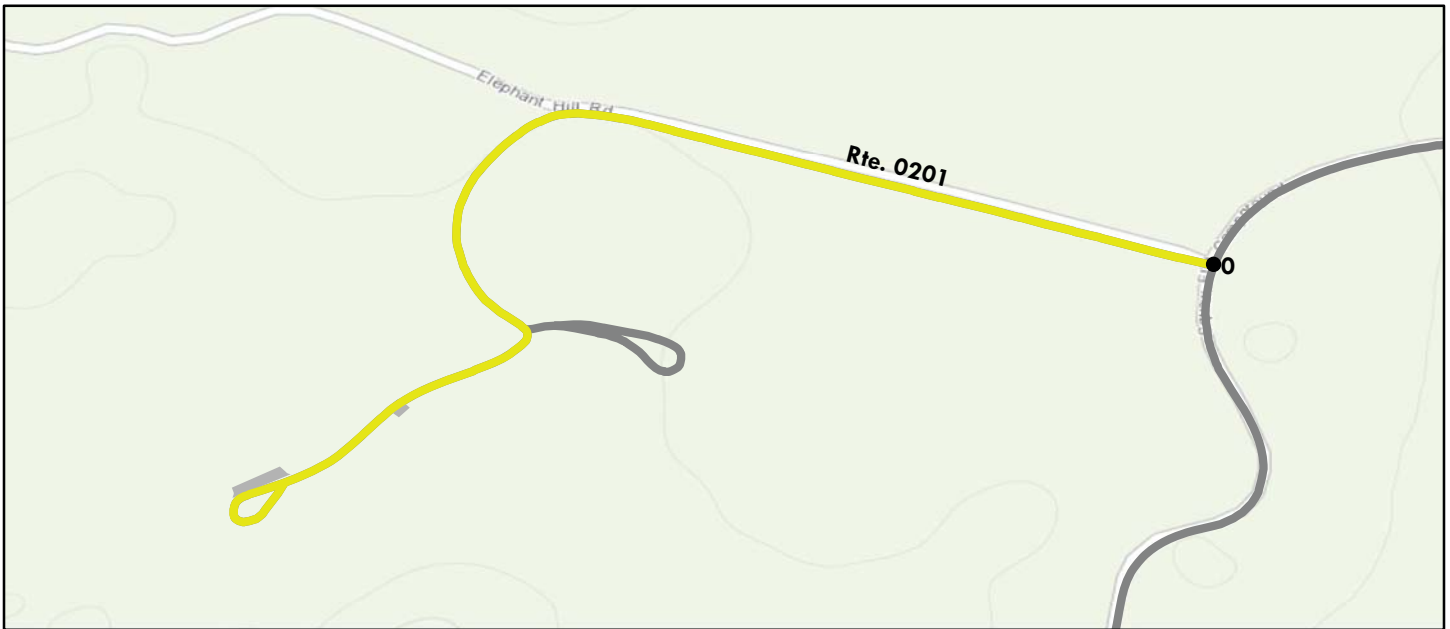

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.52	Section Length (MI)	0.52				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	76	76				
Surface Condition Rating (SCR)	76	76				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	88	88				
Alligator Crack Index	100	100				
Longitudinal Crack Index	88	88				
Transverse Cracking Index	76	76				
Patching Index	100	100				
Rutting Index	94	94				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	2	2				
Paved Width (ft)	19.9	19.9				
Lane Width (ft)	8.7	8.7				

Canyonlands National Park

ROUTE 0202: NEEDLES OUTPOST ROAD

Data Collection Vehicle (DCV) Rating



Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.36	Section Length (MI)	0.36				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	86	86				
Surface Condition Rating (SCR)	86	86				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	99	99				
Alligator Crack Index	100	100				
Longitudinal Crack Index	99	99				
Transverse Cracking Index	91	91				
Patching Index	100	100				
Rutting Index	86	86				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	2	2				
Paved Width (ft)	18.3	18.3				
Lane Width (ft)	8.5	8.5				

Canyonlands National Park

ROUTE 0215: WHITE RIM OVERLOOK PICNIC AREA

Data Collection Vehicle (DCV) Rating




Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.28	Section Length (MI)	0.28				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	91	91				
Surface Condition Rating (SCR)	91	91				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	99	99				
Alligator Crack Index	100	100				
Longitudinal Crack Index	99	99				
Transverse Cracking Index	91	91				
Patching Index	100	100				
Rutting Index	96	96				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	1	1				
Paved Width (ft)	14	14				
Lane Width (ft)	10.5	10.5				

Canyonlands National Park

ROUTE 0216: WILLOW FLATS CAMPGROUND

Data Collection Vehicle (DCV) Rating

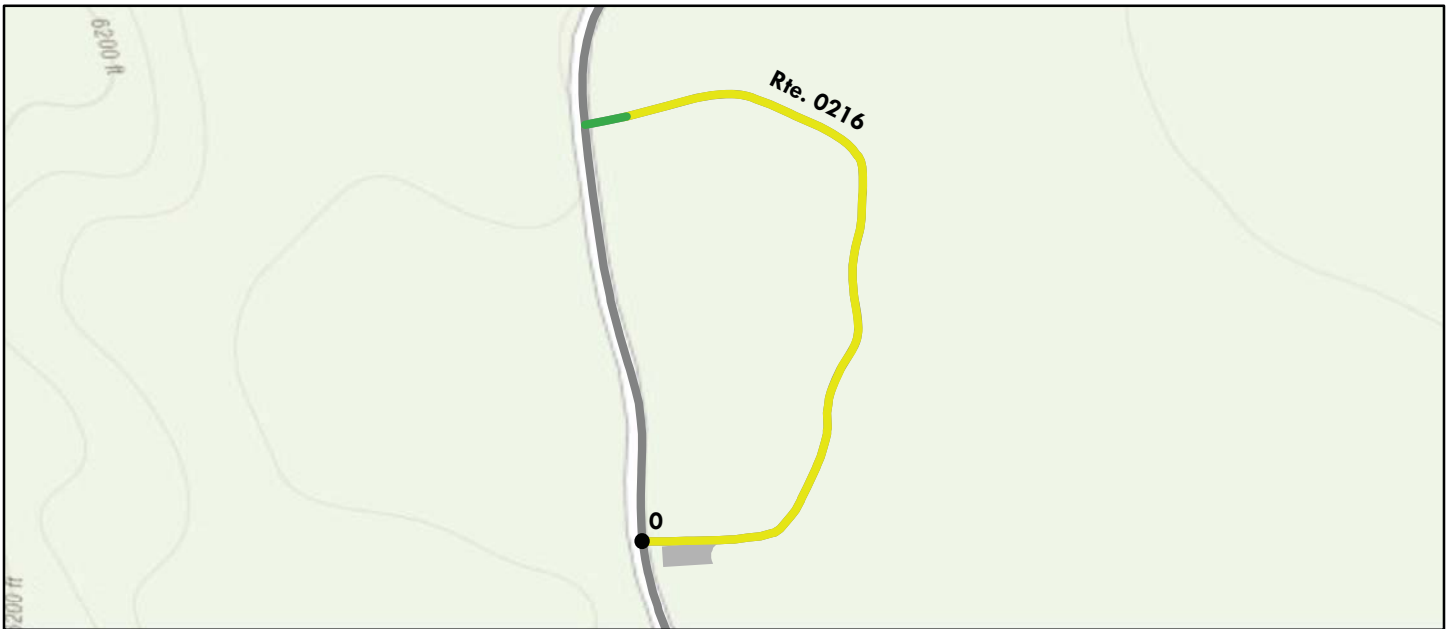


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.21	Section Length (MI)	0.21				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	80	80				
Surface Condition Rating (SCR)	80	80				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	98	98				
Alligator Crack Index	100	100				
Longitudinal Crack Index	98	98				
Transverse Cracking Index	80	80				
Patching Index	100	100				
Rutting Index	94	94				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	1	1				
Paved Width (ft)	12.7	12.7				
Lane Width (ft)	12.7	12.7				

Canyonlands National Park

ROUTE 0221: NEEDLES VISITOR CONTACT STATION ACCESS ROAD

Data Collection Vehicle (DCV) Rating

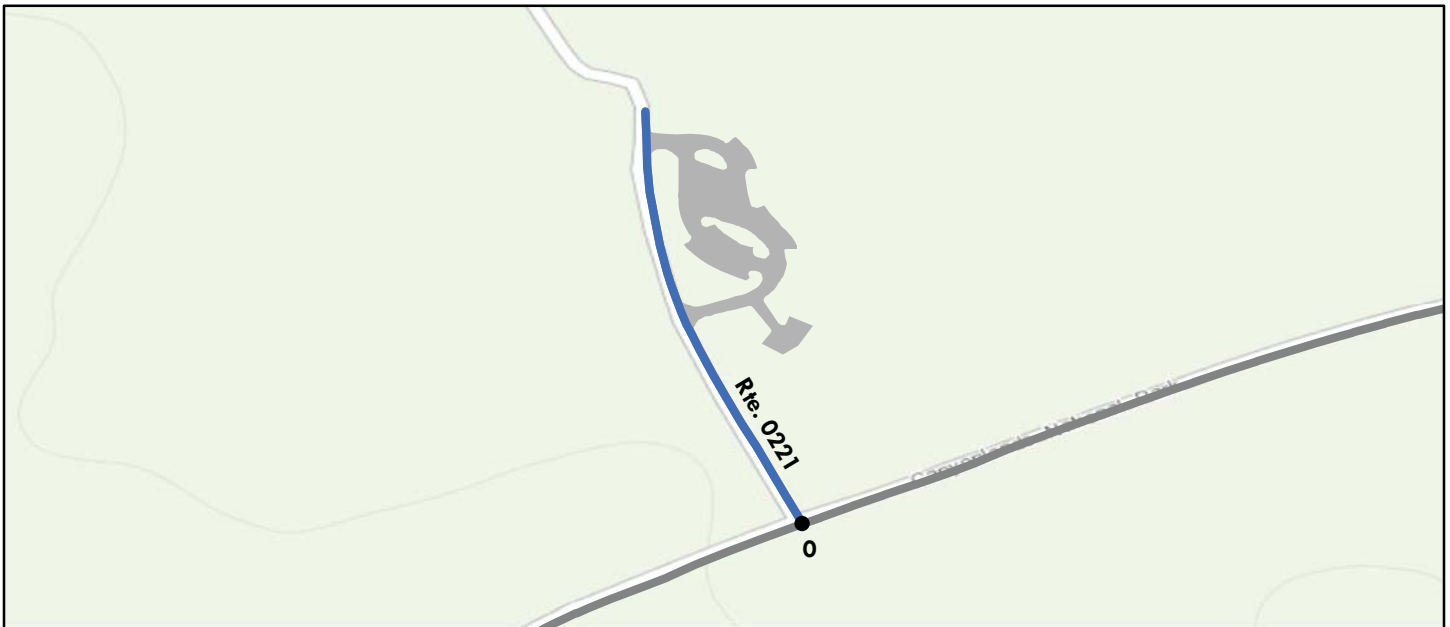


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.16	Section Length (MI)	0.16				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	97	97				
Surface Condition Rating (SCR)	97	97				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	99	99				
Alligator Crack Index	100	100				
Longitudinal Crack Index	99	99				
Transverse Cracking Index	97	97				
Patching Index	100	100				
Rutting Index	97	97				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	2	2				
Paved Width (ft)	25.4	25.4				
Lane Width (ft)	11.8	11.8				

Canyonlands National Park

ROUTE 0229: SQUAW FLAT CAMPGROUND LOOP B

Data Collection Vehicle (DCV) Rating

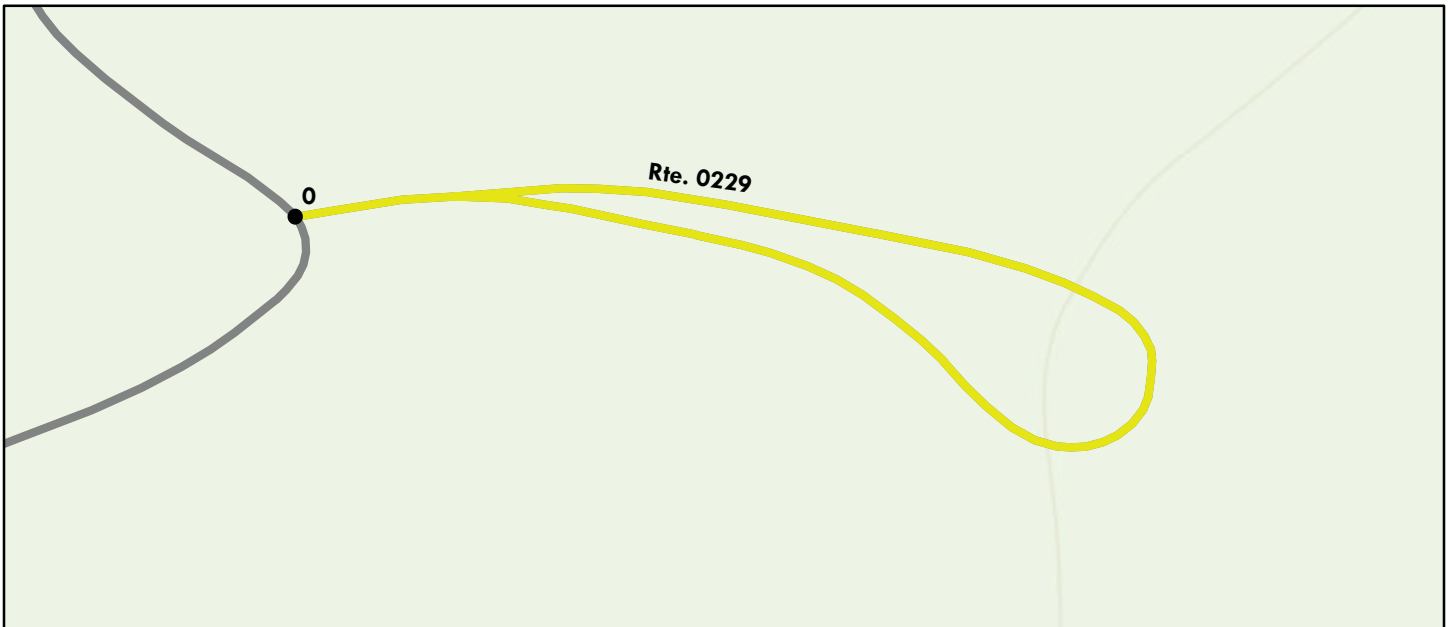


Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.10	Section Length (MI)	0.10				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	74	74				
Surface Condition Rating (SCR)	74	74				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	83	83				
Alligator Crack Index	100	100				
Longitudinal Crack Index	83	83				
Transverse Cracking Index	74	74				
Patching Index	100	100				
Rutting Index	98	98				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	1	1				
Paved Width (ft)	15.5	15.5				
Lane Width (ft)	11.4	11.4				

Canyonlands National Park

ROUTE 0401: NEEDLES RESIDENCE ROAD

Data Collection Vehicle (DCV) Rating

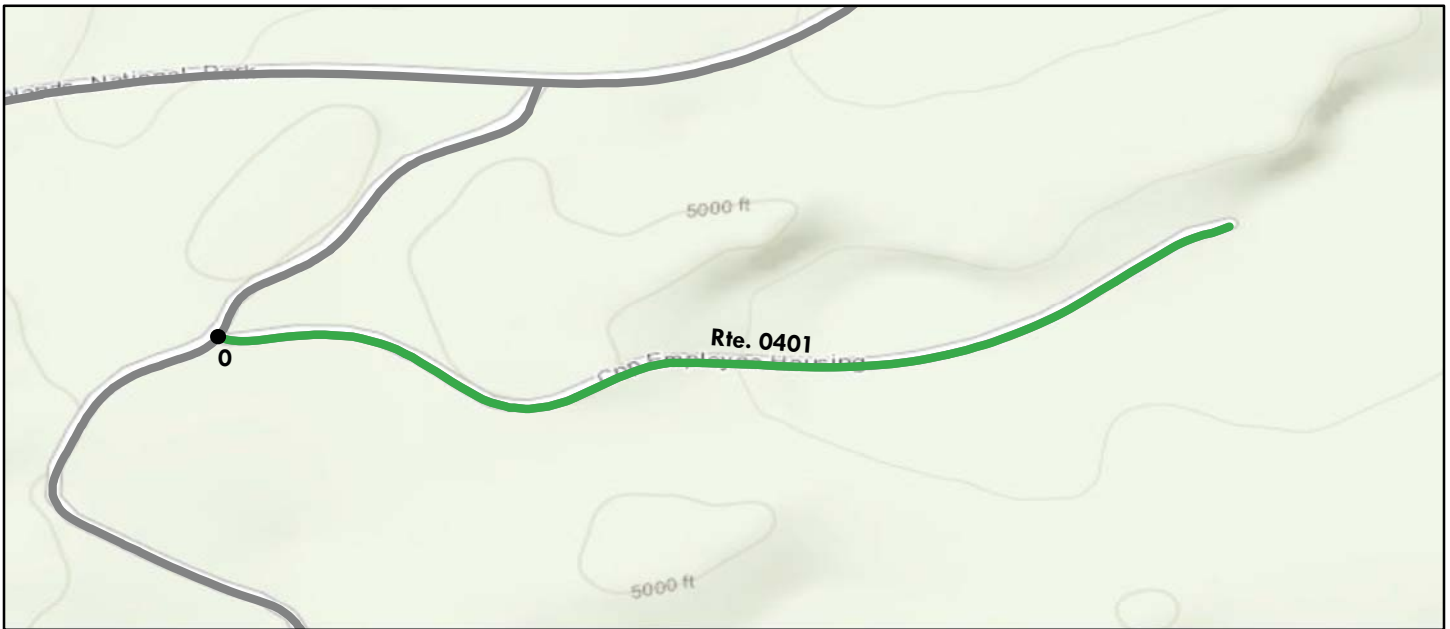

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.57	Section Length (MI)	0.57				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	88	88				
Surface Condition Rating (SCR)	88	88				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	100	100				
Alligator Crack Index	100	100				
Longitudinal Crack Index	100	100				
Transverse Cracking Index	88	88				
Patching Index	100	100				
Rutting Index	100	100				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	2	2				
Paved Width (ft)	20.1	20.1				
Lane Width (ft)	10.1	10.1				

Canyonlands National Park

ROUTE 0403: NEEDLES MAINTENANCE AREA LOOP

Data Collection Vehicle (DCV) Rating



Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.22	Section Length (MI)	0.22				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	81	81				
Surface Condition Rating (SCR)	81	81				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	99	99				
Alligator Crack Index	100	100				
Longitudinal Crack Index	99	99				
Transverse Cracking Index	81	81				
Patching Index	100	100				
Rutting Index	94	94				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	2	2				
Paved Width (ft)	18.2	18.2				
Lane Width (ft)	9.1	9.1				

Canyonlands National Park

ROUTE 0406: I-SKY RESIDENCE ROAD

Data Collection Vehicle (DCV) Rating



Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated


See Appendix for definitions and formulas

Inspection Date: 6/5/2017	Beginning Section MP	0				
Paved Length (Miles): 0.11	Section Length (MI)	0.11				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	81	81				
Surface Condition Rating (SCR)	81	81				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	85	85				
Alligator Crack Index	100	100				
Longitudinal Crack Index	85	85				
Transverse Cracking Index	81	81				
Patching Index	99	99				
Rutting Index	99	99				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	2	2				
Paved Width (ft)	18	18				
Lane Width (ft)	9	9				

Canyonlands National Park

ROUTE 0410: WILLOW FLATS SERVICE ROAD

Manual Rating

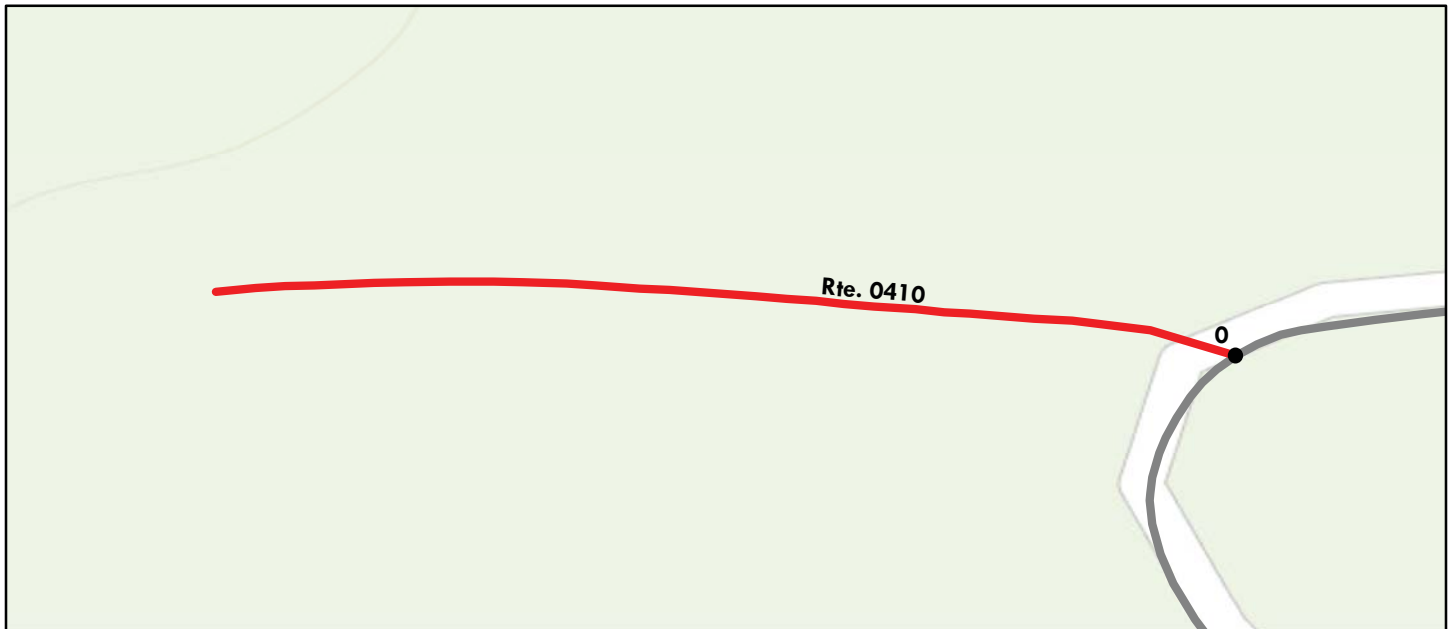

Sources: Esri, HERE, DeLorme, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, MapmyIndia, © OpenStreetMap contributors, and the GIS User Community

Route Condition Legend – Pavement Condition Rating (PCR)						
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated		
See Appendix for definitions and formulas						
Inspection Date: 3/18/2016	Beginning Section MP	0.00				
Paved Length (Miles): 0.07	Section Length (MI)	0.07				
Surface Type: ASPHALT	Route Summary					
Roadway Condition Information						
Pavement Condition Rating (PCR)	53	53				
Surface Condition Rating (SCR)	53	53				
Roughness Condition Index (RCI)	N/A	N/A				
Distress Index Values						
Structural Crack Index	N/A	N/A				
Alligator Crack Index	53	53				
Longitudinal Crack Index	53	53				
Transverse Cracking Index	53	53				
Patching Index	53	53				
Rutting Index	53	53				
International Roughness Index (IRI)	N/A	N/A				
Lane & Width Information						
Number of Lanes	1	1				
Paved Width (ft)	15	15				
Lane Width (ft)	15	15				

Canyonlands National Park

ROUTE 0410: WILLOW FLATS SERVICE ROAD

Condition Photos

Condition photos are shown only for manually rated roads. Use the PathView program to see images of DCV rated roads.



CANY_0410_3693.JPG



CANY_0410_3694.JPG



CANY_0410_3695.JPG



CANY_0410_3696.JPG



CANY_0410_3697.JPG

Section 6 Paved Parking Area Condition Rating Sheets



Canyonlands National Park



Federal Lands Highway
Road Inventory Program

Canyonlands National Park

ROUTE 0900: ISLAND IN THE SKY VISITOR CENTER PARKING

Manual Rating

ADJACENT TO ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 6.81 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	90336	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
21,243	0.366	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)



Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

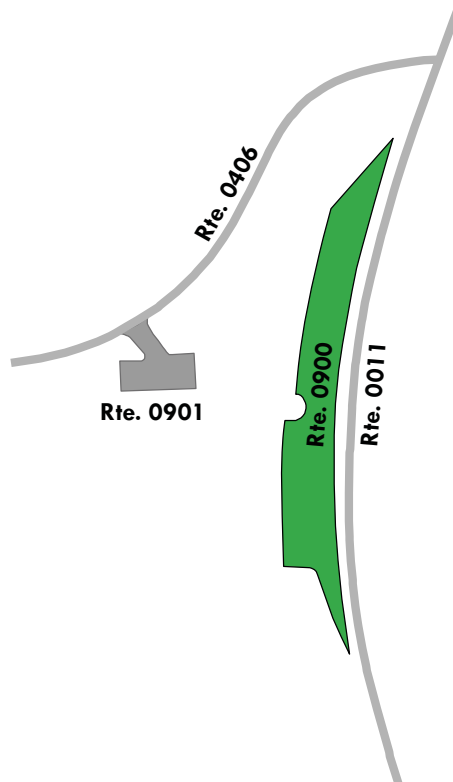

Canyonlands National Park

ROUTE 0901: SKY VISITOR CENTER EMPLOYEE PARKING

Manual Rating

FROM ROUTE 0406 (I-SKY RESIDENCE ROAD) AT MP 0.09 ON LEFT



TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	61946	NONPUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
3,676	0.063	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R TREATMENTS		POOR / 53	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
---------------	---------------	----------------	----------------------	-----------

See Appendix for definitions and formulas

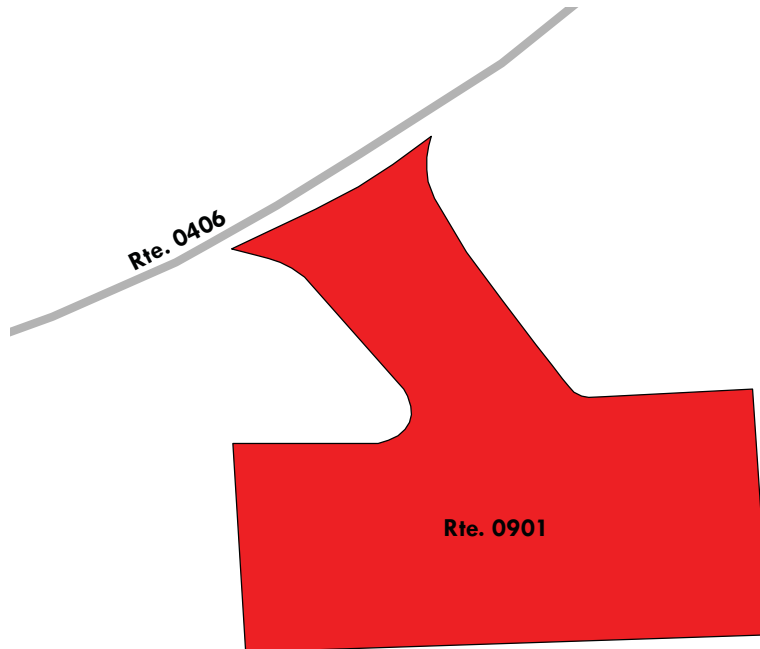

Canyonlands National Park

ROUTE 0902: NECK SPRINGS TRAILHEAD PARKING

Manual Rating


FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 7.30 ON LEFT
TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66233	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
40,429	0.696	6	MODERATE REPAIR
Curb Type		Curb & Gutter Type	
ASPHALT		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

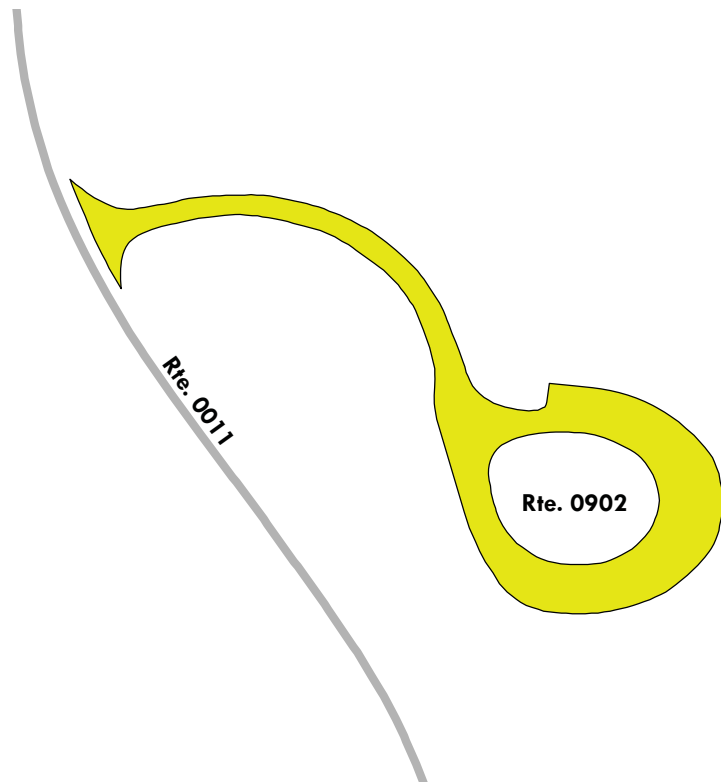

Canyonlands National Park

ROUTE 0903: MESA ARCH PARKING

Manual Rating

FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 12.87 ON LEFT

TO ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 12.95 ON LEFT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66232	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
21,721	0.374	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)



Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

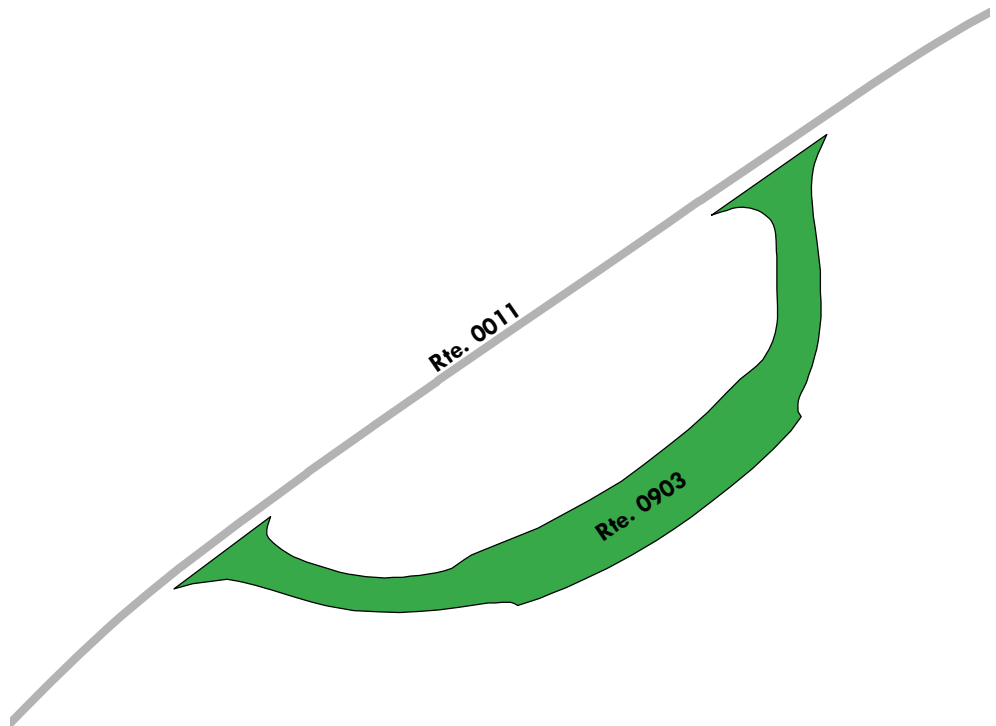

Canyonlands National Park

ROUTE 0904: BUCK CANYON OVERLOOK PARKING

Manual Rating



FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 16.28 ON LEFT
TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66235	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
21,612	0.372	NOT APPLICABLE	DO NOTHING
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

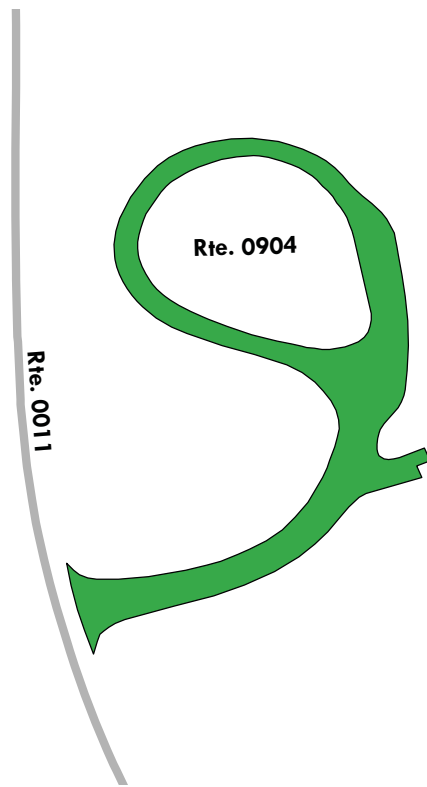

Canyonlands National Park

ROUTE 0905: ORANGE CLIFFS OVERLOOK PARKING

Manual Rating

FROM ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 18.81 ON RIGHT



TO ROUTE 0011 (ISLAND IN THE SKY ROAD) AT MP 18.86 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66236	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
11,176	0.192	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R TREATMENTS		POOR / 53	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

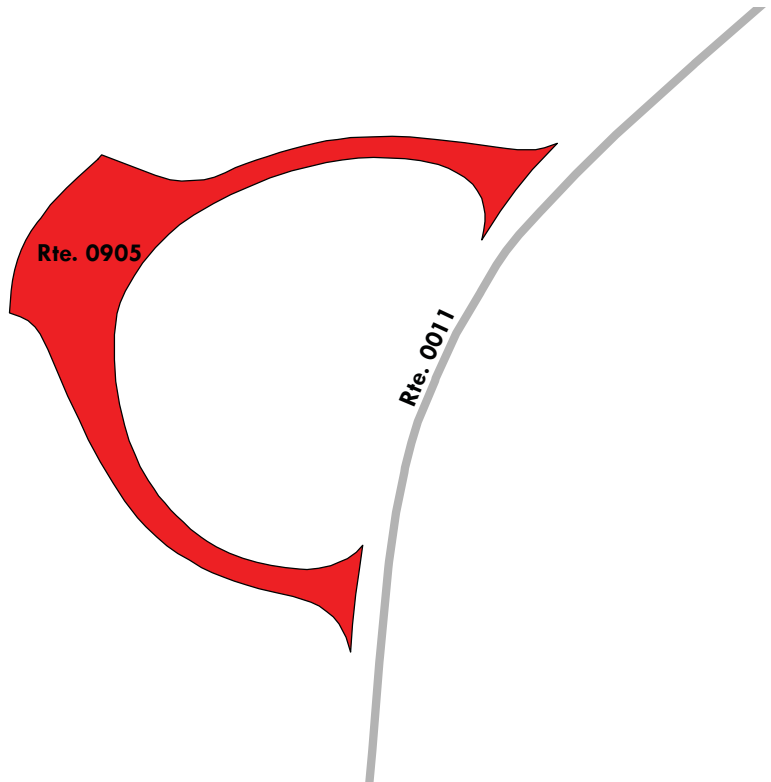

Canyonlands National Park

ROUTE 0906: GRAND VIEW POINT PARKING AREA

Manual Rating



FROM END OF ROUTE 0011 (ISLAND IN THE SKY ROAD)
TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66234	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
37,800	0.651	NOT APPLICABLE	DO NOTHING
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

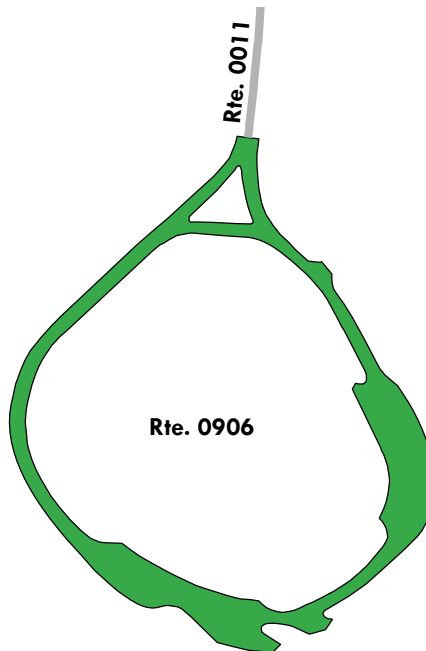

Canyonlands National Park

ROUTE 0907: AZTEC BUTTE TRAILHEAD PARKING

Manual Rating

FROM ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 0.83 ON RIGHT



TO ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 0.88 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66229	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
12,878	0.222	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

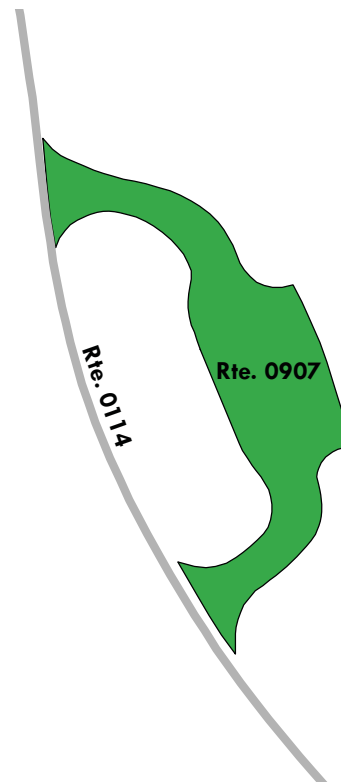

Canyonlands National Park

ROUTE 0908: WHALE ROCK TRAILHEAD PARKING

Manual Rating

FROM ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 4.00 ON RIGHT



TO ROUTE 0114 (UPHEAVAL DOME ROAD) AT MP 4.04 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66230	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
11,698	0.201	NOT APPLICABLE	DO NOTHING
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

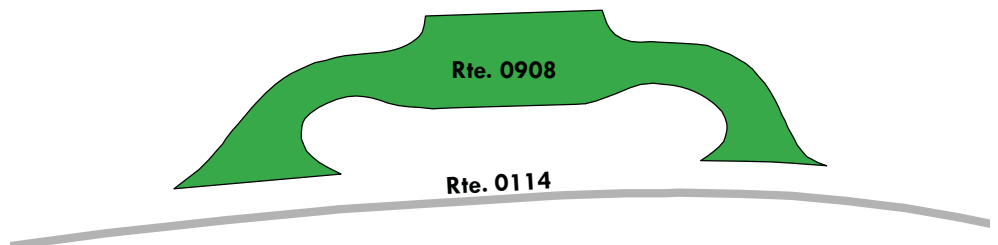

Canyonlands National Park

ROUTE 0909: UPHEAVAL DOME PICNIC PARKING

Manual Rating



FROM END OF ROUTE 0114 (UPHEAVAL DOME ROAD)
TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	66231	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
19,975	0.344	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

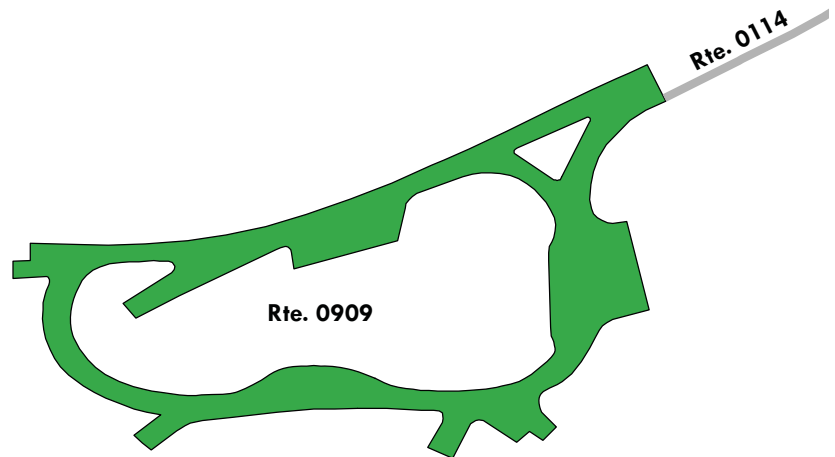

Canyonlands National Park

ROUTE 0910: INDIAN CREEK PARKING

Manual Rating

FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 7.63 ON RIGHT

TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 7.72 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	67880	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
9,351	0.161	6	LIGHT REPAIR
Curb Type		Curb & Gutter Type	
CONCRETE		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R TREATMENTS		POOR / 53	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)



Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

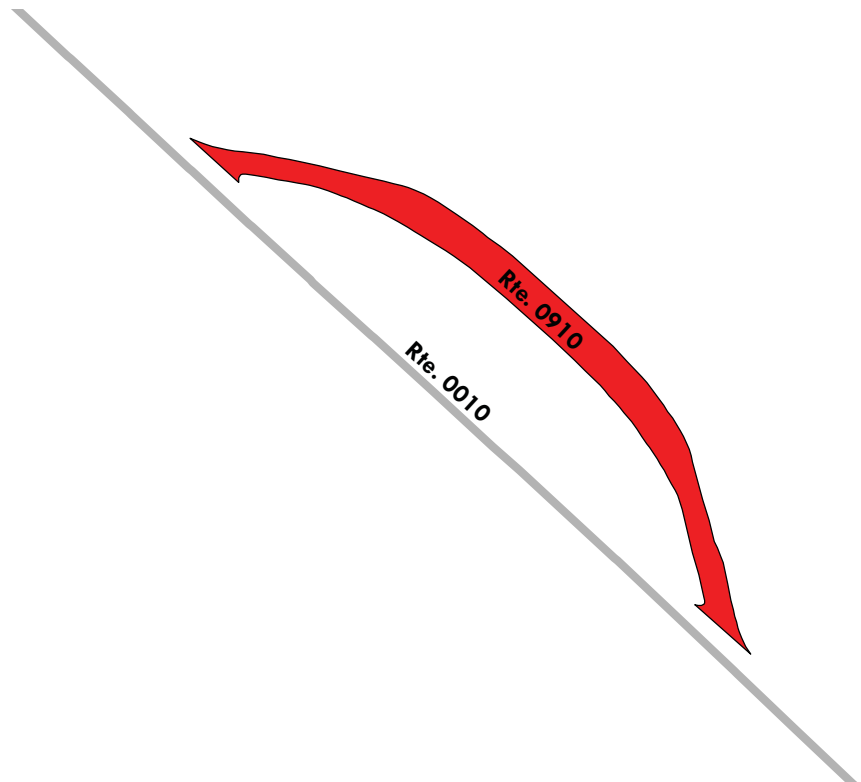

Canyonlands National Park

ROUTE 0911: NEEDLES VISITOR CENTER PARKING

Manual Rating

FROM ROUTE 0221 (NEEDLES VISITOR CONTACT STATION ACCESS ROAD) AT MP 0.08 ON RIGHT
TO ROUTE 0221 (NEEDLES VISITOR CONTACT STATION ACCESS ROAD) AT MP 0.15 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	45708	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
40,064	0.69	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	



Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas



Note: Parking area consists of multiple surface types: 1 part Asphalt at 35,978 square feet; 1 part Concrete at 4,086 square feet.

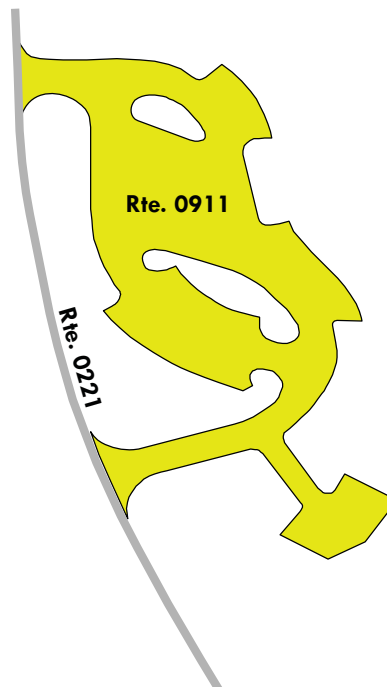

Canyonlands National Park

ROUTE 0912: WOODEN SHOE PARKING

Manual Rating

FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 17.55 ON LEFT

TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 17.58 ON LEFT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	67873	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
6,826	0.118	NOT APPLICABLE	DO NOTHING
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)


Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

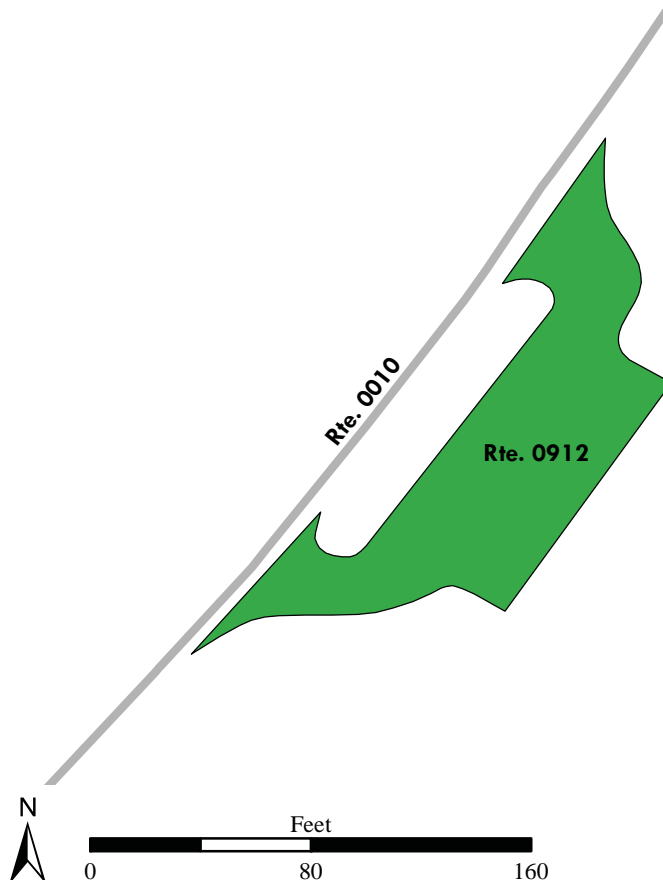

Canyonlands National Park

ROUTE 0913: THE PICNIC AREA (NEEDLES)

Manual Rating

FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 19.97 ON LEFT


TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 20.00 ON LEFT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	67865	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
6,866	0.118	NOT APPLICABLE	DO NOTHING
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

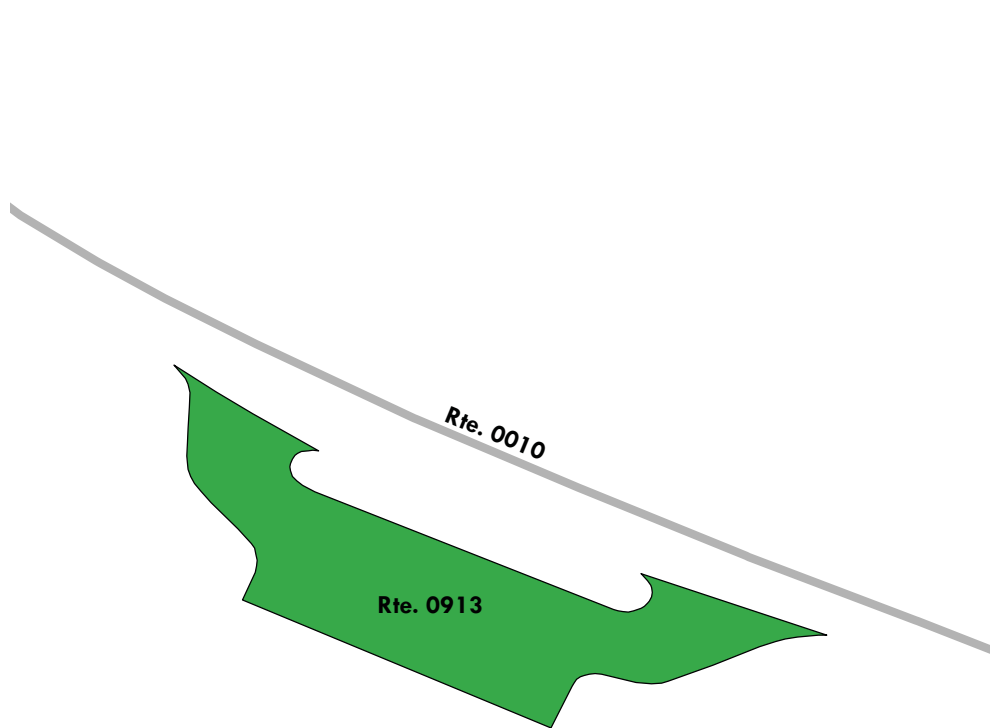

Canyonlands National Park

ROUTE 0914: POTHOLE HILL TRAILHEAD PARKING

Manual Rating

FROM ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 20.39 ON LEFT



TO ROUTE 0010 (NEEDLES ACCESS ROAD) AT MP 20.42 ON LEFT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	47627	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
9,222	0.159	NOT APPLICABLE	DO NOTHING
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

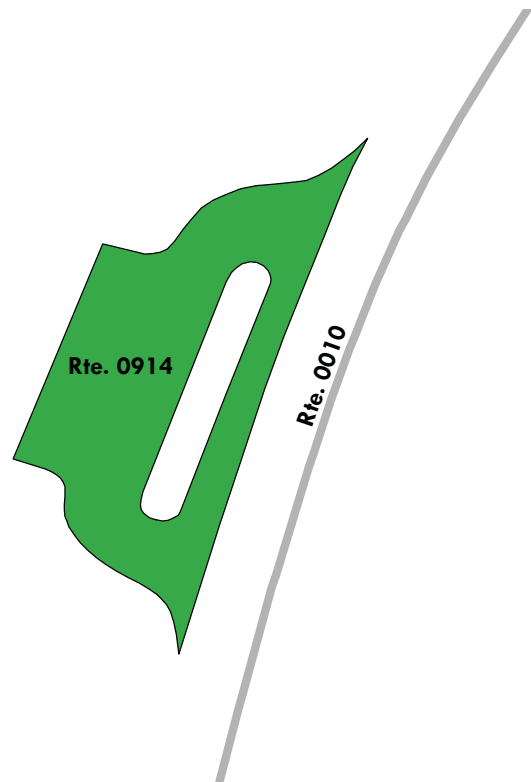

Canyonlands National Park

ROUTE 0915: BIG SPRINGS PARKING

Manual Rating

FROM END OF ROUTE 0010 (NEEDLES ACCESS ROAD)

TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	67877	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
16,951	0.292	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)



Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

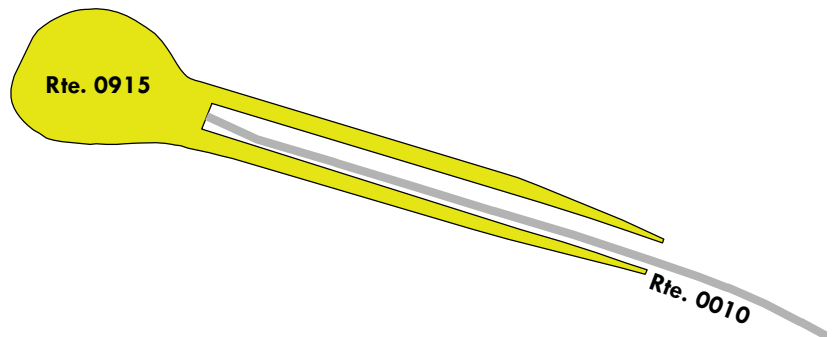

Canyonlands National Park

ROUTE 0916A: NEEDLES MAINTENANCE YARD COMPLEX AREA A

Manual Rating

FROM ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.04 ON RIGHT

TO ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.09 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	67875	NONPUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
27,478	0.473	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)



Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas



Note: Parking area consists of multiple surface types: 1 part Asphalt at 26,740 square feet; 1 part Concrete at 738 square feet.

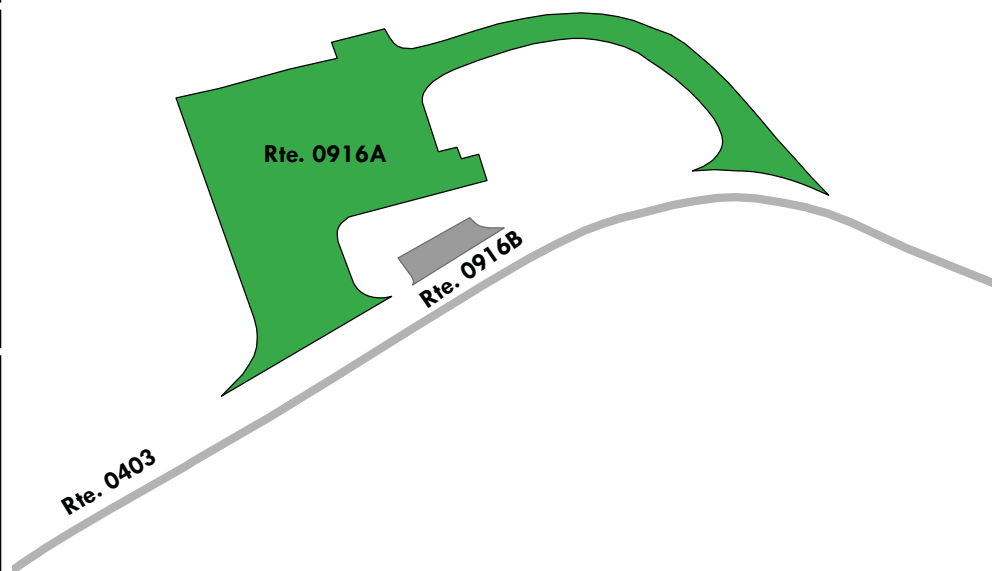

Canyonlands National Park

ROUTE 0916B: NEEDLES MAINTENANCE YARD COMPLEX AREA B

Manual Rating



ADJACENT TO ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.07 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102708	NONPUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
1,055	0.018	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
---------------	---------------	----------------	----------------------	-----------

See Appendix for definitions and formulas

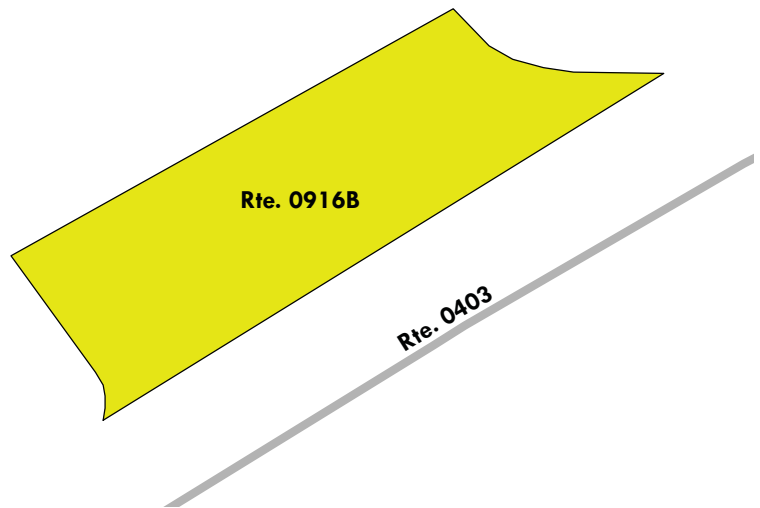

Canyonlands National Park

ROUTE 0916C: NEEDLES MAINTENANCE YARD COMPLEX AREA C

Manual Rating

ADJACENT TO ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP) AT MP 0.14 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102710	NONPUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
1,544	0.027	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)



Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

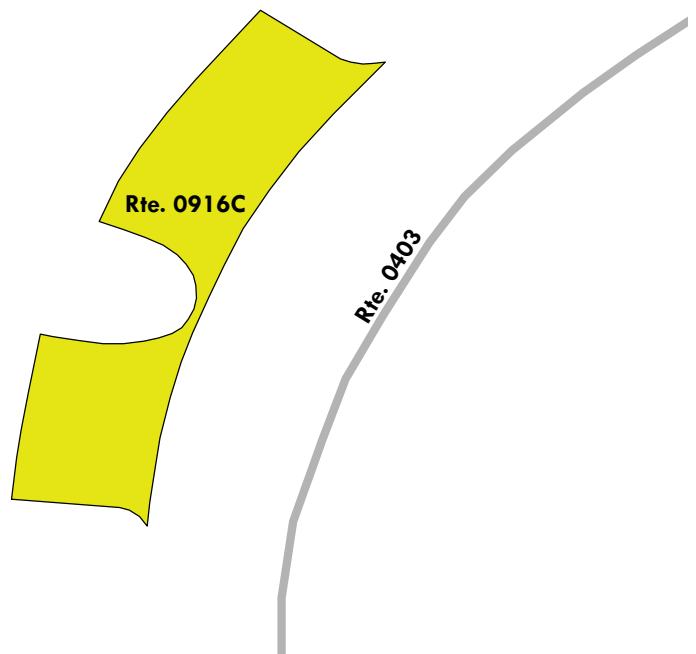

Canyonlands National Park

ROUTE 0918: SQUAW FLAT RESTROOM A PARKING

Manual Rating




ADJACENT TO ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.77 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102711	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
1,033	0.018	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

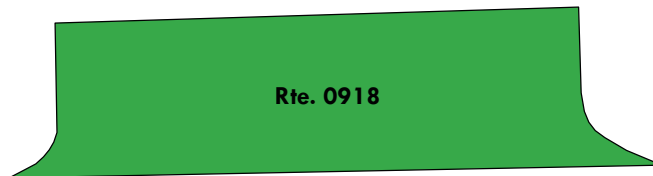

Canyonlands National Park

ROUTE 0919: SQUAW FLAT TRAILHEAD PARKING

Manual Rating




ADJACENT TO ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.91 ON LEFT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102712	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
9,057	0.156	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R TREATMENTS		POOR / 53	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

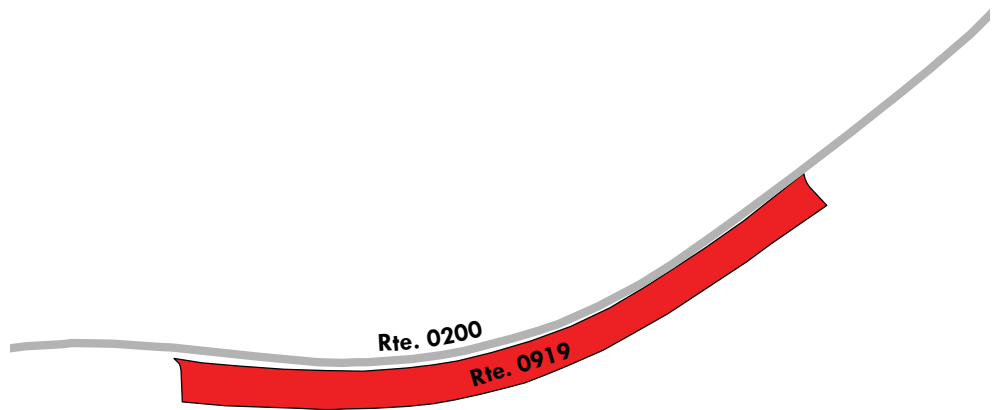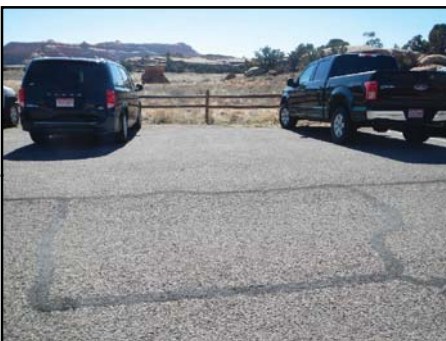

Canyonlands National Park

ROUTE 0920: SQUAW FLAT RESTROOM B PARKING

Manual Rating



ADJACENT TO ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B)) AT MP 0.42 ON LEFT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102715	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
570	0.01	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

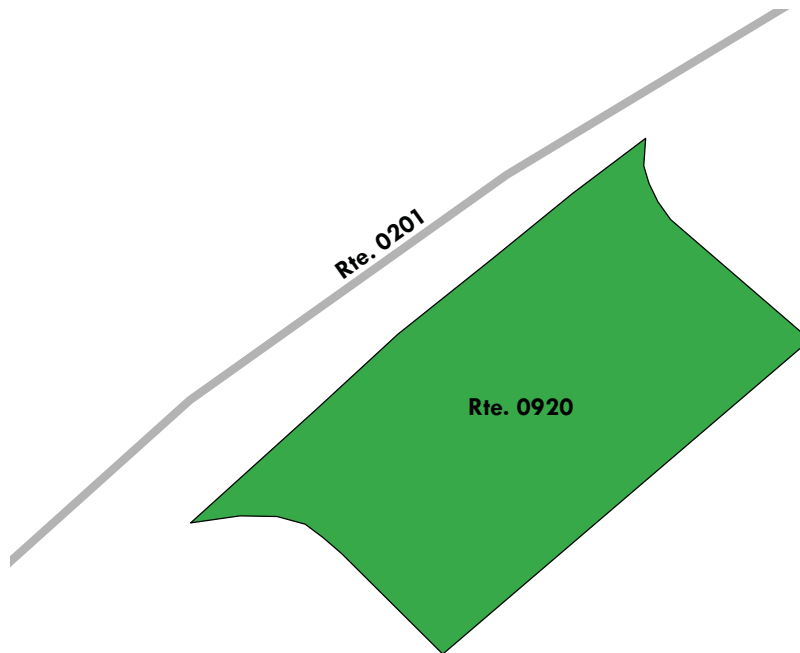

Canyonlands National Park

ROUTE 0921: WHITE RIM OVERLOOK PARKING

Manual Rating


ADJACENT TO ROUTE 0215 (WHITE RIM OVERLOOK PICNIC AREA) AT MP 0.14 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102716	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
959	0.017	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

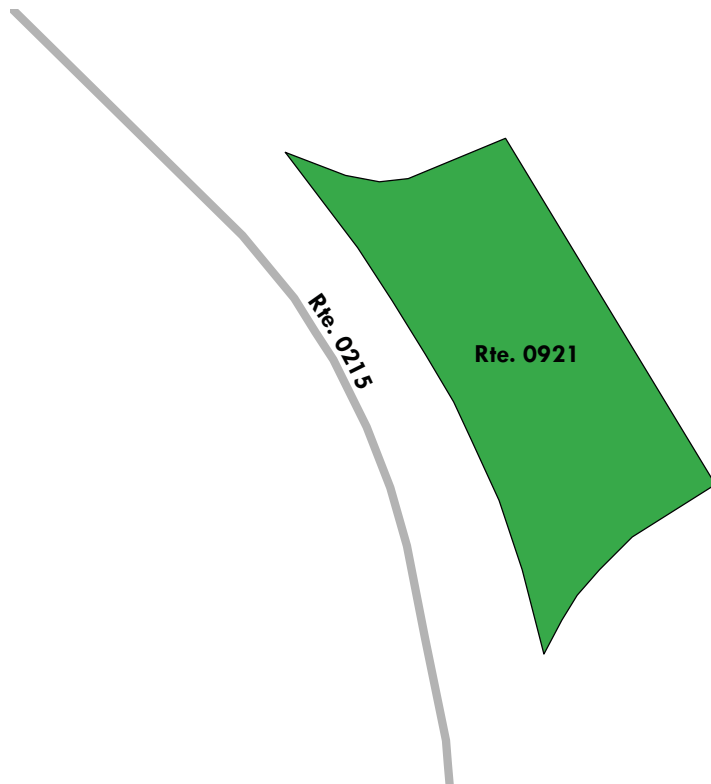

Canyonlands National Park

ROUTE 0922: GREEN RIVER OVERLOOK PARKING

Manual Rating



FROM END OF ROUTE 0113 (GREEN RIVER OVERLOOK ROAD)
TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	90764	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
19,417	0.334	NOT APPLICABLE	DO NOTHING
Curb Type		Curb & Gutter Type	
NO CURB		CONCRETE	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

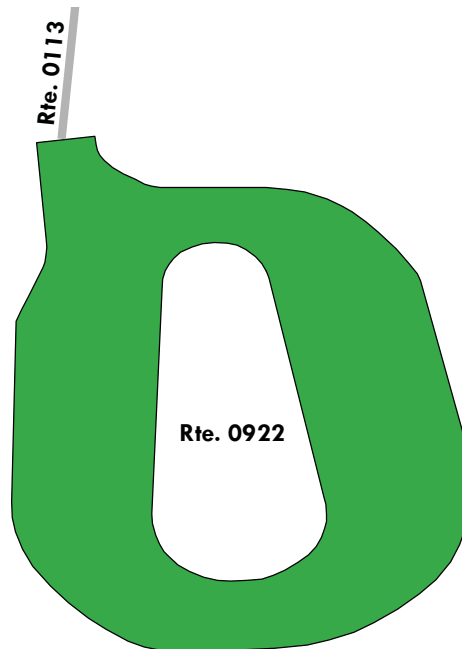

Canyonlands National Park

ROUTE 0923: WILLOW FLAT CAMPGROUND PARKING

Manual Rating


ADJACENT TO ROUTE 0216 (WILLOW FLATS CAMPGROUND) AT MP 0.01 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102755	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
2,144	0.037	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

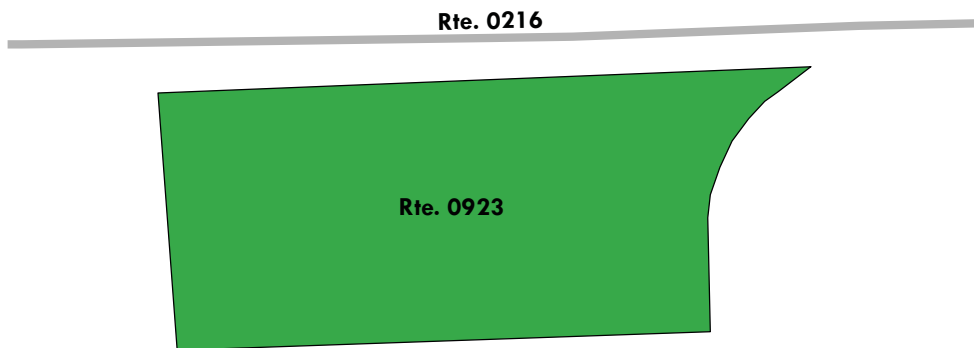

Canyonlands National Park

ROUTE 0924: SQUAW FLAT GROUP SITE PARKING LOOP A

Manual Rating

FROM ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.79 ON RIGHT

TO ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A)) AT MP 0.81 ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	102648	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
6,882	0.118	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R TREATMENTS		POOR / 53	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)



Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

See Appendix for definitions and formulas

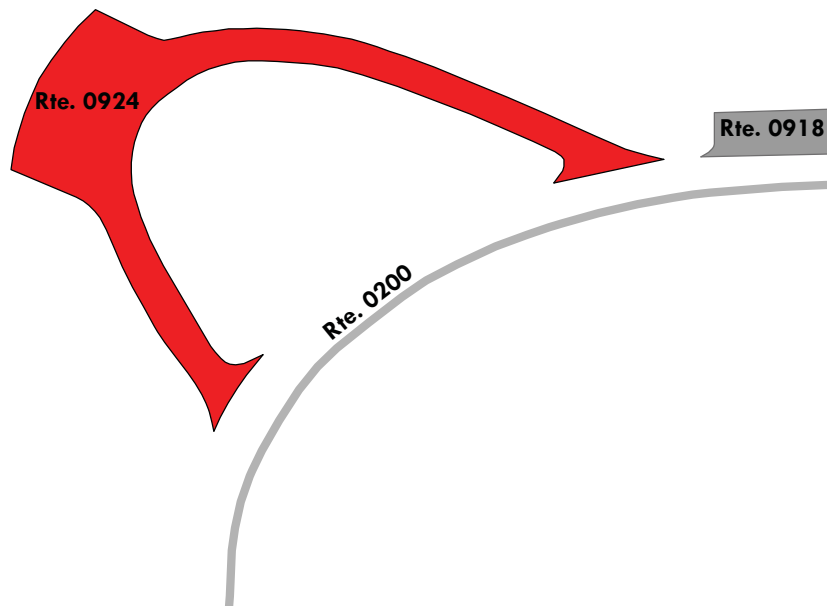

Canyonlands National Park

ROUTE 0925: SQUAW FLAT LOOP B PARKING

Manual Rating



ADJACENT TO ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))

Inspection Date	FMSS Number	User Access	Surface Type
3/18/2016	238082	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
2,657	0.046	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R TREATMENTS		POOR / 53	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 100)	Not Rated
----------------------	----------------------	-----------------------	-----------------------------	------------------

See Appendix for definitions and formulas

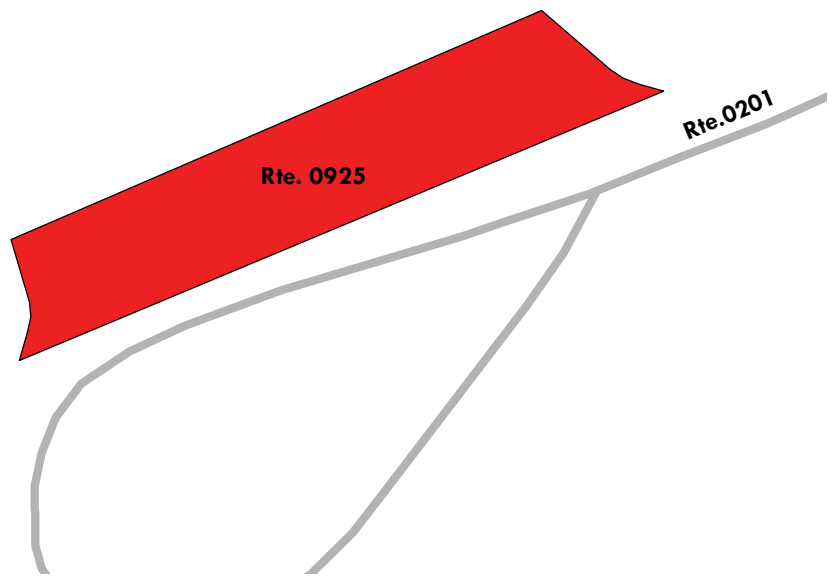

Section 7

Road Milepost Information



Canyonlands National Park



Federal Lands Highway
Road Inventory Program

Road Milepost Information

This report section contains road milepost information for all paved roads in the park that were collected with the Data Collection Vehicle (DCV). The milepost data is obtained from the DCV by using a distance measuring instrument (DMI) that is calibrated to record mileage to the nearest thousandth of a mile. Park roads that were manually rated did not have milepost data collected, and thus are not included in this report section.

For Cycle 6, the information presented in this section differs from previous RIP cycles in that it does not contain the roadside features inventories for the paved park roads. Some examples of the features previously collected are signs, culverts/drop inlets, guardrails, curbing, pullouts, etc. If the park was collected in a previous RIP cycle, then the latest features data can be obtained by referencing the following:

Where to find the latest Features Inventories for NPS Parks:

- For Small Parks (parks with less than 10 miles of paved roads):
 - Refer to Cycle 5 data (collected 2010 - 2014)
 - Features were reported in Section 9 of the *Cycle 5* RIP report
 - Video of features can be viewed using the *PathViewVO* program and *Cycle 5* data
- For Large Parks (parks with more than 10 miles of paved roads):
 - Refer to Cycle 4 data (collected 2006 - 2009)
 - Features were reported in Section 9 of the *Cycle 4* RIP report
 - Video of features can be viewed using the *VisiData* program and *Cycle 4* data
 - Note: Features inventories were updated in Large Parks in *Cycle 5* only on a route by route basis if the route was new or modified in *Cycle 5*. If this is the case for a particular route, then features for the route can be obtained using the *PathViewVO* program and *Cycle 5* data (same as above for Small parks).

Milepost Events Verified in Cycle 6

In Cycle 6, the following events were collected and reported in Section 7 of this report:

- Intersections with roads and parking areas
- All bridges and culverts with BIP Numbers (bridge inspection program numbers)
- Mile Marker Signs
- One-Way travel directions
- Overpasses
- Tunnels
- Low Water Crossings (LWCR)
- Surface type changes
- Construction areas where no pavement condition data was obtained

GPS Mileage Matching

A consistent survey milepost and constant route length as recorded by the Data Collection Vehicle (DCV) is a challenge to maintain from one collection cycle to the next. The challenge is due to many factors such as driver characteristics, DMI calibration, tire pressure etc. After Cycle 4 (~2010), a decision was made to hold constant the length of roads so long as there was no physical change from reconstruction projects or realignments that would result in a change to the length of a road. Consequently, the “GPS Mileage Match” was implemented to specify which cycle the route length is being matched. Route mileages and GPS are matched to a previous collection whenever there is no physical change to a route alignment. The route mileage and GPS is not matched to previous cycles whenever it is determined that a road length and GPS needs to be updated. When this happens the GPS and length is updated to the cycle that displays the change, and that collection cycle is used as the matching cycle in subsequent collections of the road. Thus, the Cycle 6 GIS could be either the survey length collected in Cycle 4, Cycle 5, or Cycle 6 and therefore, may not match the survey milepost displayed in the latest Cycle 6 DCV video which is viewable in *PathView VO*.

The features inventories and road logs collected on NPS routes contain mileposts that are determined from the corresponding cycle that the GPS is matched to. Therefore, the mileposts contained in the Cycle 4 or 5 features inventories or the Cycle 6 road logs may not exactly match the survey milepost collected in the latest Cycle 6 video of the road.

Locating Mile Marker Signs

For routes that have mile marker signs along them, the milepost reported by RIP will most likely not line up exactly with the sign located in the field. This could be happening for many reasons, most likely due to either the error falling within the acceptable calibration range of the vehicle, or the level of accuracy that the mile marker signs were placed in the field.

Because mile marker signs are important features in many project plans and location descriptions, RIP is reporting locations of mile marker signs in three ways in Cycle 6:

1. Mileposts from Cycle 6 GIS: the official RIP milepost taken from the features inventories and the matching GPS/mileage cycle as described above. This is the milepost that should be used on project plans and when finding locations in the field
2. Mileposts from Cycle 6 Video: milepost shown to help locate the mile marker sign in the latest *PathView VO* video.
3. Latitude / Longitude: a constant way of locating a mile marker sign so long as the park has not moved the sign

The mileposts from Cycle 6 Video and GIS should be nearly the same, but on longer roads it has been observed that the Video milepost deviates more from the official GIS milepost that comes from the matching cycle.

CANY: Route Milepost Log

ROUTE 0010: NEEDLES ACCESS ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	N/A	PAVED ROUTE (UTAH STATE ROUTE 211 / NON NPS)
0.43	0.43	INTERSECTION	L	UNPAVED ROUTE
0.92	0.92	INTERSECTION	R	UNPAVED ROUTE (GATED)
1.01	1.01	MILE MARKER	R	MILE MARKER 1
1.23	1.23	INTERSECTION	L	UNPAVED ROUTE (BEEF BASIN / COUNTY ROAD 107/ELK MOUNTAIN)
1.25	1.25	INTERSECTION	R	UNPAVED ROUTE
1.68	1.68	INTERSECTION	R	UNPAVED ROUTE (GATED)
1.68	1.68	INTERSECTION	L	UNPAVED ROUTE (GATED)
1.93	1.93	MILE MARKER	R	MILE MARKER 2
2.09	2.09	INTERSECTION	R	UNPAVED ROUTE (GATED)
2.82	2.82	INTERSECTION	R	UNPAVED ROUTE
2.94	2.94	INTERSECTION	L	UNPAVED ROUTE
2.99	2.99	MILE MARKER	R	MILE MARKER 3
3.44	3.44	INTERSECTION	L	UNPAVED ROUTE
3.64	3.64	INTERSECTION	L	UNPAVED ROUTE
3.97	3.97	MILE MARKER	R	MILE MARKER 4
4.53	4.53	INTERSECTION	L	UNPAVED ROUTE
4.98	4.98	MILE MARKER	R	MILE MARKER 5
5.54	5.54	INTERSECTION	R	UNPAVED ROUTE (GATED)
5.91	5.91	INTERSECTION	L	UNPAVED ROUTE
6.01	6.01	MILE MARKER	R	MILE MARKER 6
6.89	6.89	INTERSECTION	L	UNPAVED ROUTE (SUPERBOWEL CAMPGROUND/BLM (GATED))
6.89	6.89	INTERSECTION	R	UNPAVED ROUTE (GATED)
6.95	6.95	MILE MARKER	R	MILE MARKER 7
7.24	7.26	BRIDGE	N/A	1340-001 (INDIAN CREEK BRIDGE)
7.38	7.38	INTERSECTION	L	UNPAVED ROUTE (LAVENDER CANYON AND DAVIS CANYON ACCESS)
7.63	7.63	INTERSECTION	R	ROUTE 0910 (INDIAN CREEK PARKING)
7.72	7.72	INTERSECTION	R	ROUTE 0910 (INDIAN CREEK PARKING)

Data Collected on 6/2017

CANY: Route Milepost Log

ROUTE 0010: NEEDLES ACCESS ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
7.90	7.90	MILE MARKER	R	MILE MARKER 8
8.19	8.19	INTERSECTION	R	UNPAVED ROUTE (CREEK PASTURE CAMPGROUND / BLM)
8.91	8.91	MILE MARKER	R	MILE MARKER 9
9.21	9.21	INTERSECTION	L	UNPAVED ROUTE
9.90	9.90	MILE MARKER	R	MILE MARKER 10
10.10	10.10	INTERSECTION	R	UNPAVED ROUTE (LOCK HART BASIN ROAD)
10.39	10.39	INTERSECTION	R	UNPAVED ROUTE
10.90	10.90	MILE MARKER	R	MILE MARKER 11
11.97	11.97	MILE MARKER	R	MILE MARKER 12
12.75	12.75	INTERSECTION	R	UNPAVED ROUTE
12.87	12.87	PARK BOUNDARY	N/A	N/A
12.98	12.98	MILE MARKER	N/A	MILE MARKER 13 (LOCATION NOT VERIFIED IN VIDEO)
13.86	13.86	MILE MARKER	R	MILE MARKER 14
14.33	14.33	INTERSECTION	R	ROUTE 0202 (NEEDLES OUTPOST ROAD)
14.38	14.38	INTERSECTION	L	ROUTE 0404 (FIRING RANGE ROAD)
14.84	14.86	BRIDGE	N/A	1340-003 (SALT CREEK BRIDGE)
14.88	14.88	MILE MARKER	R	MILE MARKER 15
15.46	15.46	INTERSECTION	R	ROUTE 0221 (NEEDLES VISITOR CONTACT STATION ACCESS ROAD) SPUR
15.50	15.50	INTERSECTION	R	ROUTE 0221 (NEEDLES VISITOR CONTACT STATION ACCESS ROAD)
15.85	15.85	MILE MARKER	N/A	MILE MARKER 16 (LOCATION NOT VERIFIED IN VIDEO)
16.15	16.15	INTERSECTION	L	ROUTE 0102 (WOODEN SHOE LOOP)
16.64	16.64	MILE MARKER	R	MILE MARKER 17
17.55	17.55	INTERSECTION	L	ROUTE 0912 (WOODEN SHOE PARKING)
17.58	17.58	INTERSECTION	L	ROUTE 0912 (WOODEN SHOE PARKING)
17.83	17.83	MILE MARKER	R	MILE MARKER 18
17.93	17.93	INTERSECTION	L	ROUTE 0102 (WOODEN SHOE LOOP)
18.27	18.27	INTERSECTION	L	ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A))
18.81	18.81	MILE MARKER	R	MILE MARKER 19

CANY: Route Milepost Log

ROUTE 0010: NEEDLES ACCESS ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
19.53	19.56	BRIDGE	N/A	1340-002 (LITTLE SPRING CREEK BRIDGE)
19.80	19.80	MILE MARKER	R	MILE MARKER 20
19.97	19.97	INTERSECTION	L	ROUTE 0913 (THE PICNIC AREA (NEEDLES))
20.00	20.00	INTERSECTION	L	ROUTE 0913 (THE PICNIC AREA (NEEDLES))
20.39	20.39	INTERSECTION	L	ROUTE 0914 (POTHOLE HILL TRAILHEAD PARKING)
20.42	20.42	INTERSECTION	L	ROUTE 0914 (POTHOLE HILL TRAILHEAD PARKING)
20.79	20.79	MILE MARKER	R	MILE MARKER 21
21.79	21.79	MILE MARKER	R	MILE MARKER 22
21.85	21.85	INTERSECTION	N/A	ROUTE 0915 (BIG SPRINGS PARKING)

CANY: Route Milepost Log

ROUTE 0011: ISLAND IN THE SKY ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	N/A	PAVED ROUTE (UTAH STATE ROUTE 313 / NON NPS)
0.00	0.00	INTERSECTION	L	PAVED ROUTE (UTAH STATE ROUTE 313 / NON NPS)
0.90	0.90	INTERSECTION	R	UNPAVED ROUTE
0.97	0.97	MILE MARKER	R	MILE MARKER 1
1.15	1.15	INTERSECTION	R	UNPAVED ROUTE
1.15	1.15	INTERSECTION	L	UNPAVED ROUTE
1.73	1.73	INTERSECTION	L	UNPAVED ROUTE
1.97	1.97	MILE MARKER	R	MILE MARKER 2
2.53	2.53	INTERSECTION	L	UNPAVED ROUTE
2.54	2.54	INTERSECTION	R	UNPAVED ROUTE
3.01	3.01	MILE MARKER	R	MILE MARKER 3
3.46	3.46	INTERSECTION	L	UNPAVED ROUTE
4.05	4.05	MILE MARKER	R	MILE MARKER 4
4.10	4.10	INTERSECTION	R	UNPAVED ROUTE
4.39	4.39	PARK BOUNDARY	N/A	N/A
5.06	5.06	MILE MARKER	R	MILE MARKER 5
5.65	5.65	INTERSECTION	L	UNPAVED PARKING (ENTRANCE STATION / RESTROOM)
5.85	5.85	INTERSECTION	L	ROUTE 0111 (WHITE RIM ROAD)
6.09	6.09	MILE MARKER	R	MILE MARKER 6
6.74	6.74	INTERSECTION	R	ROUTE 0406 (I-SKY RESIDENCE ROAD)
6.75	6.75	MILE MARKER	R	MILE MARKER 7
6.81	6.81	INTERSECTION	R	ROUTE 0900 (ISLAND IN THE SKY VISITOR CENTER PARKING)
7.30	7.30	INTERSECTION	L	ROUTE 0902 (NECK SPRINGS TRAILHEAD PARKING)
7.73	7.73	MILE MARKER	R	MILE MARKER 8
8.64	8.64	MILE MARKER	R	MILE MARKER 9
9.60	9.60	MILE MARKER	R	MILE MARKER 10
10.56	10.56	MILE MARKER	R	MILE MARKER 11
11.50	11.50	MILE MARKER	R	MILE MARKER 12
12.46	12.46	MILE MARKER	R	MILE MARKER 13

Data Collected on 6/2017

CANY: Route Milepost Log

ROUTE 0011: ISLAND IN THE SKY ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
12.87	12.87	INTERSECTION	L	ROUTE 0903 (MESA ARCH PARKING)
12.95	12.95	INTERSECTION	L	ROUTE 0903 (MESA ARCH PARKING)
13.14	13.14	INTERSECTION	R	ROUTE 0114 (UPHEAVAL DOME ROAD)
13.35	13.35	MILE MARKER	N/A	MILE MARKER 14 (LOCATION NOT VERIFIED IN VIDEO)
14.37	14.37	MILE MARKER	R	MILE MARKER 15
15.32	15.32	MILE MARKER	R	MILE MARKER 16
15.59	15.59	INTERSECTION	R	ROUTE 0926 (MURPHY POINT PARKING AREA)
16.28	16.28	MILE MARKER	R	MILE MARKER 17
16.28	16.28	INTERSECTION	L	ROUTE 0904 (BUCK CANYON OVERLOOK PARKING)
17.23	17.23	MILE MARKER	R	MILE MARKER 18
18.03	18.03	INTERSECTION	L	ROUTE 0215 (WHITE RIM OVERLOOK PICNIC AREA)
18.16	18.16	INTERSECTION	L	ROUTE 0215 (WHITE RIM OVERLOOK PICNIC AREA)
18.19	18.19	MILE MARKER	R	MILE MARKER 19
18.81	18.81	INTERSECTION	R	ROUTE 0905 (ORANGE CLIFFS OVERLOOK PARKING)
18.86	18.86	INTERSECTION	R	ROUTE 0905 (ORANGE CLIFFS OVERLOOK PARKING)
18.90	18.90	INTERSECTION	N/A	ROUTE 0906 (GRAND VIEW POINT PARKING AREA)

CANY: Route Milepost Log

ROUTE 0102: WOODEN SHOE LOOP

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.00	0.00	INTERSECTION	R	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.17	0.17	INTERSECTION	L	ROUTE 0211 (WOODEN SHOE ROAD)
0.77	0.77	INTERSECTION	L	ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP)
0.92	0.92	INTERSECTION	L	ROUTE 0403 (NEEDLES MAINTENANCE AREA LOOP)
1.03	1.03	INTERSECTION	L	ROUTE 0402 (GENERATOR BUILDING ROAD)
1.27	1.27	INTERSECTION	R	ROUTE 0100 (CAVE SPRING ROAD)
1.71	1.71	INTERSECTION	R	ROUTE 0401 (NEEDLES RESIDENCE ROAD)
1.94	1.94	INTERSECTION	L	ROUTE 0010 (NEEDLES ACCESS ROAD)
1.94	1.94	INTERSECTION	R	ROUTE 0010 (NEEDLES ACCESS ROAD)

CANY: Route Milepost Log

ROUTE 0113: GREEN RIVER OVERLOOK ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	ROUTE 0114 (UPHEAVAL DOME ROAD)
0.00	0.00	INTERSECTION	R	ROUTE 0114 (UPHEAVAL DOME ROAD)
0.78	0.78	INTERSECTION	R	ROUTE 0410 (WILLOW FLATS SERVICE ROAD)
1.05	1.05	INTERSECTION	L	ROUTE 0216 (WILLOW FLATS CAMPGROUND)
1.17	1.17	INTERSECTION	L	ROUTE 0216 (WILLOW FLATS CAMPGROUND)
1.35	1.35	INTERSECTION	N/A	ROUTE 0922 (GREEN RIVER OVERLOOK PARKING)

CANY: Route Milepost Log

ROUTE 0114: UPHEAVAL DOME ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.00	0.00	INTERSECTION	L	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.27	0.27	INTERSECTION	L	ROUTE 0113 (GREEN RIVER OVERLOOK ROAD)
0.83	0.83	INTERSECTION	R	ROUTE 0907 (AZTEC BUTTE TRAILHEAD PARKING)
0.88	0.88	INTERSECTION	R	ROUTE 0907 (AZTEC BUTTE TRAILHEAD PARKING)
0.95	0.95	MILE MARKER	R	MILE MARKER 1
1.92	1.92	MILE MARKER	R	MILE MARKER 2
2.88	2.88	MILE MARKER	R	MILE MARKER 3
3.84	3.84	MILE MARKER	R	MILE MARKER 4
4.00	4.00	INTERSECTION	R	ROUTE 0908 (WHALE ROCK TRAILHEAD PARKING)
4.04	4.04	INTERSECTION	R	ROUTE 0908 (WHALE ROCK TRAILHEAD PARKING)
4.78	4.78	MILE MARKER	R	MILE MARKER 5
4.78	4.78	INTERSECTION	N/A	ROUTE 0909 (UPHEAVAL DOME PICNIC PARKING)

CANY: Route Milepost Log

ROUTE 0200: SQUAW FLAT CAMPGROUND ROAD (LOOP A)

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.00	0.00	INTERSECTION	L	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.26	0.26	INTERSECTION	R	ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))
0.77	0.77	INTERSECTION	R	ROUTE 0918 (SQUAW FLAT RESTROOM A PARKING)
0.79	0.79	INTERSECTION	R	ROUTE 0924 (SQUAW FLAT GROUP SITE PARKING LOOP A)
0.81	0.81	INTERSECTION	R	ROUTE 0924 (SQUAW FLAT GROUP SITE PARKING LOOP A)
0.91	0.91	INTERSECTION	L	ROUTE 0919 (SQUAW FLAT TRAILHEAD PARKING)
1.02	1.02	INTERSECTION	L	ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A))
1.02	1.02	ONE-WAY START	N/A	N/A
1.13	1.13	INTERSECTION	N/A	ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A))
1.13	1.13	INTERSECTION	L	ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A))
1.13	1.13	ONE-WAY END	N/A	N/A

CANY: Route Milepost Log

ROUTE 0201: SQUAW FLAT CAMPGROUND ROAD (LOOP B)

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A))
0.00	0.00	INTERSECTION	R	ROUTE 0200 (SQUAW FLAT CAMPGROUND ROAD (LOOP A))
0.25	0.25	INTERSECTION	R	ROUTE 0106 (ELEPHANT HILL ACCESS ROAD)
0.36	0.36	INTERSECTION	L	ROUTE 0229 (SQUAW FLAT CAMPGROUND LOOP B)
0.42	0.42	INTERSECTION	L	ROUTE 0920 (SQUAW FLAT RESTROOM B PARKING)
0.48	0.48	INTERSECTION	L	ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))
0.48	0.48	ONE-WAY START	N/A	N/A
0.52	0.52	ONE-WAY END	N/A	N/A
0.52	0.52	INTERSECTION	L	ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))
0.52	0.52	INTERSECTION	N/A	ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))

CANY: Route Milepost Log

ROUTE 0202: NEEDLES OUTPOST ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.00	0.00	INTERSECTION	L	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.36	0.36	PARK BOUNDARY	N/A	NORTH PARK BOUNDARY UNPAVED ROUTE (GATED / NON NPS)
0.36	0.36	INTERSECTION	N/A	UNPAVED ROUTE (NEEDLES OUTPOST ACCESS ROAD / NON NPS)

CANY: Route Milepost Log

ROUTE 0215: WHITE RIM OVERLOOK PICNIC AREA

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.00	0.00	ONE-WAY START	N/A	N/A
0.00	0.00	INTERSECTION	R	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.14	0.14	INTERSECTION	R	ROUTE 0921 (WHITE RIM OVERLOOK PARKING)
0.28	0.28	INTERSECTION	R	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.28	0.28	INTERSECTION	L	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.28	0.28	ONE-WAY END	N/A	N/A

CANY: Route Milepost Log

ROUTE 0216: WILLOW FLATS CAMPGROUND

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	ROUTE 0113 (GREEN RIVER OVERLOOK ROAD)
0.00	0.00	INTERSECTION	R	ROUTE 0113 (GREEN RIVER OVERLOOK ROAD)
0.00	0.00	ONE-WAY START	N/A	N/A
0.01	0.01	INTERSECTION	R	ROUTE 0923 (WILLOW FLAT CAMPGROUND PARKING)
0.21	0.21	INTERSECTION	R	ROUTE 0113 (GREEN RIVER OVERLOOK ROAD)
0.21	0.21	INTERSECTION	L	ROUTE 0113 (GREEN RIVER OVERLOOK ROAD)
0.21	0.21	ONE-WAY END	N/A	N/A

CANY: Route Milepost Log

ROUTE 0221: NEEDLES VISITOR CONTACT STATION ACCESS ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.00	0.00	INTERSECTION	L	ROUTE 0010 (NEEDLES ACCESS ROAD)
0.03	0.03	INTERSECTION	R	ROUTE 0010 (NEEDLES ACCESS ROAD) SPUR
0.08	0.08	INTERSECTION	R	ROUTE 0911 (NEEDLES VISITOR CENTER PARKING)
0.15	0.15	INTERSECTION	R	ROUTE 0911 (NEEDLES VISITOR CENTER PARKING)
0.16	0.16	INTERSECTION	N/A	ROUTE 0105 (COLORADO RIVER OVERLOOK)

CANY: Route Milepost Log

ROUTE 0229: SQUAW FLAT CAMPGROUND LOOP B

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))
0.00	0.00	INTERSECTION	N/A	ROUTE 0201 (SQUAW FLAT CAMPGROUND ROAD (LOOP B))
0.02	0.02	INTERSECTION	L	ROUTE 0229 (SQUAW FLAT CAMPGROUND LOOP B)
0.02	0.02	ONE-WAY START	N/A	N/A
0.10	0.10	ONE-WAY END	N/A	N/A
0.10	0.10	INTERSECTION	L	ROUTE 0229 (SQUAW FLAT CAMPGROUND LOOP B)
0.10	0.10	INTERSECTION	N/A	ROUTE 0229 (SQUAW FLAT CAMPGROUND LOOP B)

CANY: Route Milepost Log

ROUTE 0401: NEEDLES RESIDENCE ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0102 (WOODEN SHOE LOOP)
0.00	0.00	INTERSECTION	L	ROUTE 0102 (WOODEN SHOE LOOP)
0.57	0.57	INTERSECTION	N/A	DEAD END (DRIVEWAY)

CANY: Route Milepost Log

ROUTE 0403: NEEDLES MAINTENANCE AREA LOOP

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0102 (WOODEN SHOE LOOP)
0.00	0.00	INTERSECTION	L	ROUTE 0102 (WOODEN SHOE LOOP)
0.04	0.04	INTERSECTION	R	ROUTE 0916A (NEEDLES MAINTENANCE YARD COMPLEX AREA A)
0.07	0.07	INTERSECTION	R	ROUTE 0916B (NEEDLES MAINTENANCE YARD COMPLEX AREA B)
0.09	0.09	INTERSECTION	R	ROUTE 0916A (NEEDLES MAINTENANCE YARD COMPLEX AREA A)
0.14	0.14	INTERSECTION	R	ROUTE 0916C (NEEDLES MAINTENANCE YARD COMPLEX AREA C)
0.22	0.22	INTERSECTION	R	ROUTE 0102 (WOODEN SHOE LOOP)
0.22	0.22	INTERSECTION	L	ROUTE 0102 (WOODEN SHOE LOOP)

CANY: Route Milepost Log

ROUTE 0406: I-SKY RESIDENCE ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 4.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.00	0.00	INTERSECTION	L	ROUTE 0011 (ISLAND IN THE SKY ROAD)
0.09	0.09	INTERSECTION	L	ROUTE 0901 (SKY VISITOR CENTER EMPLOYEE PARKING)
0.11	0.11	INTERSECTION	N/A	ROUTE 0406 (I-SKY RESIDENCE ROAD) UNPAVED SECTION

Section 8 Appendix



Canyonlands National Park



**Federal Lands Highway
Road Inventory Program**

Improvements to the RIP Index Equations and Determination of PCR

In 2005, the Federal Highway Administration (FHWA) began implementing the use of a Pavement Management System (PMS) to assist the National Park Service (NPS) in prioritizing Pavement Maintenance and Rehabilitation activities. The PMS used by FHWA is the Highway Pavement Management Application (HPMA) which has the ability to store inventory and condition data from the Road Inventory Program (RIP) and forecast future performance using prediction models. Outputs include performance and condition reports at the National, Region, Park, or Route level. A regional prioritized list and optimization have been produced for most regions and the Federal Highway Deferred Maintenance is calculated via the HPMA as well.

In an effort to improve the accuracy of treatment recommendations and pavement condition descriptions the distresses and indexes that comprise the Pavement Condition Rating (PCR), an extensive study was completed throughout 2010 that has resulted in changes to the RIP condition reporting method and specifically, the calculation of PCR. It was determined that a better representation of PCR could be achieved by modifying the relative impact certain distresses would have on the overall rating.

Through the use of HPMA data, it was noted that false failure indicators existed with the existing PCR model, and that it would be necessary to reduce their impact. The distresses affected in this way were Rutting and Roughness. Conversely, experience showed that roadways with extensive cracking present were often shown to have a high PCR. Therefore, the crack index models were adjusted to be more sensitive to changes in crack severity or quantity. It was also determined that these issues were not due to a problem with data acquisition (i.e. the RIP “van”), but with the way the collected data was processed. The final change was to provide guidance on when to use the Roughness Condition Index (RCI) in the PCR calculation. Roughness data is of little value to determining overall condition on routes that, due to their length or geometrics, have lower vehicle operating speeds. Therefore, in Cycle 5, only routes that have lengths of one half mile or greater and posted speed limits of 25 mph or greater will have RCI reported and included in the PCR calculations.

Additionally, methodologies were updated in 2013 for Manually Rated Routes (paved routes that the collection vehicle is unable to drive) as well as Parking Areas to provide more accurate condition data to the HPMA. These updated methodologies allow for the efficient assessment of pavement conditions using a visual inspection method to denote specific distresses. These distresses are indicative of current conditions, the causes for current and future deterioration, and identify the level of targeted repair and rehabilitation practices required.

The changes that were implemented were endorsed by management at both the FHWA and NPS. In order to show the effectiveness of these changes, several sites were ground truth tested in early 2014 to ensure that an improvement was achieved between the relationship of PCR and the actual Maintenance and Rehabilitation needs that were represented. The changes will allow greater use of RIP and HPMA data for not simply condition data reporting, but also as a reliable tool for project identification and selection.

Description of the Rating System

The Federal Highway Administration, National Park Service Road Inventory Program (NPS-RIP), collects roadway condition data on paved surfaces (asphalt, concrete, brick, and cobblestone) on roads, parkways, and parking areas in national parks nationwide. The road surface condition data is collected using an automated Data Collection Vehicle (DCV) and manually using Manually Rated Route (MRR) procedures. Roads having brick or cobblestone surfacing are not normally surveyed with the DCV, but are manually rated for condition rating.

The FHWA RIP is implemented based on the premise that an accurate pavement surface condition assessment can be accomplished using automated crack detection technology as applied to digital images. Various methods of pavement condition assessment have been developed over the years with varying degrees of accuracy and acceptance. The use of digital photography to record pavement images and subsequent crack detection and classification has undergone continuous improvements over the past decade. Digital cameras with increasingly superior resolution and high definition have become more affordable, and the proprietary programming code and algorithms have been improved in crack detection software.

With the use of quality digital photography and automated crack detection software, FHWA RIP is tasked with executing a pavement condition assessment on a network of roughly 5,700 miles of National Park Service roads and parkways. Because a subset of roads will be collected multiple times this cycle, the total collection length will be around 13,000 miles. Foremost in setting up the basis of pavement distress identification is employing the distress identification protocols used by FHWA. There is no single distress identification system that is universal among entities conducting a program of distress identification. For the purpose of the NPS RIP, FHWA employs distress identification protocols that are specific to this program.

FHWA has referenced the “*Distress Identification Manual for the Long-Term Pavement Performance Program*”, Publication No. FHWA-RD 03-031, June 2003, as the point-of-reference for distress types on NPS pavement. In truth, the FHWA RIP distress types are similar to those described in the LTPP manual with some modifications. This document, “*Distress Identification Manual for the NPS Road Inventory Program, Cycle 6, 2014-2020*” was developed using the “*Distress Identification Manual for the Long-Term Pavement Performance Program*” as a guideline. Definitions of severity levels based on crack width contained in this document adhere to the LTPP Distress ID Manual. Modifications have been made to the definition of Alligator and Longitudinal Cracking and determination of Alligator Cracking severity. This manual also addresses Rutting and Roughness and its application to RIP.

Cycle 6 has launched in the spring of 2014 and will again comprise all parks, large and small, that are served by paved roads and/or parking areas. For Cycle 6, roughly 333 large and small parks will have all paved routes and parking areas collected at least once in the cycle, some will have multiple collections depending on the size of the park and the functional class of the route.

This “*Distress Identification Manual for the NPS Road Inventory Program, Cycle 6, 2014-2020*” will be used as a reference resource in crack detection and classification, determination of distress severity and extent, and in the calculation of distress index values for the FHWA RIP Cycle 6.


Explanation of the Condition Descriptions

In addition to the RIP Index changes that were implemented in Cycle 5, we will also aim to provide greater assistance in translating good/fair/poor categories into pavement needs categories. The PCR can be used to indicate the place in the Pavement Life Cycle and the types of treatments that should be considered now and into the future.

- Excellent/New: PCR of 95-100. Pavements in this range will require only spot repairs
- Good: PCR of 85-94. Pavements in this range will likely be candidates for preventive maintenance. Examples include Chip and Slurry Seals, Micro Surfacing and Thin Overlays.
- Fair: PCR of 61-84. Pavements in this range will likely be candidates of Light Rehabilitation (L3R). Examples include single-lift overlays up to 2.5 inches in total thickness, milling and overlays.
- Poor: PCR of 60 or below. Pavements in this range will likely be candidates of Heavy Rehabilitation or Reconstruction (H3R or 4R). Examples include Pulverization, Multiple Lift Overlays, and Reconstruction.

At this time, specific maintenance and rehabilitation activities should be evaluated and recommended at the project level. Site-specific conditions that influence treatment type should be determined based on performing a subsurface investigation and/or pavement condition survey, and not be based solely on RIP data. Additionally, RIP produces a snapshot of conditions the year in which the data was collected. For further information or to obtain additional PMS data from our (HPMA) please contact the Eastern Federal Lands pavement team.

Condition Categories and Treatments

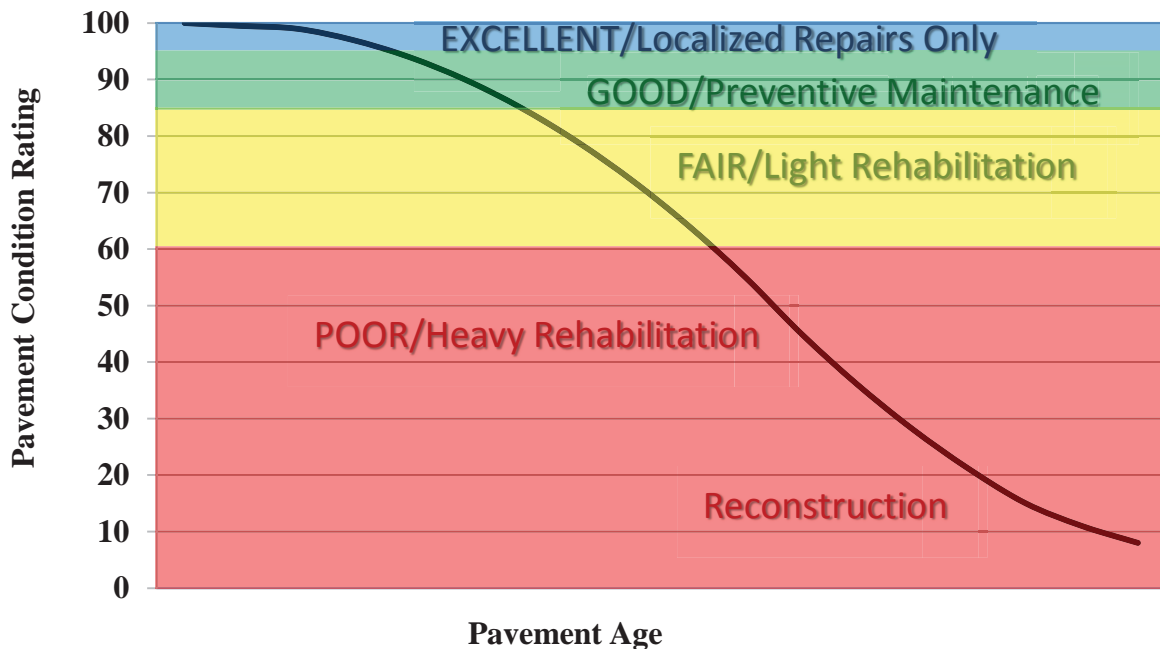

Description of Pavement Treatment Types

1. **Preventive Maintenance** is a planned strategy of cost-effective treatments to an existing roadway system and its appurtenances that preserves the system, retards future deterioration, and maintains or improves the functional condition of the system (without significantly increasing the structural capacity). Preventive maintenance is typically applied to pavements in good condition having significant remaining service life. As a major component of pavement preservation, preventive maintenance is a strategy of extending the service life by applying cost-effective treatments to the surface or near-surface of structurally sound pavements. Examples of preventive treatments include asphalt crack sealing, chip sealing, slurry or micro-surfacing, thin and ultra-thin hot-mix asphalt overlay, concrete joint sealing, diamond grinding, dowel-bar retrofit, and isolated, partial and/or full-depth concrete repairs to restore functionality of individual slabs.
2. Pavement Rehabilitation consists of structural enhancements that extend the service life of an existing pavement and/or improve its load carrying capacity. Rehabilitation techniques include restoration treatments and structural overlays. Rehabilitation projects extend the life of existing pavement structures either by restoring existing structural capacity through the elimination of age-related, environmental cracking of embrittled pavement surface or by increasing pavement thickness to strengthen existing pavement sections to accommodate existing or projected traffic loading conditions. Two sub-categories result from these distinctions, which are directly related to the restoration or increase of structural capacity.
 - **Light Rehabilitation (L3R)** - Examples include single-lift overlays up to 2.5 inches in total thickness and milling and overlays for flexible pavements
 - **Heavy Rehabilitation (H3R)** – Requires rehabilitation with grade improvement. H3R stands for resurfacing, restoration, and rehabilitation projects. H3R projects typically involve multi-depth (overlays greater than 2.5 inches) pavement improvement work (short of full-depth replacement) and targeted safety improvements. H3R projects generally involve retention of the existing three-dimensional alignment.
3. **Reconstruction (4R)** is defined as the replacement of the entire existing pavement structure by the placement of the equivalent or increased pavement structure. Reconstruction usually requires the complete removal and replacement of the existing pavement structure. Reconstruction may utilize either new or recycled materials incorporated into the materials used for the reconstruction of the complete pavement section. Reconstruction is required when a pavement has either failed or has become functionally obsolete.

Appendix A

Methodology for Determining Condition Ratings with the Data Collection Vehicle (DCV)

Surface Distresses Identified by the Data Collection Vehicle

Surface Condition Rating – SCR

Surface distresses are measured in the primary lane only. In the classification and measurement of all paved surface condition data, results will be reported in the database in record intervals of 0.02 miles (105.6 feet) (smallest granularity) along the route.

Surface distresses and rutting are determined from digital images that provide both the longitudinal and transverse profile. The images also provide an elevation profile of the road, creating a 3-dimensional image of the paved surface.

- Transverse Cracks
- Longitudinal Cracks
- Alligator Cracks
- Patching/Potholes
- Rutting

Each of the five surface distresses is assigned a computed surface distress index

- Transverse Crack Index
- Longitudinal Crack Index
- Alligator Crack Index
- Patching/Pothole Index
- Rutting Index

Surface distress data are classified as listed above, measured for severity, and quantified for extent. Classification, severity, and extent of these five surface distresses comprise the three main elements for calculation of Surface Condition Rating (SCR).

In addition to the five surface distresses, a Structural Crack Index is computed, which is a combination of the Longitudinal Crack Index and the Alligator Crack Index. The Structural Crack Index is then used in lieu of the LC and AC indices to compute SCR.

Roughness Condition Index - RCI

Additional condition data measured by DCV (lasers and accelerometers)

- Roughness (IRI)

Roughness is measured by FHWA's DCV and reported as International Roughness Index (IRI) in inches/mile. Using IRI, the Roughness Condition Index (RCI) is computed.

Pavement Condition Rating - PCR

Using the SCR (computed from the five surface distresses) and the RCI, an overall Pavement Condition Rating (PCR) is computed. The formula for PCR is:

$$\text{Asphalt PCR} = (0.60 * \text{SCR}) + (0.40 * \text{RCI})$$

$$\text{Concrete PCR} = \text{RCI}$$

A detailed description of each distress index formula, roughness index formula, SCR and PCR is provided in this document.

Each classified surface distress will fall into one or more severity - LOW, MEDIUM, or HIGH based on criteria listed. For each severity, an extent is established based on the measured quantity of the distress within that severity. Within each severity individual distresses are assigned a Maximum Allowable Extent (MAE). For example, LOW severity transverse cracking may be allowed up to 21.1 cracks within a 0.02 mile interval before it reaches MAE and fails.

The index formulas are based on a scale of 0 to 100. A PCR index value of 100 would indicate a “new” road with no measurable distresses or rough ride. A PCR value of 60 is determined to be terminable serviceability and the road is considered failed. The range of index values with condition descriptors is:

POOR = (less than or equal to 60), **FAIR**= (61 – 84), **GOOD**= (85 - 94), **EXCELLENT**= (95 - 100)

Index values are generally computed based on cumulative deducts of the measured severities. As shown in the index formulas below, as any single severity reaches or exceeds MAE, the index computes to a value of 60 or less, and the road fails for that 0.02 interval.

Note: *As a result of a unique combination of measured surface distresses and IRI, index values occasionally compute to less than 0 or greater than 100. In this instance, an index value less than 0 defaults to 0. Index values greater than 100 defaults to 100. For all indices, a higher value indicates a better road condition, and a lower value indicates a poorer road condition.*

On the following page, Table 1 summarizes the different types of distresses measured.

ASPHALT-SURFACED PAVEMENT DISTRESS TYPES WITH RUTTING AND ROUGHNESS				
Distress Type	Units Of Measure	Converted To	Defined Severity Levels?	Measured By
Alligator Cracking	Square Feet	Percent of Lane Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Transverse Cracking	Linear feet	Number of Cracks Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Longitudinal Cracking	Linear feet	Percent of Lane Length Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Patching / Potholes	Square Feet	Percent of Lane Per 0.02 Mile	No	3 Dimensional pavement imaging system
Rutting	Inches	Rut Depth Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Roughness	IRI	*RCI Per 0.02 Mile	No	DCV – Lasers / Accelerometers

**Note: Roughness is measured on concrete roadways, but surface distresses and rutting are not measured. For concrete, PCR = RCI*

Table 1. Distress summary

Alligator Cracking

Description:

Alligator cracking is considered a combination of fatigue and block cracking. It is a series of interconnected cracks in various stages of development. Alligator cracking develops into a many-sided pattern that resembles chicken wire or alligator skin. It can occur anywhere in the road lane. Alligator cracking must have a quantifiable area.

Severity Levels:

LOW

An area with little to no interconnecting cracks with no visible spalling. Cracks are less than or equal to a mean width of 0.25 in. (6mm). Cracks in the pattern are no further apart than 1 foot (0.328 m). May be sealed cracks with sealant in good condition and a crack width that cannot be determined.

MEDIUM

An area of interconnected cracks that form a complete pattern. Cracks may be slightly spalled. Cracks are greater than 0.25 in. (6 mm) but less than or equal to 0.75 in. (19 mm) or any crack with a mean width less than or equal to 0.75 in. (19 mm) and adjacent low severity cracking. Cracks in the pattern are no further apart than 6 in. (150 mm).

HIGH

An area of interconnected cracks forming a complete pattern. Cracks are moderately or severely spalled. Cracks are greater than 0.75 in. (19mm) or any crack with a mean width less than or equal to 0.75 in. (19mm) and adjacent medium to high severity random cracking.

A combination of observed crack width and crack pattern is used to determine overall severity of alligator cracking. Based on above description of each severity, the highest level of crack width and crack pattern determines overall severity as shown in Table 2.

ALLIGATOR CRACKING SEVERITY LEVELS				
	CRACK SEVERITY	CRACK PATTERN		
		LOW	MED	HIGH
CRACK WIDTH	LOW	LOW	MED	HIGH
	MED	MED	MED	HIGH
	HIGH	HIGH	HIGH	HIGH

Table 2. Alligator Crack Severity Levels

Longitudinal Cracking

Description:

Longitudinal cracking occurs predominantly parallel to the pavement centerline. It can occur anywhere within the lane. Longitudinal cracks occurring in the wheelpath may be noteworthy.

Severity Levels:

LOW

Cracks with a mean width less than or equal to 0.25 in. (6 mm). This also includes sealed cracks with sealant in good condition and a width that cannot be determined.

MEDIUM

Cracks with a mean width greater than 0.25 in. (6 mm) but less than 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random low severity cracking.

HIGH

Cracks with a mean width greater than 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random medium to high severity cracking.

Transverse Cracking

Description:

Transverse cracking occurs predominantly perpendicular to the pavement centerline. It can occur anywhere within the lane.

Severity Levels:

LOW

Cracks with a mean width of less than or equal to 0.25 in. (6 mm). Sealed cracks with sealant in good condition and a width that cannot be determined.

MEDIUM

Cracks with a mean width greater 0.25 in. (6 mm) and less than or equal to 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random low severity cracking.

HIGH

Cracks with a mean width greater than 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random medium to high severity cracking.

Patching and Potholes

Description:

Patching is an area of pavement surface that has been removed and replaced with patching material or an area of pavement surface that has had additional patching material applied. Patching may encompass partial lane or full lane width. On full lane width patching; the total, contiguous length of patch may not exceed 0.100 mi. (0.161 km). (Any full-lane patch exceeding 0.100 mi. in length is considered a pavement change). Patching must have a quantifiable area.

Potholes are bowl-shaped holes of various sizes occurring in the pavement surface.

Manhole covers should not be rated as patches unless there is obvious patching around the manhole.

Speed bumps should not be rated as patches

Severity Levels:

There are no stratified severities for Patching and Potholes. They either are present or they are not.

RUTTING

Description:

Rutting is a longitudinal surface depression in the wheelpath.

Severity Levels:

LOW

Ruts with a measured depth of 0.20 inches to 0.49 inches
Ruts less than 0.20 in. are not included in the distress calculations.

MEDIUM

Ruts with a measured depth of 0.50 inches to 0.99 inches

HIGH

Ruts with a measured depth greater than 1.00 inch

ROUGHNESS

Description:

Roughness is the measurement of the unevenness of the pavement in the direction of travel. It is measured in units of IRI (International Roughness Index), inches per mile, and is indicative of ride comfort.

Severity Levels:

There are no stratified severity levels for roughness. The roughness (or smoothness) of a road surface can be defined by IRI in the following table.

IRI DESCRIPTIONS	
Type of Road	Typical IRI (in/mile)
New Road, no noticeable roughness	<90
Small level of roughness	90 – 126
Road of average roughness	126 – 190
Road with above average roughness	190 – 253
Road with severe roughness	253 – 380
Nearly impassable	>380

Table 3. International Roughness Index

Roughness Collection Parameters

On shorter roads with a lower speed limit the usefulness in collecting and reporting IRI is negligible. Lower, inconsistent speeds can lead to a less accurate IRI value. Therefore RIP has put in place the following protocols for reporting IRI.

International Roughness Index (IRI) is not reported on routes with the following criteria:

- Posted speed limit is less than 25 mph
- Length of route is less than 0.50 miles

When a collected route has a posted speed limit of at least 25 mph and length of at least 0.50 miles, IRI will be collected except on road sections where the speed is less than 20 mph

Other situations may arise where the speed and length factors are met, but reporting IRI could lead to an inaccurate PCR. RIP will determine whether or not it is reasonable to report IRI on these routes on a case by case basis.

Index Formulas

Note: All index formulas listed below contain MAE applicable to 0.02 mile (105.6 feet) interval.

Alligator Crack Index

$$\text{AC_INDEX} = 100 - 40 * [(\% \text{LOW} / 35) + (\% \text{MED} / 15) + (\% \text{HI} / 5)]$$

Where:

The values %LOW, %MED and %HI report the percentage of the observed pavement (0.02 mile, primary lane) that contains alligator cracking within the respective severities. These values range from 0 to 100.

%LOW = Percent of total area (primary lane, 0.02 in length), low severity

%MED = Percent of total area (primary lane, 0.02 in length), medium severity

%HI = Percent of total area (primary lane, 0.02 in length), high severity

Percent of total area is computed as:

$$\frac{\text{square foot area of alligator crack severity}}{(0.02 \text{ mile}) * (\text{lane width})}$$

In AC_INDEX, the denominators 35, 15, and 5 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 35% of low severity alligator cracking for a 0.02 interval before failure, 15% for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Longitudinal Crack Index

$$\text{LC_INDEX} = 100 - 40 * [(\% \text{LOW} / 175) + (\% \text{MED} / 75) + (\% \text{HI} / 25)]$$

Where:

The values %LOW, %MED, and %HI report the length of longitudinal cracking within each severity as a percent of the section length (0.02 mile, primary lane). These values are greater than or equal to 0 and can exceed 100.

%LOW = Percent of interval length (primary lane, 0.02 in length), low severity

%MED = Percent of interval length (primary lane, 0.02 in length), medium severity

%HI = Percent of interval length (primary lane, 0.02 in length), high severity

Percent of interval length is computed as:

$$\frac{\text{length of respective longitudinal cracking}}{(0.02 \text{ mile}) * (105.6 \text{ ft.})}$$

In LC_INDEX, the denominators 175, 75, and 25 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 175% of low severity longitudinal cracking for a 0.02 interval before failure, 75% for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Structural Crack Index

$$SC_INDEX = [100 - ((100 - AC_INDEX) + (100 - LC_INDEX))]$$

Structural Crack Index is a combination of Alligator Cracking and Longitudinal Cracking, and is used in the SCR formula in lieu of AC and LC separately.

Transverse Crack Index

$$TC_INDEX = 100 - 40 * [(LOW / 21.1) + (MED / 4.4) + (HI / 2.6)]$$

Where:

The values LOW, MED and HI report a count of the total number of transverse cracks (reported to three decimals) within each severity level, where one transverse crack is equal to the lane width. These values are greater than or equal to 0.

LOW = Number of cracks in interval (primary lane, 0.02 in length), low severity

MED = Number of cracks in interval (primary lane, 0.02 in length), medium severity

HI = Number of cracks in interval (primary lane, 0.02 in length), high severity

Number of cracks is computed as:

$$\frac{\text{Total length of transverse cracks}}{\text{Lane width}}$$

In TC_INDEX, the denominators 21.1, 4.4, and 2.6 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 21.1 low severity transverse cracks for a 0.02 interval before failure, 4.4 cracks for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Patching Index

$$PATCH_INDEX = (100 - 40) * (\%PATCHING / 80)$$

Where:

The value %PATCHING reports the percentage of the observed pavement (0.02 mile, primary lane) that contains patching/potholes. This value ranges from 0 to 100.

%PATCHING = Percent of total area (primary lane, 0.02 in length)

Percent of total area is computed as:

$$\frac{\text{square foot area of patching/potholes}}{(0.02 \text{ mile}) * (\text{lane width})}$$

There are no severity levels for patching. It either exists or does not.

There are no severity levels for patching. It either exists or does not. In PATCH_INDEX, the denominator 80 is the Maximum Allowable Extent (MAE) for each severity. In other words, we will allow up to 80% patching for a 0.02 interval before failure. As you can see, if patching/potholes reaches MAE the resulting index value is 60, or failure.

Rutting Index

$$\text{RUT_INDEX} = 100 - 40 * [(\% \text{LOW} / 535) + (\% \text{MED} / 205) + (\% \text{HI} / 40)]$$

Where:

20 rut depth measurements are taken per 0.02 interval for each of 2 wheel paths (left and right), resulting in a total of 40 measurements taken for both wheel paths. Each wheelpath is analyzed independently for rut severities. The values %LOW, %MED and %HI report the percentage of the 40 measurements within that severity. These values range from 0 to 200.

%LOW = Percent of LOW ruts in left wheelpath based on 20 ruts, plus percent of LOW ruts in right wheelpath based on 20 ruts.

%MED = Percent of MED ruts in left wheelpath based on 20 ruts, plus percent of MED ruts in right wheelpath based on 20 ruts.

%HI = Percent of HI ruts in left wheelpath based on 20 ruts, plus percent of HI ruts in right wheel path based on 20 ruts.

Percent of rut measurements within each severity can also be computed as:

$$\frac{\text{(total number of ruts within each severity in both wheelpaths)}}{20} \times 100$$

In RUT_INDEX, the denominators 535, 205, and 40 are the Maximum Allowable Extents for each severity; Low, Medium, and High, respectively. Only the MAE for high severity rutting can fail a section, since 200% of *only* low severity ruts would yield a rut index of 85 and 200% of *only* medium severity ruts would yield a rut index of 61.

Roughness Condition Index (Asphalt)

$$\text{RCI} = 32 * [5 * (2.718282^{(-.0041 * \text{AVG IRI}))}]$$

Where:

The value AVG IRI reports the average value of the Left IRI and Right IRI measurements for the interval (0.02 mile, primary lane). This value can range from approximately 40 to 999.0.

Average IRI is computed as:

$$\frac{(\text{Left wheelpath IRI}) + (\text{Right wheelpath IRI})}{2}$$

There is no applicable threshold for failure for this index.

Roughness Condition Index (Concrete)

$$\text{RCI} = (-0.0012)(\text{IRI}^2) + (0.0499)(\text{IRI}) + 99.542$$

For concrete, PCR = RCI

Surface Condition Rating Index

SCR = Lowest Index Value Of: [SC_INDEX, TC_INDEX, PATCH_INDEX, RUT_INDEX]

Note: The modified SCR equation above combines AC_INDEX and LC_INDEX, and considers that a single AC/LC index value of the Structural Crack Index (SC_INDEX). The lowest of the four computed index values (SC_INDEX, TC_INDEX, PATCH_INDEX, or RUT_INDEX) becomes the SCR.

Where:

See above for determinations of SC_INDEX, TC_INDEX, PATCH_INDEX and RUT_INDEX.

The threshold for failure for this index is SCR = 60. Data Collection Vehicle Subsystems

Data on paved roads is collected by FHWA using a Pathway Services Inc. Data Collection Vehicle (DCV), called a PathRunner. The DCV is driven in the primary-direction lane at posted speed limits and less.

Cameras

Forward-facing and rear-facing video is collected as jpeg digital imagery files at a frequency of every 26.4feet.

Two forward-facing cameras are mounted above the vehicle cab, one pointed straight ahead and the other to the right shoulder providing seamless roughly 120 degree viewing. A third camera is mounted in the rear of the vehicle, recording the left shoulder.

CAMERA SPECIFICATIONS TWO FORWARD / ONE REAR FACING CAMERA	
Camera lens/type	Prosilica GT 2750 (GigE Technology)
Image format	*.jpg
Image resolution	2750 x 2200, 18 frames/second
Image pixel size	depends on distance
Zoom ratio	16mm Fixed
Iris range	Aperture Range F 1.8 – Infinity (P-Iris, Automatic)

Pavement Imaging and Rutting

High resolution rutting data and surface imaging are collected in a single data stream using a three-dimensional (3D) pavement surface transverse profile data acquisition system. The 3D camera captures a laser line as it is projected over the pavement surface and uses the location of this line to measure the height deviations of the pavement surface. These height deviations can be used to calculate rutting in both wheelpaths. These deviations also provide a grayscale image detailing the change in height throughout the surface, i.e. providing depth measurements for cracking.

THREE-DIMENSIONAL PAVEMENT SURFACE AND TRANSVERSE PROFILE DATA ACQUISITION SYSTEM	
Surface Image Specifications	
Image size	1536 pixels/scan @ 3000 Hz
Image width	4 meters (3950 mm nominal)
Laser class	3B
Power	16W (Two lasers @ 8W Ea)
Vehicle speed limitations	62 mph
Environment	Dry pavement, day or night
Sensor size (approximate)	1536 pixels x 512 pixels
Image display length	26.4 feet
Rutting Specifications	
Reported rut depth units	Inches
Vehicle speed limitations	Up to 62 mph
Sampling rate	3000 profiles/second
Transverse resolution	1536 points/profile
Transverse field-of-view	14 feet
Depth accuracy (nominal)	<1mm
Environment	Dry pavement, day or night, above 32 degrees F
Adherence to specifications	ASTM E1703M-95 (reapproved 2005)

Distance Measuring Instrument (DMI)

The DMI (Distance Measuring Instrument) obtains road length measurements that are accurate to 0.15% for speeds up to 60 mph. The DMI is connected to the hub of the rear wheel on the driver's side, and is calibrated to the revolutions of the rear vehicle axle on a regular basis.

Roughness (IRI)

IRI SPECIFICATIONS	
Reported IRI units	Inches/mile
Vehicle speed limitations	12-62 mph
IRI equipment certification	Texas Transportation Institute (TTI)
Wavelengths accommodated	0.5 feet to 300 feet
IRI computed & reported	World Bank Technical Paper Number 46
Environment	Dry pavement, day or night, above 32 degrees
Adherence to specifications	ASTM E950 Class 1 & AASHTO M 328

The collection system includes a South Dakota type laser profiler manufactured based on active Class 1 ASTM E950 standards. The dynamic profile of the pavement surface is collected from which the IRI roughness data is computed. The sensors include one accelerometer on each wheelpath, one height sensor (laser) on each wheelpath, and a distance transducer.

GPS & Inertial Systems

GPS is collected by an onboard system employing Omnistar real time correction and a spinning gyroscope to provide accurate positioning data in instances of satellite obstruction. All GPS coordinates are tied to an image and linear distance measurements.

GPS SPECIFICATIONS	
Static accuracy	Sub-meter
Dynamic accuracy	2-3 meters
Receiver	12 satellite tracking
Coordinate system	Lat Lon WGS 84
Environment	Day or night
Cross-slope	± 1.75%
Grade	± 1.75%
Adherence to specifications	ASTM E1703M-95 (reapproved 2005)

*NOTE – GPS accuracy is dependent on many different factors. Satellite constellation, tree coverage, GPS receiver quality, and real-time correction availability can all affect the locational and elevation accuracies. The elevation (z coordinate) accuracy is less dependable than locational or horizontal accuracy (x/y coordinates or latitude/longitude). In areas of heavy tree coverage or poor satellite constellations, elevation data can vary by as much as +/- 100 feet.

Appendix B

**Methodology for Determining Condition Ratings
Using Manual Rating Procedures**

Description of Manual Rating Methods

In 2013, the Federal Highway Administration updated existing Manual Rating Procedures in an effort to better align pavement conditions for Manually Rated Routes and Parking with the Highway Pavement Management Application (HPMA). HPMA is the Pavement Management System used by the FHWA to store inventory and condition data from the Road Inventory Program (RIP) and forecast future performance using prediction models. HPMA uses pavement condition data (collected by the Road Inventory Program) to develop life cycles for pavements and recommend treatments to maximize useable pavement life while minimizing costs associated with maintenance and repair.

The Federal Highway Administration (FHWA) developed a set of manual rating methods for pavement that are appropriate for Federal Roadways. Two different methods were developed for linear roads and a separate method was developed for parking areas and nonlinear roads. These methods employ a 0 to 100 rating scale and improve consistency and objectivity in the manual evaluation of surface distresses. They are compatible with ratings that are collected by the automated Data Collection Vehicle (DCV).

- The first of the two manual evaluation methods for roads uses rating criteria to assign index values to each distress type based on a visual evaluation of severity and extent.
- The second manual evaluation method for roads is very time demanding and is best employed on only a select set of routes which may have the highest visitor use and require a more intensive assessment. This method will be used for the Manual Rating of Function Class 1, 2, 7, and 8 Roads. This method is based on measurements that are recorded for each instance of a surface distress. These measurements are converted into index values using conversion formulas.
- Parking areas and non-linear roads are rated similar to the first method shown above, however, there are some slight differences due to the non-linear nature.

The details and criteria used for each of these rating methods are outlined below.

Visual Inspection Method for Manually Rating Secondary Roads

The visual inspection method for manually rated roads uses condition rating criteria that have been developed by FHWA. This criteria is based on a visual evaluation of the severity and extent of distresses to determine the overall condition of the roadway. This method is used for secondary roads that are Functional Class 3, 4, 5, and 6. This constitutes the majority of manually rated roads collected by the Road Inventory Program.

Rating Section Lengths

For this method, Manually Rated Roads are rated in sections. These sections may be made based on length of changes in surface type or condition as described below. The ratings are then aggregated to give an overall rating for the Route:

- Rating sections should be no longer than 0.25 miles in order to keep the area being rated manageable.
- A new rating section may be started based on changes in condition, width, or surface type if these changes represent a significant portion of the route (are not isolated instances).
- If the road condition, width, and surface type remain constant then new sections do not need to be created unless the road exceeds 0.25 miles.

Rating Criteria

For this method, Manually Rated Roads are evaluated using a visual inspection of the six distress types listed below. Each distress is assigned one of five index values. An overall Surface Condition Rating (SCR) and Pavement Condition Rating (PCR) are calculated based on these index values.

- Alligator Cracking
 - Rating based on percentage of road surface affected
- Longitudinal Cracking
 - Rating based on severity level (crack width) and percentage of road section length of longitudinal cracks
- Transverse Cracking
 - Rating based on crack width, crack spacing, and percentage of surface affected
- Patching
 - Rating based on percentage of road surface affected
- Rutting
 - Rating based on percentage of road section length affected by visible rutting (>1 inch depth) that requires remediation
- Roughness
 - Manual assessments of roughness are not made due to the subjectivity of the measurement. Therefore, roughness is not incorporated into the PCR calculation of manually rated roads.

Concrete Routes also receive a PCR rating based on visual evaluation of the following six distress types.

- Slab Faulting at Joints
- Slab Cracking and breakup
- Surface Delamination and Pop-outs
- Joint Distresses
- Patching

Distress Measurement Method for Manually Rating Primary Roads

A more intensive and time demanding assessment than our standard method was developed for Primary roads that are functional class 1, 2, 7, or 8. These high visitation roads are usually accessible by the automated Data Collection Vehicle but in rare instances may need to be manually rated. The method developed is based on measuring each instance of a distress. These measurements are totaled over each section length being measured and are then converted into index values between 0 and 100 (100 being a road with no distress) using index formula equations outlined below. The goal of this method is to produce measured index values which are directly comparable to the automated DCV.

Rating Section Lengths

For the distress measurement method roads are broken into sections in order to rate. Distress measurements are totaled for each section separately in order to determine the index value for that particular section. The section length to be rated is determined based on the following rules:

- Rating sections are between 0.25 and 0.50 miles long
- A new rating section is created if there is a significant change in condition or pavement width
- If there are no significant changes in condition or pavement width, rating sections are broken at equal intervals, typically 0.50 miles

Manual Distress Measurements

Alligator Cracking

- Alligator cracking is measured by area (square feet). Instances of Alligator cracking are measured along the length and multiplied by the average width of the distressed area.
- The index for alligator cracking takes the total area of cracking compared to the interval length and converts it to a percentage. That percentage is then input into an index formula that yields a value between 0 and 100 (0 being the most distressed).
- Severity levels are not defined for manually measured Alligator cracks. The Alligator Crack Index formula is calculated based on an assumption of medium severity.

Longitudinal Cracking

- Longitudinal cracking (cracking in the direction parallel to the roadway) is measured by length (ft.).
- The index for longitudinal cracking takes the total length of cracking compared to the interval length and converts it to a percentage broken down by severity. That percentage is then input into a formula that yields a value between 0 and 100 (0 being the most distressed).
- Two severity levels are defined for manually measured Longitudinal Cracks. Lower severity cracks are those with a mean width of less than 0.25 inches. Sealed cracks with sealant in good condition are also considered lower severity. Higher severity cracks are those with a mean width of greater than 0.25 inches.

Transverse Cracking

- Transverse cracking (cracking in the direction perpendicular to the roadway) is measured by length (ft).
- The index for transverse cracking takes the total number of cracks (1 crack would encompass the full lane) broken down by severity. The total numbers of each severity are then put into a formula that yields a value between 0 and 100 (0 being the most distressed).
- Two severity levels are defined for manually measured Transverse Cracks. Lower severity cracks are those with a mean width of less than or equal to 0.25 inches. Sealed cracks with sealant in

good condition are also considered lower severity. Higher severity cracks are those with a mean width of greater than 0.25 inches.

Patching and Potholes

- Patching and Potholes are measured by area (square feet). Instances of Patching are measured along the length and multiplied by the average width of the patch.
- Instances of full lane width patching cannot be longer than 0.100 miles, otherwise it should be considered a pavement change rather than a distress.
- There are no stratified severities for Patching. It is either present or it is not.

Rutting

- Visible rutting is measured by length (ft.) in each wheel path. Only visible ruts are rated, which are ruts greater than 1 inch deep.
- All rutting recorded in a manual rating is considered to be high severity (> 1 inch). Lesser severities are generally not distinguishable in a visual inspection.

Roughness

- Manual assessments of roughness are not made due to the subjectivity of the measurement. Therefore, roughness is not incorporated into the PCR calculation of manually rated roads.

Index Formulas for Distress Measurement Method:

The method used to convert distress measurements into index values is shown below. The Surface Condition Rating and Pavement Condition Rating are calculated based on these index values.

Alligator Crack Index for Manual Rating:

$$AC_INDEX = 100 - 40 * (\%ALLIGATOR / 15)$$

Where:

%ALLIGATOR = Percent of total area of section being rated that contains Alligator cracking.

Longitudinal Crack Index for Manual Rating:

$$LC_INDEX = 100 - 40 * [(\%LOW / 175) + (\%MED / 75)]$$

Where:

%LOW = Percent length of longitudinal cracks where crack width less than or equal to 0.25 inches

%HIGH = Percent length of longitudinal cracks where crack width greater than 0.25 inches

Transverse Crack Index for Manual Rating:

$$TC_INDEX = (100 - 40) * [(LOW / 21.1) + (MED / 4.4)]$$

Where:

LOW = Count of the total number of transverse cracks within the section length where one transverse crack is equal to the lane width and the crack width \leq 0.25 inches

HIGH = Count of the total number of transverse cracks within the section length where one transverse crack is equal to the lane width and the crack width $>$ 0.25 inches

Number of cracks is computed as:
Total length of transverse cracks/Lane width

Patching Index for Manual Rating:

$$\text{PATCH_INDEX} = (100 - 40) * (\% \text{PATCHING} / 80)$$

Where:

%PATCHING = Percentage of pavement section that contains patching/potholes.

Rutting Index for Manual Rating:

$$\text{RUT_INDEX} = 100 - 40 * (\% \text{RUTTING} / 40)$$

Where:

%RUTTING = Percentage length of high severity rutting within the section being measured.

Method for Manually Rating Paved Parking Areas and Non-Linear Roads

Parking areas are evaluated based on a visual inspection using condition rating criteria that has been developed by FHWA. This criteria is based on a visual evaluation of the severity and extent of distresses to determine the overall condition of the parking area. This overall condition rating is linked to the level of repair and rehabilitation practices required.

A distress index is determined for each of the distresses listed below for Asphalt and Concrete Parking areas. The overall Pavement Condition Rating (PCR) of the parking lot is driven by the most severe distress present.

Rating Criteria:

Asphalt Parking Distress Types

- Alligator Cracking
 - Rating based on percentage of road surface affected
- Longitudinal, Transverse and Block cracking
 - Rating based on crack width, crack spacing, and percentage of surface affected
- Rutting and Distortions
 - Rating based on percentage of road surface affected
- Hot Mix Asphalt Patches
 - Rating based on overall percentage of HMA patches
- Potholes and Cold Patches
 - Rating based on percentage of road surface affected
- Surface Raveling and Bleeding
 - Rating based on percentage of road surface affected

Concrete Parking Distress Types

- Slab Faulting at Joints
 - Rating based on height differential between adjacent slabs or pieces of broken slabs
- Slab Cracking and breakup
 - Rating based on quantity of cracks and if slab is acting to able distribute load as designed
- Surface Delamination and Pop-outs
 - Rating based on percentage of road surface affected to include pop-outs, spalls and surface delamination
- Joint Distresses
 - Rating based on sealant condition and concrete distresses at/or adjacent to joints
- Patching
 - Rating based on percentage of road surface affected

Curb Inspection and Treatments

During inspections of manually rated parking lots and routes, the curb reveal and overall curb condition are evaluated. The curb condition is used to determine a recommendation.

Curb Reveal

The vertical distance on the curb face from the gutter flow line or pavement surface to the top of curb. When resurfacing adjacent to curb, the resulting curb reveal should be no less than 4 inches. Additionally, when resurfacing adjacent to a gutter, the resulting pavement surface should be flush with the gutter pan. In cases where a resurfacing would violate either of these parameters, the surface may need to be milled or removed to adjust to these field conditions.

Curb Recommendations

The following treatment categories are based on the overall percentage of distresses along the entire curb structure for a specific pavement structure. Distresses include spalling, cracking, loss of material and any other damage which prevents the curb from conveying storm runoff or failing to perform in its intended function.

- Overall curb damage ranging 0%-5%:
 - DO NOTHING
- Overall curb damage ranging 5%-20%
 - LIGHT REPAIR
- Overall curb damage ranging 20%-50%
 - MODERATE REPAIR
- Overall curb damage greater than 50%:
 - REPLACE

GPS for Manually Rated Roads and Parking

GPS information for Manually Collected Cycle 6 Routes will be recorded using the latest hardware and software by TRIMBLE 6000 Series GeoXT. Cycle 6 GPS collection units will allow access to GPS and GLONASS, improving overall GPS reliability, accuracy and precision to submeter accuracy.

Additionally, the new GPS units have an enhanced ability to collect accurate signals underneath tree cover or adjacent to buildings or natural terrain with extreme vertical gradations that typically reduce GPS accuracy. Trees and buildings create “satellite shadows”, limiting the areas where you can reliably collect high-accuracy GPS data. The updated GPS receiver will deliver improved usable data under tree canopy or in natural or urban canyons. Routes that were previously collected accurately will not be recollected in Cycle 6.

TRIMBLE 6000 SERIES GeoXT GPS SPECIFICATIONS	
Receiver	Trimble Maxwell™ 6 GNSS chipset
Channels	220 channels
Systems	GPS / GLONASS / WAAS
Accuracy	Sub-meter
Operation Temperature	-20 °C to +60 °C (-4 °F to +140 °F)
Cellular and Wireless	UMTS / HSDPA / GPRS / EDGE / Wi-Fi / Bluetooth
Internal Still Camera w/ GEOTAG ability	Autofocus 5 MP (JPG) and WMV w/ Audio

Appendix C
Description of Cycle 6 Deliverables

Interim Report Delivery

Partial report will be primarily focused on manually collected routes. The report will be released approximately four months after manual collection of parking lots and other manually collected routes to provide NPS an immediate report on the condition of routes collected manually.

The Interim Report Delivery consists of an Interim Report PDF that contains the following:

- Parking lot and manually rated route conditions
- Route ID Reports
- Route ID Changes Report.

Please note that since the Data Collection Vehicle will have not collected data at this point in time, the following will not be in the Interim Report:

- No park summary information will be provided in the report
- No DCV data will be provided in report
- No road logs will be provided in report
- No maps will be provided in report
- Any mileages collected will be approximate

All data provided in the Interim Report will also be included in the Final Report.

Final Report Delivery

The Final Report will contain all data collected by Manual Inspection and the Data Collection Vehicle. All information provided in the Interim Report will be included in the Final report. Manually collected information reported in the Interim Report may be updated in the Final Report if pavement conditions have substantially changed between the Manual Inspection and Data Collection Vehicle Inspection or other unforeseen circumstances.

The final report will be released approximately 8 months after the Data Collection Vehicle completes its collection of that specific park.

Data included in the Final Report package consists of the following:

- **Condition Photos:** All photos taken during Cycle 6.
- **Data Video:** Data and video of each route collected by the DCV will be viewable through PATHVIEW software. PATHVIEW Software and training will be provided to NPS personnel by Eastern Federal Lands.
- **GPS on All Rated Routes:** All GPS data collected from the DCV will be provided. Parking areas, some roads, and other paved areas that are not fully drivable with the DCV are collected manually by field technicians. GPS is collected for these routes using portable Trimble GPS units.
 - GPS will be provided as Shapefiles and KMLs
 - All GPS data related to road collection will be linear referenced to the collected length
- **Geodatabase – Background and Metadata:** In addition to this park report, a geodatabase containing both tabular and spatial data specific to this park has been provided.
 - All data disseminated in the preceding report has been obtained from the tables and fields within said geodatabase. The geodatabase can be referenced for tabular data via Microsoft Access or for both tabular and spatial data via ESRI's ArcGIS Suite of software which consists of; ArcMap, ArcCatalog and ArcExplorer.
 - Consolidating the RIP data into one database creates a seamless relationship of tables and geographic data. It allows RIP to facilitate easier updates and enhancements in the future. A geodatabase can be thought of as simply a database containing spatial data. A complete and thorough description of the tables and fields contained within this geodatabase can be found in the metadata. The metadata is attached directly within the geodatabase and can be accessed via ESRI's ArcCatalog.
- **Report (RIP Report and Route ID):** A PDF report will be provided that includes a list of all routes and key data. Condition reports for each route will be included. All changes, additions and deletions to any route will be included in the report. Features along routes will not be collected in Cycle 6.

Partial DCV Collections

Additional Partial DCV Collections may be done on specific parks depending on their size and overall mileage of routes within its boundaries during Cycle 6. Parks with greater than 10 miles of paved roadways will receive at least one additional Partial DCV collection during Cycle 6. Data collected during these Partial DCV Collections will not result in the delivery of an additional report to the park.

Data collected by the DCV during Partial DCV Collection will be used to improve HPMA modeling by providing additional “snapshots in time” of park pavement conditions. This improved HMPA modeling will assist in the programming and budgeting of future projects which will help maximize the life of pavement infrastructures.

Instead of receiving a report of conditions collected during the Partial DCV collection, the park will receive a formal letter from the Road Inventory Program requesting coordination for the additional Partial DCV collection, identifying the dates of the Partial DCV Collection and will reinforce the purpose and importance of the Partial DCV Collection.

Appendix D
Glossary of Terms and Abbreviations

Glossary of Terms and Abbreviations

TERM OR ABBREVIATION	DESCRIPTION OR DEFINITION
AC	Alligator Cracking
CRS	Condition Rating Sheets (Section 5)
Curb Recommendation	Curb remediation based on overall percentage of curb distress
Curb Reveal	Height of curb exposed from gutter flow line to top of curb
DCV	Data Collection Vehicle
Excellent	Excellent rating with an index value of 95 to 100
Fair	Fair rating with an index value from 61 to 84
FUNCT_CLASS	Functional Classification (see Route ID, Section 2)
Good	Good rating with an index value from 85 to 94
IRI	International Roughness Index
HPMA	Highway Pavement Management Application
Lane Width	Width from road centerline to fogline, or from centerline to edge-of-pavement when no fogline exists
LC	Longitudinal Cracking
MRR	Manually Rated Route
MRL	Manually Rated Line
MRP	Manually Rated Polygon
N/A	Not Applicable
NC	Not Collected
PATCH	Patching and Potholes
Paved Width	Width from edge-of-pavement to edge-of-pavement
PCR	Pavement Condition Rating
PKG	Parking Area
Poor	Poor rating with an index value of 0 to 60
RCI	Roughness Condition Index
SC	Structural Cracking
SCR	Surface Condition Rating
TC	Transverse Cracking