PETE Cycle 6

Final Report

Road Inventory and Condition Assessment of Paved Routes Petersburg National Battlefield





Prepared By:

Federal Highway Administration Eastern Federal Lands Highway Division Road Inventory Program (RIP)

Report Date: October 2021

Petersburg National Battlefield in Virginia

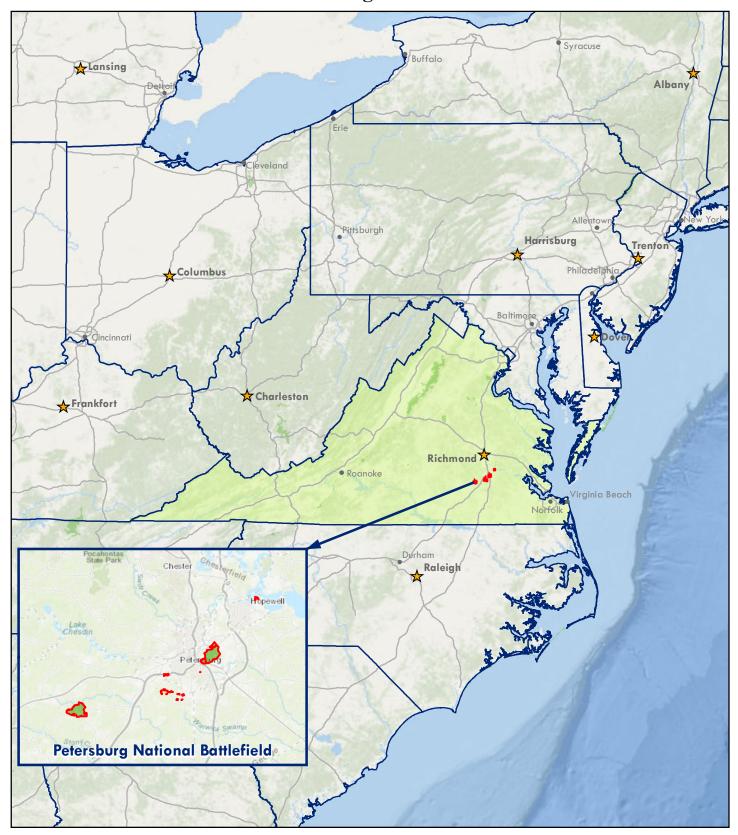




Table of Contents

SEC	TION	PAGE NO.
1.	INTRODUCTION	1 - 1
2.	PARK ROUTE INVENTORY	
	Route ID Report, Subcomponent Report, and Changes Report (As Applicable)	2 - 1
3.	PARK SUMMARY INFORMATION	
	Parkwide Paved Route Condition Summary	3 - 1
	Explanation of Condition Descriptions	3 - 2
	Route-Level Condition Summary Reports for Data Collection Vehicle, Manually Rated, and Parking Area Routes (As Applicable)	3 - 3
4.	PARK ROUTE LOCATION MAPS	
	Route Location Key Map	4 - 1
	Route Location Area Map(s)	4 - 2
	Route Condition Key Map – PCR Mile by Mile	4 - 6
	Route Condition Area Map(s) – PCR Mile by Mile	4 - 7
5.	PAVED ROAD CONDITION RATING SHEETS	
	Paved Road Pages	5 - 1
6.	PAVED PARKING AREA CONDITION RATING SHEETS	
	Paved Parking Area Pages	6 - 1
7.	ROAD MILEPOST INFORMATION	
	Road Milepost Information and Logs	7 - 1
8.	APPENDIX	
	Improvements to the RIP Index Equations and Determination of PCR	8 - 1
	Description of the Rating System	8 - 2
	Explanation of the Condition Descriptions	8 - 3
	Description of Pavement Treatment Types	8 - 4
	Appendix A: Methodology for Determining Condition Ratings with the Data Collection Vehicle (DCV)	8 - 5
	Appendix B: Methodology for Determining Condition Ratings Using Manual Rating Procedures	8 - 20
	Appendix C: Description of Cycle 6 Deliverables	8 - 29
	Appendix D: Glossary of Terms and Abbreviations	8 - 32

Section 1 Introduction





Introduction

The Federal Highway Administration's (FHWA), Road Inventory Program (RIP) inventories all roads and parking areas in the National Park System, and performs condition inspections on all paved roads and parking areas for the National Park Service (NPS). This report contains the results of the Cycle 6 condition assessment of paved roads and parking lots for this park unit. This assessment was done using an automated, state-of-the-art pavement inspection vehicle as well as manual ratings. This information represents the condition of the paved assets at the time of the inspection. The pavement management system utilized by FHWA and the NPS uses these assessments to estimate future conditions and help prioritize pavement maintenance and rehabilitation projects. Further information about RIP data and its role in managing paved roads and bridges can be obtained by contacting the NPS Regional Transportation Program Manager.

A History of the Road Inventory Program:

The FHWA, in the mid-1970s, was charged with the task of identifying surface condition deficiencies and corrective priorities on NPS roads and parkways. Additionally, FHWA was tasked with establishing an integrated maintenance features inventory, locating features such as culverts, guardrails, and signs, among others, along NPS roads and parkways. As a result, in 1976 the NPS and FHWA entered into a Memorandum of Agreement (MOA) which established the RIP. This MOA was revised in 1980 to update RIP data collection standards and develop a long-range program to improve and maintain NPS roads to designated condition standards and establish a pavement management program.

The FHWA completed the initial phase of inventory in the early 1980s. As a result of this effort, each NPS unit included in the collection received a RIP Report known as the "Brown Book" which contained information that was inventoried during this first RIP phase. In the 1990s, a cyclical program was developed, and since then five cycles of collection have been completed. Cycle 6 is currently in progress. A summary of the RIP collection cycles is shown in the table below.

Cycle	Years	Parks Collected
Cycle 1	1994 - 1997	° 44 Large Parks
Cycle 2	1997 - 2001	79 Large Parks5 Small Parks
Cycle 3	2001 - 2004	All Large ParksAll Small Parks
Cycle 4	2006 - 2010	86 Large ParksSeveral Small Parks
Cycle 5	2010 - 2014	 All Large Parks (Only functional class 1, 2, 7, and new/modified routes collected) All Small Parks (all roads and parking areas collected)
Cycle 6	2014 – 2020 (±)	 All roads and parking areas collected at all Parks Additional partial collections of functional class 1, 2, and 7 roads at Large Parks Cycle 6 is expected to last 6 years

Note: Large Parks have ≥ 10 Paved Miles; Small Parks have < 10 Paved Miles

Since 1984, the Road Inventory Program has been funded through the Federal Lands Highway Park Roads and Parkways (PRP) Program. Currently, coordination of the RIP with Federal Lands Highway (FLH) is under the NPS Washington Headquarters Park Facility Management Division. The FLH Washington office coordinates policy and prepares national reports and needs assessment studies for Congress.

In 1998, the Transportation Equity Act for the 21st Century (TEA-21) amended Title 23 U.S.C., and inserted Section 204(a)(6) requiring the FHWA and NPS, to develop by rule, a Pavement Management System (PMS) applied to park roads and parkways serving the National Park System.

In 2012, the Moving Ahead for Progress in the 21st Century Act (MAP-21) amended Title 23 U.S.C., and under Section 203(c)(1-2) stated that the National Park Service in cooperation with the DOT/FHWA, shall maintain a comprehensive national inventory of their transportation facilities, with the goal of quantifying transportation infrastructure needs within the National Park System.

A History of the Pavement Management System:

In 2005, the FHWA began implementing the use of a pavement management system to assist the NPS in prioritizing Pavement Maintenance and Rehabilitation activities. The system used by FHWA is the Highway Pavement Management Application (HPMA), which has the ability to store inventory and condition data from RIP and forecast future performance using prediction models. Outputs include performance and condition reports at the National, Regional, Park, or Route level. Regional prioritized lists and optimizations have been produced for most regions, and the Service's overall roadway Deferred Maintenance is calculated via the HPMA.

Overview of Cycle 6:

Cycle 6 launched in the spring of 2014 and will again comprise all NPS park units that are served by paved roads and/or parking areas. For Cycle 6, all paved roads (approximately 5,700 miles) and parking areas will be collected in all parks at least once, while the primary routes (functional class 1, 2, and 7 roads) at Large Parks will have additional collections. These multiple collections will provide updated condition data on a majority of the NPS's primary road network and help build a better pavement management system, allowing for more accurate pavement performance prediction models.

FLH is responsible for the accuracy of all data presented in this report. Any questions or comments concerning the contents of this report should be directed to the national RIP Coordinator located in Ashburn, Virginia.

Respectfully,

FHWA RIP Team

FHWA/Eastern Federal Lands 22001 Loudoun County Parkway Building E-2, Suite 200 Ashburn, VA 20147 (571) 434-1574 FHWA/Central Federal Lands 12300 West Dakota Ave Lakewood, CO 80228 (720) 963-3556

Section 2 Park Route Inventory





Page 1 of 7

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle
MRL = Manually Rated Line

 $\mathsf{MRP} = \mathsf{Manually} \; \mathsf{Rated} \; \mathsf{Polygon}$

PKG = Parking Areas NC = Not Collected

PETE

				=		ROAD INVENTORY (1100 SERIES FMSS	LOCATIONS	S)				5			
Route No.	Cycle Collected	Iteration Collected	FMSS Number	Concessio	Route Name	Route Des	cription To	Maintenance District	FLTP	Paved Miles	Unpaved Miles	Total Mileage	Function Class	Area (SQ FT)	Surf. Type	Area Map
0010	6	1	22942		VA 36 EAST TO VISITOR CENTER	FROM STATE HIGHWAY 36 (OAKLAWN BOULEVARD)	TO ROUTE 0904 (VISITOR CENTER PARKING)	EASTERN FRONT	YES	0.39	0	0.39	1		AS	3
0011	6	1	231698		SHORT FLANK ROAD	FROM PARK-BOUNDARY	TO FLANK ROAD	WESTERN FRONT	YES	0.29	0	0.29	1		AS	2
0012	6	1	46006		VA 36 WEST ON RAMP	FROM ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)	TO STATE HIGHWAY 36 (OAKLAWN BOULEVARD)	EASTERN FRONT	YES	0.16	0	0.16	1		AS	3
0013	6	1	46005		VA 36 WEST OFF RAMP	FROM STATE HIGHWAY 36 (OAKLAWN BOULEVARD)	TO ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)	EASTERN FRONT	YES	0.09	0	0.09	1		AS	3
0014	NC		231690		CRATER VISTA ACCESS ROAD	FROM ROUTE 0500 (SIEGE ROAD)	TO END	EASTERN FRONT	NO	0	0.12	0.12	6		GR	3
0202	NC		24529		BEACH ACCESS ROAD	FROM TOP OF BLUFF NEAR ROUTE 0900 (GRANT'S HEADQUARTERS VISITOR PARKING)	TO WATERFRONT	CITY POINT	NO	0	0.04	0.04	6		GR	4
0300ZZ	6	1	22766		CARRIAGE LANES	FROM VAUGHAN ROAD	TO END OF LOOP	POPLAR GROVE	YES	0.33	0	0.33	2		AS	2
0301	6	1	23019		LONG FLANK ROAD	FROM SQUIRREL LEVEL ROAD	TO CHURCH ROAD	WESTERN FRONT	YES	0.90	0	0.90	3		AS	2
0400	6	1	22825		MANOR HOUSE ENTRANCE DRIVE	FROM PECAN STREET	TO END OF THE LOOP AT MANOR HOUSE	CITY POINT	NO	0	0.14	0.14	3		GR	4
0402	6	1	45375		HEADQUARTERS ACCESS ROAD	FROM STATE HIGHWAY 109 (HICKORY HILL ROAD)	TO END OF LOOP	HOME HEADQUARTERS	YES	0.49	0	0.49	5		AS	3
0403	6	1	45850		RANGER STATION ACCESS ROAD	FROM STATE HIGHWAY 109 (HICKORY HILL ROAD)	TO END OF ROUTE 0408 (RANGER STATION TO HQ SHORTCUT)	HOME HEADQUARTERS	YES	0.11	0	0.11	5		AS	3
0406	NC		22993		OPERATIONS SERVICE ROAD	FROM SOUTH WHITEHILL DRIVE	TO ROUTE 0500 (SIEGE ROAD)	EASTERN FRONT	NO	0.33	0	0.33	6		AS	2
0407	NC		22861		SHAND HOUSE ROAD	FROM ROUTE 0500 (SIEGE ROAD)	TO COLUMBIA GAS LINE RIGHT OF WAY	EASTERN FRONT	NO	0	0.34	0.34	5		GR	3

Page 2 of 7

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle MRL = Manually Rated Line

MRP = Manually Rated Polygon

PKG = Parking Areas NC = Not Collected

PETE

				Ę		ROAD INVENTORY (1100 SERIES FMSS	LOCATION	S)				<u> </u>			
Route No.	Cycle Collected	lteration Collected	FMSS Number	Concessic	Route Name	Route Des	cription To	Maintenance District	FLTP	Paved Miles	Unpaved Miles	Total Mileage	Function Class	Area (SQ FT)	Surf. Type	Area Map
0408	6	1	51263		RANGER STATION TO HQ SHORTCUT	FROM ROUTE 0402 (HEADQUARTERS ACCESS ROAD)	TO END OF ROUTE 0403 (RANGER STATION ACCESS ROAD)	HOME HEADQUARTERS	YES	0.05	0	0.05	5		AS	3
0411	6	1	45878		QUARTERS #29 ACCESS ROAD	FROM STATE HIGHWAY 109 (HICKORY HILL ROAD)	TO ROUTE 0939 (HICKORY HILL HIKE / BIKE PARKING)	HOME HEADQUARTERS	NO	0.13	0	0.13	6		AS	3
0412	NC		22880		MORTAR LOOP ROAD	FROM NW OF VISITOR CENTER PARKING (BATTLEFIELD)	TO END PARALELL TO HWY 36 (WOODLAWN AVE)	EASTERN FRONT	NO	0	0.87	0.87	5		GR	3
0413	NC		22822		CONFEDERATE ESCAPE ROAD	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO END	FIVE FORKS	NO	0	1.40	1.40	6		NV	1
0414	NC		22818		GILLIAM FIELD ROAD	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO END	FIVE FORKS	NO	0	0.10	0.10	6		NV	1
0415	NC		22824		WAGON ROAD	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO END	FIVE FORKS	NO	0	0.20	0.20	6		NV	1
0416	NC		238402		VISITOR CENTER SERVICE ROAD	FROM ROUTE 0904 (VISITOR CENTER PARKING)	TO VISITOR CENTER	EASTERN FRONT	NO	0	0.08	0.08	6		GR	3
0500	6	1	22461		SIEGE ROAD	FROM ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)	TO SOUTH CRATER ROAD	EASTERN FRONT	YES	3.43	0	3.43	1		AS	3

					PAR	KING AREA INVENTO	RY (1300 SERIES FMSS	LOCATI	ONS)					
Route No.	ycle	teration Collected	FMSS Number	oncession	Route Name	Ro From	ute Description		Maintenance District	FLTP	Access Level	Area (SQ FT)	Surf. Type	Area Map
	00	= 0		0	I I	rrom	То					· · ·		
0900	6	1	24557		GRANT'S HEADQUARTERS VISITOR PARKING	FROM CEDAR LANE	TO PARKING		CITY POINT	YES	PUBLIC	23,750	AS	4
0901	6	1	24532		WATER STREET RECREATIONAL PARKING #1	FROM WATER STREET	TO PECAN STREET		CITY POINT	YES	PUBLIC	9,106	AS	4

Page 3 of 7

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle

MRL = Manually Rated Line

MRP = Manually Pated Polygon

MRP = Manually Rated Polygon

PKG = Parking Areas NC = Not Collected

PETE

	PARKING AREA INVENTORY (1300 SERIES FMSS LOCATIONS)												
Route	cle llected	O Territoria Superioria Superiori		ncessio		Route De	scription	Maintenance	FIF	Access	Area	Surf.	Area
No.	ပ် ပိ	⊉ ც	Number	ပိ	Route Name	From To		District	Ξ.	Level	(SQ FT)	Туре	Мар
0902	6	1	46014		WATER STREET RECREATIONAL PARKING #2	FROM WATER STREET	TO PARKING	CITY POINT	YES	PUBLIC	6,137	AS	4
0903	6	1	22827		CARRIAGE HOUSE PARKING	FROM ROUTE 0400 (MANOR HOUSE ENTRANCE DRIVE)	TO PARKING	CITY POINT	NO	PUBLIC	3,327	GR	4
0904	6	1	51262		VISITOR CENTER PARKING	FROM END OF ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)	TO PARKING	EASTERN FRONT	YES	PUBLIC	42,542	AS	3
0905	6	1	45869		MAINTENANCE AREA ACCESS ROAD & PARKING	FROM ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)	TO MAINTENANCE AREA	EASTERN FRONT	YES	PUBLIC	47,678	AS	3
0906	6	1	51168		FORT FRIEND PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO ROUTE 0500 (SIEGE ROAD)	EASTERN FRONT	YES	PUBLIC	1,420	AS	3
0907	6	1	51191		SUTLER STORE PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO ROUTE 0500 (SIEGE ROAD)	EASTERN FRONT	YES	PUBLIC	5,239	AS	3
0908	6	1	51192		SUTLER STORE OVERFLOW PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO ROUTE 0500 (SIEGE ROAD)	EASTERN FRONT	YES	PUBLIC	11,644	AS	3
0911	6	1	51211		HARRISON CREEK PARKING	ADJACENT TO ROUTE 0500 (SIEGE ROAD)		EASTERN FRONT	YES	PUBLIC	1,382	AS	3
0912	6	1	51212		FORT STEDMAN PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO ROUTE 0500 (SIEGE ROAD)	EASTERN FRONT	YES	PUBLIC	7,247	AS	3
0913	6	1	51213		FORT HASKELL PARKING	ADJACENT TO ROUTE 0500 (SIEGE ROAD)		EASTERN FRONT	YES	PUBLIC	2,102	AS	3
0915	6	1	51215		CRATER & MINE TUNNEL PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO ROUTE 0500 (SIEGE ROAD)	EASTERN FRONT	YES	PUBLIC	6,784	AS	3
0916	6	1	51216		CRATER & MINE TUNNEL BUS PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO PARKING	EASTERN FRONT	YES	PUBLIC	1 <i>,</i> 797	AS	3
0917	6	1	51219		HORSE TRAILER PARKING	FROM ROUTE 0402 (HEADQUARTERS ACCESS ROAD)	TO PARKING	HOME HEADQUARTERS	NO	PUBLIC	10,348	GR	3
0919	6	1	51224		RESOURCE MANAGEMENT PARKING	FROM MAHONE AVENUE	TO PARKING	HOME HEADQUARTERS	NO	NONPUBLIC	18,015	AS	3
0920	6	1	45371		MAHONE PARKING	FROM MAHONE AVENUE	TO MAHONE AVENUE	HOME HEADQUARTERS	YES	PUBLIC	34,269	AS	3

Page 4 of 7

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle

MRL = Manually Rated Line

MRP = Manually Pated Polygon

MRP = Manually Rated Polygon

PKG = Parking Areas NC = Not Collected

PETE

				_	PAR	KING AREA INVENTORY (1300 SERIES FMSS LOCAT	IONS)					
Route	ile lected	Iteration Collected	FMSS	ıcession		escription	Maintenance	FLTP	Access	Area	Surf.		
No.	Š 3̄	를 3	Number	ا ق	Route Name	From To		District	<u> </u>	Level	(SQ FT)	Туре	Мар
0921	6	1	43966	1.	FORT WADSWORTH PARKING	FROM HALIFAX ROAD	TO FLANK ROAD	WESTERN FRONT	YES	PUBLIC	8,309	AS	2
0922	6	1	51225	ı	PUBLIC PARKING	FROM ROUTE 0300AZ (CARRIAGE LANE A)	TO ROUTE 0300AZ (CARRIAGE LANE A)	POPLAR GROVE	YES	PUBLIC	8,841	AS	2
0923	6	1	51239	F	FORT URMSTON PARKING	ADJACENT TO ROUTE 0301 (LONG FLANK ROAD)		WESTERN FRONT	YES	PUBLIC	1,127	AS	2
0924	6	1	51242		FORT CONAHEY PARKING AREA #1	ADJACENT TO ROUTE 0301 (LONG FLANK ROAD) ON RIGHT		WESTERN FRONT	YES	PUBLIC	2,300	AS	2
0925	6	1	51248		FORT CONAHEY PARKING AREA #2	ADJACENT TO ROUTE 0301 (LONG FLANK ROAD) ON LEFT		WESTERN FRONT	YES	PUBLIC	1,694	AS	2
0926	6	1	51249	F	FORT FISHER PARKING	ADJACENT TO ROUTE 0301 (LONG FLANK ROAD)		WESTERN FRONT	YES	PUBLIC	2,056	AS	2
0927	6	1	43968		CONFEDERATE FORT GREGG PARKING	FROM 7TH AVE	TO 7TH AVE	WESTERN FRONT	YES	PUBLIC	8,227	AS	2
0928	6	1	43964		FINAL STAND WAYSIDE PARKING	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO STATE HIGHWAY 613 (WHITE OAK ROAD)	FIVE FORKS	YES	PUBLIC	5,536	AS	1
0929	6	1	43962		ANGLE ATTACK WAYSIDE PARKING	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO STATE HIGHWAY 613 (WHITE OAK ROAD)	FIVE FORKS	YES	PUBLIC	5,356	AS	1
0930	6	1	43961		UNION CAVALRY ATTACK WAYSIDE PARKING	FROM STATE HIGHWAY 627 (COURTHOUSE ROAD)	TO STATE HIGHWAY 627 (COURTHOUSE ROAD)	FIVE FORKS	YES	PUBLIC	6,996	AS	1
0931	6	1	43965		CRAWFORD'S SWEEP WAYSIDE PARKING	FROM STATE HIGHWAY 627 (COURTHOUSE ROAD)	TO STATE HIGHWAY 627 (COURTHOUSE ROAD)	FIVE FORKS	YES	PUBLIC	6,999	AS	1
0933	6	1	51258		PARK HEADQUARTERES PARKING	ADJACENT TO ROUTE 0402 (HEADQUARTERS ACCESS ROAD)		HOME HEADQUARTERS	YES	PUBLIC	2,846	AS	3
0934	6	1	51259	١	RANGER STATION PARKING	ADJACENT TO ROUTE 0403 (RANGER STATION ACCESS ROAD)		HOME HEADQUARTERS	YES	PUBLIC	1,327	AS	3
0935	6	1	114397		VCS ACCESS ROAD & PARKING	FROM STATE HIGHWAY 627 (COURTHOUSE ROAD)	TO PARKING	FIVE FORKS	YES	PUBLIC	39,258	AS	1

Page 5 of 7

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle
MRL = Manually Rated Line
MRP = Manually Rated Polygon

PKG = Parking Areas

NC = Not Collected

PETE

			_	_	PAR	KING AREA INVENTORY (1300 SERIES FMSS LOCATI	ONS)					
Route	le lected	lteration Collected	FMSS	cessio		Route De	scription	Maintenance	FLTP	Access	Area	Surf.	Area
No.	ÿ <u>§</u>	5 S	Number	8	Route Name	From	То	District	균	Level	(SQ FT)	Туре	Мар
0936	6	1	114398		MAINTENANCE AREA ACCESS ROAD & PARKING AREA	FROM ROUTE 0935 (VCS ACCESS ROAD & PARKING)	TO PARKING	FIVE FORKS	YES	PUBLIC	11,697	AS	1
093 <i>7</i>	6	1	116479		OPERATIONS PARKING	FROM INTERSECTION OF ROUTE 0500 (SIEGE ROAD) AND ROUTE 0406 (OPERATIONS SERVICE ROAD)	TO PARKING	EASTERN FRONT	YES	PUBLIC	12,414	AS	3
0938	6	1	228717		FIVE FORKS HIKE/BIKE PARKING	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO PARKING	FIVE FORKS	NO	PUBLIC	12,124	GR	1
0939	6	1	228716		HICKORY HILL HIKE / BIKE PARKING	FROM STATE HIGHWAY 109 (HICKORY HILL ROAD)	TO STATE HIGHWAY 109 (HICKORY HILL ROAD)	HOME HEADQUARTERS	YES	PUBLIC	20,144	AS	3
0940	6	1	115176		MARTIN FIELD HORSE PARKING	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO PARKING	FIVE FORKS	NO	PUBLIC	28,948	GR	1
0945ZZ	6	1	228082		TAYLOR HOUSE SITE PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO ROUTE 0500 (SIEGE ROAD)	EASTERN FRONT	YES	PUBLIC	6,695	AS	3
0946	6	1	238419		WHITE OAK VISITOR PARKING	FROM STATE HIGHWAY 613 (WHITE OAK ROAD)	TO STATE HIGHWAY 613 (WHITE OAK ROAD)	FIVE FORKS	YES	PUBLIC	9,870	AS	1

Page 6 of 7

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle MRL = Manually Rated Line

MRP = Manually Rated Polygon

PKG = Parking Areas NC = Not Collected

Cycle 6 Summary Totals for Petersburg National Battlefield

Cycle 6 Route Totals

	NPS Maintained	Concessionaire Maintained	Park Totals
Paved Roads, Data Collection Vehicle Rated (Miles)	6.58	0	6.58
Paved Roads, Manually Rated Length (Miles)	0.13	0	0.13
Paved Roads, Manually Rated Area (Sq. Ft.)	0	0	0
Unpaved Roads (Miles)	3.29	0	3.29
Paved Parking (Sq. Ft.)	380,804	0	380,804
Unpaved Parking (Sq. Ft.)	54,747	0	54,747

Cycle 6 Lane Miles and Overall Pavement Condition

	Lanes Miles*	Pavement Condition Rating**
Data Collection Vehicle Routes	11.34	92
Manually Rated Roads	0.13	90
Parking Areas	6.56	74

^{*} Equivalent Lane Miles are calculated by route using the following equations:

-Excellent = 97

-Good = 90

-Fair = 73

-Poor = 53, 30, or 0

-Construction / Not Rated = -1

⁻ DCV and MRLs = $(PAVE_WIDTH \times PAVED_MI) / 11$ foot lane

⁻ MRPs and PKGs = $SQ_FEET / 5280 / 11$ foot lane

^{**}Parking and Manually Rated Routes are assigned the following PCR values based on the type of observed distresses:

Page 7 of 7

Cycle 6 NPS / RIP Route ID Report

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Non-NPS Routes

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle

MRL = Manually Rated Line

MRP = Manually Rated Polygon

PKG = Parking Areas

NC = Not Collected

General Park Road Functional Classification (FC) Table

FC	Туре	User Access	Description	Route Numbers
1	Principal Park Road Rural Parkway	Public	Roads which constitute the main access route, circulatory tour, or thoroughfare for park visitors. Rural Parkways (e.g. Natchez Trace) are numbered 0001 - 0009.	0001 - 0009 0010 - 0099
2	Connector Park Road	Public	Roads which provide access within a park to areas of scenic, scientific, recreational or cultural interest, such as overlooks, campgrounds, etc.	0100 - 0199
3	Special Purpose Park Road	Public	Roads which provide circulation within public areas, such as campgrounds, picnic areas, visitor center complexes, concessionaire facilities, etc. These roads generally serve low-speed traffic and are often designed for one-way circulation.	0200 - 0299
4	Primitive Park Road	Public	Roads which provide circulation through remote areas and/or access to primitive campgrounds and undeveloped areas. These roads frequently have no minimum design standards and their use may be limited to specially equipped vehicles. Note: Functional Classes 3 and 4 have the same route numbers because, historically, they were numbered similarly.	0200 - 0299
5	Administrative Park Road	Public	All public roads intended for access to administrative developments or structures such as park offices, employee quarters, or utility areas.	0400 - 0499
6	Administrative Park Road (Restricted Access)	Nonpublic	All roads normally closed to the public, including patrol roads, truck trails, and other similar roads. Note: Functional Classes 5 and 6 have the same route numbers because historically they were numbered similarly and often there is little distinction between these routes. For example, because utility areas and employee housing are often closed to the public, this restriction would result in classification of FC 6 rather than FC 5.	0400 - 0499
7	Urban Parkway	Public	These facilities serve high volumes of park and non-park related traffic and are restricted, limited-access facilities in an urban area. This category of roads primarily encompasses the major parkways which serve as gateways to our nation's capital. Other major park roads or portions thereof, however, may be included in this category.	0001 - 0009
8	City Street	Public	City streets are usually extensions of the adjoining street system that are owned and maintained by the National Park Service. The construction and/or reconstruction should conform with accepted local engineering practice and local conditions.	0600 - 0699
N/A	Non-NPS Roads	Public	State, County, or City owned roads which border, traverse, or provide access to Park Facilities or Locations. Non-NPS roads are not assigned functional classes and are driven for GPS and Video Log only.	5000 - 5999

Types
S - Asphaltic Concrete Pavement
R - Brick or Pavers Road Bed
B - Cobble Stone Road Bed
O - Portland Cement Concrete Pavemen

Surface

NV - Native or Dirt Material Road Bed

OT - Other Materials Road Bed

GR - Gravel Road Bed

A park road system contains those roads within or giving access to a park or other unit of the NPS which are administered by the NPS, or by the Service in cooperation with other agencies. The assignment of a functional classification (FC) to a park road is not based on traffic volumes or design speed, but on the intended use or function of that road or route.

The historic route numbering system also included a 300 series for interpretive roads, and a 500 series for one-way roads. There are approximately 250 roads nationwide which are designated by the 300 and 500 series. The numbers for these roads will be maintained for reporting consistency. However, since these interpretive and one-way routes are not as clearly tied to a specific functional class, the 300 and 500 series will be discontinued for future use.

Page 1 of 2

NPS / RIP Subcomponent Details for PETE

Report Date: 10/07/2021 (Numerical By Summary Route and Subcomponent #)



Shading Color Key

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Paved Routes, Non-NPS

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle
MRL = Manually Rated Line

 $\mathsf{MRP} = \mathsf{Manually} \; \mathsf{Rated} \; \mathsf{Polygon}$

PKG = Parking Areas NC = Not Collected

				_	SUMMARY ROUTE IN	IVENTORY FOR ROADS (110	00 SERIES FMSS LOCATION	IS)				<u> </u>	
Route	FMSS	le ected	rtion ected	cession		Route Des	scription		Paved	Unpaved		ctionc	Area
Numbe	r Number	Š	C le	S	Route Name	From	То	臣	Miles	Miles	Mileage	2 g	(SQ FT)
0300ZZ	22766	6	1		CARRIAGE LANES	FROM VAUGHAN ROAD	TO END OF LOOP	YES	0.33	0.00	0.33	2	

				SUMMARY ROUTE	INVENTORY FOR PA	RKING AREAS (1300 SERIES FMSS LO	OCATIONS)		
Route	FMSS	le lected	lected .			Route Description		User	Area
Number	Number	Š 🖥 .	College	Route Name	From	То	FLTE	Access	(SQ FT)
0945ZZ	228082	6	1	TAYLOR HOUSE SITE PARKING	FROM ROUTE 0500 (SIE	GE ROAD) TO ROUTE 0500 (SIEGE	ROAD) YES	PUBLIC	6,695

	PETE-O	300ZZ	Sub	con	ıpo	nent Breakdown							-	
ı	Route	FMSS	:le lected	ation lected	ncessio		Route Des	cription	. م			avea rolar o s		Area
Ļ	Number	Number	٥٥	를 S	õ	Route Name	From	То	<u> </u>	Miles	Miles	Mileage	⊋ី	(SQ FT)
	0300AZ	22766	6	1		CARRIAGE LANE A	FROM VAUGHAN ROAD	TO ROUTE 0300BZ (CARRIAGE LANE B)	YES	0.20	0.00	0.20	2	
	0300BZ	22766	6	1		CARRIAGE LANE B	FROM ROUTE 0300AZ (CARRIAGE LANE A)	TO END OF LOOP	YES	0.13	0.00	0.13	2	

Page 2 of 2

NPS / RIP Subcomponent Details for PETE

(Numerical By Summary Route and Subcomponent #)



Shading Color Key

Report Date: 10/07/2021

White = Paved Routes, DCV Driven

Grey = Paved Routes, DCV not Driven

Black = Paved Routes, Non-NPS

= Concession Route

Yellow = Unpaved Routes, DCV not Driven

Blue = Paved Parking Areas

Green = Unpaved Parking Areas

DCV = Data Collection Vehicle
MRL = Manually Rated Line
MRP = Manually Rated Polygon

PKG = Parking Areas

NC = Not Collected

PETE

PETE-O	945ZZ	Sub	com	ιpo	nent Breakdown					
Route	FMSS		ation lected	cessio		Route Descr	iption		User	Area
Number	Number	δ̈́δ	5 S	S	Route Name	From	То	Ē	Access	(SQ FT)
0945AZ	228082	6	1		TAYLOR HOUSE SITE MAIN PARKING	FROM ROUTE 0500 (SIEGE ROAD)	TO ROUTE 0500 (SIEGE ROAD)	YES	PUBLIC	4,711
0945BZ	228082	6	1		TAYLOR HOUSE SITE BUS PARKING	ADJACENT TO ROUTE 0500 (SIEGE ROAD)		YES	PUBLIC	1,984

Route Identification Changes to Routes from Previous Cycle Petersburg National Battlefield

	ROUTES REMOVED FROM PREVIOUS INVENTORY:												
Route No.	Route Name	Type of Change	Comments										
0404	QUARTERS #34 ACCESS ROAD	OTHER	ROUTE REMOVED DURING CYCLE 6 VIA MAINTENANCE MANAGER BECAUSE IT IS A DRIVEWAY.										
0410	NALDARA ENTRANCE DRIVE	OTHER	ROUTE REMOVED DURING CYCLE 6 VIA MAINTENANCE MANAGER BECAUSE IT IS A DRIVEWAY.										
0941	MASSACHUSETTS MONUMENT PARKING	OTHER	ROUTE REMOVED DURING ROUTE ID MEETING BECAUSE IT IS A PULLOUT.										

	ROUTES ADDED FROM PREVIOUS INVENTORY:										
Route No.	Route Name	Type of Change	Comments								
0300ZZ	CARRIAGE LANES	OTHER	ROUTE SPLIT INTO SUBCOMPONENTS DUE TO NARROW GATE THAT THE DCV WAS UNABLE TO DRIVE THROUGH. ROUTE NAME CHANGED FROM "POPLAR GROVE CEMETERY ROAD" TO "CARRIAGE LANE".								

	ROUTES MODIFIED FROM PREVIOUS INVENTORY:												
Route No.	Route Name	Type of Change	Comments										
0010	VA 36 EAST TO VISITOR CENTER	ROUTE NAME	ROUTE NAME CHANGED FROM "VISITOR CENTER ACCESS ROAD" TO "VA 36 EAST TO VISITOR CENTER".										
0012	VA 36 WEST ON RAMP	ROUTE NAME	ROUTE NAME CHANGED FROM "STATE ROUTE 36 ACCESS ROAD" TO "VA 36 WEST ON RAMP".										
0013	VA 36 WEST OFF RAMP	ROUTE NAME	ROUTE NAME CHANGED FROM "ROUTE 0010 ACCESS ROAD" TO "VA 36 WEST OFF RAMP".										
0202	BEACH ACCESS ROAD	FUNCTIONAL CLASS CHANGE	FUNCTIONAL CLASS CHANGED FROM 3 TO 6 (NON PUBLIC).										
0301	LONG FLANK ROAD	ROUTE NAME	ROUTE NAME CHANGED FROM "FLANK ROAD" TO "LONG FLANK ROAD".										
0403	RANGER STATION ACCESS ROAD	ROUTE NAME	ROUTE NAME CHANGED FROM "RANGER ACCESS ROAD" TO "RANGER STATION ACCESS ROAD".										
0406	OPERATIONS SERVICE ROAD	ROUTE NAME	ROUTE NAME CHANGED FROM "SERVICE ROAD" TO "OPERATIONS SERVICE ROAD".										
0408	RANGER STATION TO HQ SHORTCUT	ROUTE NAME	ROUTE NAME CHANGED FROM "RANGER ACCESS TO HEADQUARTERS ROAD" TO "RANGER STATION TO HQ SHORTCUT".										

Route Identification Changes to Routes from Previous Cycle Petersburg National Battlefield

	ROUTES MODIFIED FROM PREVIOUS INVENTORY:											
Route No.	Route Name	Type of Change	Comments									
0500	SIEGE ROAD	ROUTE NAME	ROUTE NAME CHANGED FROM "PETERSBURG TOUR ROAD" TO "SIEGE ROAD".									
0900	GRANT'S HEADQUARTERS VISITOR PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "MAIN VISITOR PARKING" TO "GRANT'S HEADQUARTERS VISITOR PARKING".									
0901	WATER STREET RECREATIONAL PARKING #1	ROUTE NAME	ROUTE NAME CHANGED FROM "WATER STREET 1 PARKING" TO "WATER STREET RECREATIONAL PARKING AREA #1".									
0902	WATER STREET RECREATIONAL PARKING #2	ROUTE NAME	ROUTE NAME CHANGED FROM "WATER STREET 2 PARKING" TO "WATER STREET RECREATIONAL PARKING AREA #2".									
0903	CARRIAGE HOUSE PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "MANOR HOUSE PARKING" TO "CARRIAGE HOUSE PARKING".									
0905	MAINTENANCE AREA ACCESS ROAD & PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "MAINTENANCE AREA PARKING" TO "MAINTENANCE AREA ACCESS ROAD & PARKING".									
0906	FORT FRIEND PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "FORT FREN PARKING" TO "FORT FRIEND PARKING PULLOFF".									
0907	SUTLER STORE PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "SUTLERS STORE PARKING" TO "SUTLER STORE PARKING".									
0908	SUTLER STORE OVERFLOW PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "SUTLERS STORE OVERFLOW PARKING" TO "SUTLER STORE OVERFLOW PARKING".									
0911	HARRISON CREEK PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "HARRISONS CREEK PARKING" TO "HARRISON CREEK PARKING".									
0915	CRATER & MINE TUNNEL PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "CRATER PARKING" TO "CRATER & MINE TUNNEL PARKING".									
0917	HORSE TRAILER PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "HORSE PARKING" TO "HORSE TRAILER PARKING".									
0922	PUBLIC PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "POPLAR GROVE CEMETERY PARKING" TO " PUBLIC PARKING".									
0924	FORT CONAHEY PARKING AREA #1	ROUTE NAME	ROUTE NAME CHANGED FROM "FORT CONAHEY 1 PARKING" TO "FORT CONAHEY PARKING AREA #1".									
0925	FORT CONAHEY PARKING AREA #2	ROUTE NAME	ROUTE NAME CHANGED FROM "FORT CONAHEY 2 PARKING" TO "FORT CONAHEY PARKING AREA #2".									

Route Identification Changes to Routes from Previous Cycle Petersburg National Battlefield

	ROUTES MODIFIED FROM PREVIOUS INVENTORY:												
Route No.	Route Name	Type of Change	Comments										
0928	FINAL STAND WAYSIDE PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "A FINAL STAND PARKING" TO "FINAL STAND WAYSIDE PARKING".										
0929	ANGLE ATTACK WAYSIDE PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "ATTACK ON THE ANGLE PARKING" TO "ANGLE ATTACK WAYSIDE PARKING".										
0935	VCS ACCESS ROAD & PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "FIVE FORKS VCS ACCESS ROAD AND PARKING AREA" TO "VCS ACCESS ROAD & PARKING".										
0936	MAINTENANCE AREA ACCESS ROAD & PARKING AREA	ROUTE NAME	ROUTE NAME CHANGED FROM "FIVE FORKS MAINTENANCE AREA ACCESS ROAD AND PARKING AREA" TO "MAINTENANCE AREA ACCESS ROAD & PARKING".										
0945ZZ	TAYLOR HOUSE SITE PARKING	ROUTE NAME	ROUTE NAME CHANGED FROM "TAYLOR HOUSE SITE PARKING PULLOFF" TO "TAYLOR HOUSE SITE PARKING".										

Section 3 Park Summary Information





Parkwide Paved Route Condition Summary Petersburg National Battlefield

Table 1: Paved Route Miles and Parking Area Square Footages by Access Level and PCR


Breakdown of Pavement Condition Rating (PCR) Based on Access Level

	POOR (PCR of 0 - 60)	FAIR (PCR of 61 - 84)	GOOD (PCR of 85 - 94)	EXCELLENT (PCR of 95 -100)	
		PAVED	ROADS		
Functional Class	Length (miles)	Length (miles)	Length (miles)	Length (miles)	Total Mileage by FC
1	0.35	0.44	0.67	2.90	4.36
2			0.21	0.12	0.33
3	0.02	0.10	0.36	0.42	0.90
4					
5			0.04	0.62	0.66
6		0.01		0.12	0.13
7					
8					
Total Mileage by PCR	0.37	0.54	1.28	4.18	6.37
		PAVED P	ARKING		
Access Level	Area (sq. ft.)	Area (sq. ft.)	Area (sq. ft.)	Area (sq. ft.)	Total Area
PUBLIC	122,351	68,853	170,203		361,407
NONPUBLIC			18,015		18,015
Total Area by PCR	122,351	68,853	188,218	0	379,422

NOTES:

- 1. Data are reported in the table only for paved roads and parking lots that received a condition rating.
- 2. Non-linear roads (MRP collected routes) are measured by area and converted to equivalent route miles based on a 22-ft pavement width in order to be included in the mileage totals for paved roads shown above.
- 3. Quantities in the table above are derived from the route condition data within the PMS_20, PMS_MRL, PMS_MRP, and PMS_PKG tables in the Park geodatabase.

Parkwide Condition Percentages

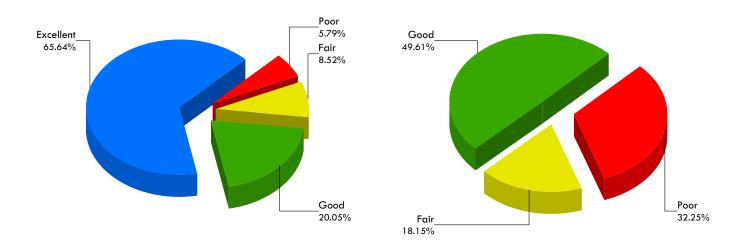

Road Condition Percentages

Parking Area Condition Percentages

Figure 1: Pavement Condition Rating Breakdown for Paved Roads and Parking Areas

Explanation of the Excellent, Good, Fair, and Poor Condition Descriptions

The Road Inventory Program aims to provide assistance in translating the excellent / good / fair / poor rating categories into pavement needs categories. The PCR can be used to indicate the place in the Pavement Life Cycle and the type of treatments that should be considered now and into the future.

- Excellent / New: PCR of 95-100
 - o Pavements in this range will require only spot repairs
- Good: PCR of 85-94
 - o Pavements in this range will likely be candidates for Preventive Maintenance. Examples include Chip and Slurry Seals, Micro Surfacing and Thin Overlays.
- Fair: PCR of 61-84
 - o Pavements in this range will likely be candidates of Light Rehabilitation (L3R). Examples include singlelift overlays up to 2.5 inches in total thickness, milling and overlays.
- Poor: PCR of 0-60
 - o Pavements in this range will likely be candidates of Heavy Rehabilitation or Reconstruction (H3R or 4R). Examples include Pulverization, Multiple Lift Overlays, and Reconstruction.

CONDITION CATEGORIES AND TREATMENTS EXCELLENT / Localized Repairs Only GOOD / Preventive Maintenance FAIR / Light Rehabilitation POOR / Heavy Rehabilitation Reconstruction Pavement Age

At this time, specific Maintenance and Rehabilitation activities should be evaluated and recommended at the project level. Site-specific conditions that influence treatment type should be determined based on performing a subsurface investigation and/or pavement condition survey, and not be based solely on RIP data. Additionally, RIP produces a snapshot of conditions at the time in which the data were collected. For further information or to obtain additional Pavement Management System's data from our Highway Pavement Management Application (HPMA) please contact the Eastern Federal Lands pavement team.



Road Condition Summary Report for Data Collection Vehicle (DCV) Rated Roads

Petersburg National Battlefield

Condition (Rating / Index) Legend

EXCELLENT (95 - 100)

GOOD (85 - 94) FAIR (61 - 84)

POOR (0 - 60)

NR = NOT RATED

Notes:

- This condition summary report contains only the roads rated with the Data Collection Vehicle (DCV).
- Condition on roads that were manually rated and parking areas are shown in separate reports.
- Route-level scores shown on this page may not represent scores at smaller intervals (due to rollup calculations).
- Additional details on individual road ratings at 0.10-mile and 1-mile intervals can be found in Section 5 of the Cycle 6 RIP Report.
- Refer to the RIP Report Appendix for an explanation of the rating system and rating methods.

Route No.	Route-	Level Condition for Roads Rated with the Data Col	ection Vehicle (DCV) Functiona Class	l Surf. Type	Paved Length (Miles)	Pavement Condition Rating (PCR)	Roughness Condition Index (RCI)	Surface Condition Rating (SCR)	Structural Crack Index	Alligator Crack Index	Longitudinal Cracking Index	Transverse Cracking Index	Patch / Pothole Index	Rutting Index
PETE-0010	22942	VA 36 EAST TO VISITOR CENTER	1	AS	0.39	80	NR	80	80	100	80	80	95	99
PETE-0011	231698	SHORT FLANK ROAD	1	AS	0.29	44	NR	44	90	100	90	44	99	99
PETE-0012	46005	VA 36 WEST ON RAMP	1	AS	0.16	93	NR	93	93	100	93	93	100	100
PETE-0013	46006	VA 36 WEST OFF RAMP	1	AS	0.09	91	NR	91	94	100	94	91	100	99
PETE-0300AZ	22766	CARRIAGE LANE A	2	AS	0.20	96	NR	96	98	100	98	96	100	99
PETE-0301	23019	LONG FLANK ROAD	3	AS	0.90	91	81	98	99	100	99	98	100	100
PETE-0402	45375	HEADQUARTERS ACCESS ROAD	5	AS	0.49	98	NR	98	99	100	99	100	100	98
PETE-0403	45850	RANGER STATION ACCESS ROAD	5	AS	0.11	99	NR	99	100	100	100	100	100	99
PETE-0406	22993	OPERATIONS SERVICE ROAD	6	AS	0.33	NR	NR	NR	NR	NR	NR	NR	NR	NR
PETE-0408	51263	RANGER STATION TO HQ SHORTCUT	5	AS	0.05	99	NR	99	100	100	100	100	100	99
PETE-0411	45878	QUARTERS #29 ACCESS ROAD	6	AS	0.13	96	NR	96	100	100	100	100	100	96
PETE-0500	22461	SIEGE ROAD	1	AS	3.43	98	97	98	98	100	98	98	100	99

Data Collection Date: 12/2020



Road Condition Summary Report for Manually Rated Roads

Condition (Rating / Index) Legend							
EXCELLENT (95 - 100)							
GOOD (85 - 94)							
FAIR (61 - 84)							
POOR (0 - 60)							
ND - NOT DATED							

Petersburg National Battlefield

Notes:

- This condition summary report contains only the roads that were manually rated.
 - o MRL: Manually Rated Line (a linear road)
 - o MRP: Manually Rated Polygon (a non-linear road)
- Condition on roads that were rated with the Data Collection Vehicle (DCV) are shown in a separate report.
- A road is manually rated when it is determined to be unsuitable for the DCV to drive.
- Additional details on individual road ratings at 0.10-mile and 1-mile intervals can be found in Section 5 of the Cycle 6 RIP Report.
- Refer to the RIP Report Appendix for an explanation of the rating system and rating methods.

Route No.	FMSS No.	Route-Level Condition for Manually Rate	Functiona Class	l Surf. Type	Paved Length (Miles)	Pavement Condition Rating (PCR)	Roughness Condition Index (RCI)	Surface Condition Rating (SCR)	Structural Crack Index	tor Crack I	Longitudinal Cracking Index	Fransverse Cracking Index	Patch / Pothole Index	Rutting Index
				, i · ·	(Miles)	- 4	<u> </u>	S IF	S	1				<u></u>
PETE-0300BZ	22766	CARRIAGE LANE B	2	AS	0.13	90	NR	90	NR	97	90	90	97	97

Data Collection Date: 08/2020



Parking Area Condition Summary Report

EXCELLENT (97) GOOD (90) FAIR (73) POOR* (0, 30, 53) NR = NOT RATED

Condition (Rating / Index) Legend

Petersburg National Battlefield

Notes:

- A PCR of 0 indicates a paved parking area in very poor condition. Individual distresses could not be identified.
- Additional details on individual parking areas can be found in Section 6 of the Cycle 6 RIP Report.
- Refer to the RIP Report Appendix for an explanation of the rating system and rating methods.

							<u>Asphalt Surface Distresses</u>			<u>es</u>	Concrete Surface Distresses						
Route No.	FMSS No.	Condition Rating Details for Paved Parking Areas Route Name	User Access	Surf. Type	Area (Sq. Ft.)	Pavement Condition Rating (PCR)	Alligator Cracking	Longitudinal / Tranverse Cracking	Rutting / Distortions	Potholes / Patching	HMA Patching	Surface Raveling / Bleeding	Joint Faulting	Slab Cracking	Joint Distresses	Delamination / Pop-Outs	Potholes / Patching
PETE-0900	24557	GRANT'S HEADQUARTERS VISITOR PARKING	PUBLIC	AS	23,750	30	30	53	97	97	97	73					
PETE-0901	24532	WATER STREET RECREATIONAL PARKING #1	PUBLIC	AS	9,106	53	73	53	97	97	97	73					
PETE-0902	46014	WATER STREET RECREATIONAL PARKING #2	PUBLIC	AS	6,137	73	90	90	90	97	97	73					
PETE-0904	51262	VISITOR CENTER PARKING	PUBLIC	AS	42,542	90	90	90	97	97	90	90					
PETE-0905	45869	MAINTENANCE AREA ACCESS ROAD & PARKING	PUBLIC	AS	47 , 678	90	97	90	90	97	97	90					
PETE-0906	51168	FORT FRIEND PARKING	PUBLIC	AS	1,420	90	90	90	97	97	97	97					
PETE-0907	51191	SUTLER STORE PARKING	PUBLIC	AS	5,239	90	90	90	97	97	97	90					
PETE-0908	51192	SUTLER STORE OVERFLOW PARKING	PUBLIC	AS	11,644	73	73	90	97	97	97	90					
PETE-0911	51211	HARRISON CREEK PARKING	PUBLIC	AS	1,382	NR											
PETE-0912	51212	FORT STEDMAN PARKING	PUBLIC	AS	7,247	90	90	90	97	97	97	90					
PETE-0913	51213	FORT HASKELL PARKING	PUBLIC	AS	2,102	53	53	90	97	97	97	90					
PETE-0915	51215	CRATER & MINE TUNNEL PARKING	PUBLIC	AS	6,784	53	90	53	97	97	97	73					
PETE-0916	51216	CRATER & MINE TUNNEL BUS PARKING	PUBLIC	AS	1,797	53	90	53	97	97	97	73					
PETE-0919	51224	RESOURCE MANAGEMENT PARKING	NONPUBLIC	: AS	18,015	90	90	97	97	97	97	90					
PETE-0920	45371	MAHONE PARKING	PUBLIC	AS	34,269	90	90	90	90	97	97	90					
PETE-0921	43966	FORT WADSWORTH PARKING	PUBLIC	AS	8,309	73	73	90	97	97	97	90					
PETE-0922	51225	PUBLIC PARKING	PUBLIC	AS	8,841	73	73	90	97	97	97	90					
PETE-0923	51239	FORT URMSTON PARKING	PUBLIC	AS	1,127	90	90	90	97	97	97	90					
PETE-0924	51242	FORT CONAHEY PARKING AREA #1	PUBLIC	AS	2,300	90	97	97	97	97	97	90					
PETE-0925	51248	FORT CONAHEY PARKING AREA #2	PUBLIC	AS	1,694	90	97	97	97	97	97	90					
PETE-0926	51249	FORT FISHER PARKING	PUBLIC	AS	2,056	90	90	97	90	97	97	90					
PETE-0927	43968	CONFEDERATE FORT GREGG PARKING	PUBLIC	AS	8,227	90	90	97	97	97	97	90					
PETE-0928	43964	FINAL STAND WAYSIDE PARKING	PUBLIC	AS	5,536	90	90	90	97	97	97	90					
PETE-0929	43962	ANGLE ATTACK WAYSIDE PARKING	PUBLIC	AS	5,356	73	73	97	97	97	97	90					
PETE-0930	43961	UNION CAVALRY ATTACK WAYSIDE PARKING	PUBLIC	AS	6,996	53	53	90	97	97	97	90					
PETE-0931	43965	CRAWFORD'S SWEEP WAYSIDE PARKING	PUBLIC	AS	6,999	73	73	90	97	97	97	90					

Data Collection Date: 08/2020



Parking Area Condition Summary Report

GOOD (90) FAIR (73) POOR* (0, 30, 53)

NR = NOT RATED

Condition (Rating / Index) Legend

Petersburg National Battlefield

Notes:

- A PCR of 0 indicates a paved parking area in very poor condition. Individual distresses could not be identified.
- Additional details on individual parking areas can be found in Section 6 of the Cycle 6 RIP Report.
- Refer to the RIP Report Appendix for an explanation of the rating system and rating methods.

							Asphalt Surface Distresses				Concrete Surface Distresses						
Route No.	FMSS No.	Condition Rating Details for Paved Parking Areas Route Name	User Access	Surf. Type	Area (Sq. Ft.)	Pavement Condition Rating (PCR)	Alligator Cracking	Longitudinal / Tranverse Cracking	Rutting / Distortions	Potholes / Patching	HMA Patching	Surface Raveling / Bleeding	Joint Faulting	Slab Cracking	Joint Distresses	Delamination / Pop-Outs	Potholes / Patching
PETE-0933	51258	PARK HEADQUARTERES PARKING	PUBLIC	AS	2,846	90	90	90	97	97	97	90					
PETE-0934	51259	RANGER STATION PARKING	PUBLIC	AS	1,327	90	90	90	97	97	97	90					
PETE-0935	114397	VCS ACCESS ROAD & PARKING	PUBLIC	AS	39,258	53	73	53	97	90	97	90					
PETE-0936	114398	MAINTENANCE AREA ACCESS ROAD & PARKING AREA	PUBLIC	AS	11,697	73	73	90	97	97	97	90					
PETE-0937	116479	OPERATIONS PARKING	PUBLIC	AS	12,414	53	73	53	90	97	97	90					
PETE-0939	228716	HICKORY HILL HIKE / BIKE PARKING	PUBLIC	AS	20,144	53	53	90	97	97	97	90					
PETE-0945AZ	228082	TAYLOR HOUSE SITE MAIN PARKING	PUBLIC	AS	4,7 11	90	90	90	97	97	97	90					
PETE-0945BZ	228082	TAYLOR HOUSE SITE BUS PARKING	PUBLIC	AS	1,984	90	90	97	97	97	97	90					
PETE-0946	238419	WHITE OAK VISITOR PARKING	PUBLIC	AS	9,870	73	90	90	97	97	97	73					


Data Collection Date: 08/2020

Section 4 Park Route Location Maps






ROUTE LOCATION MAP Key Map

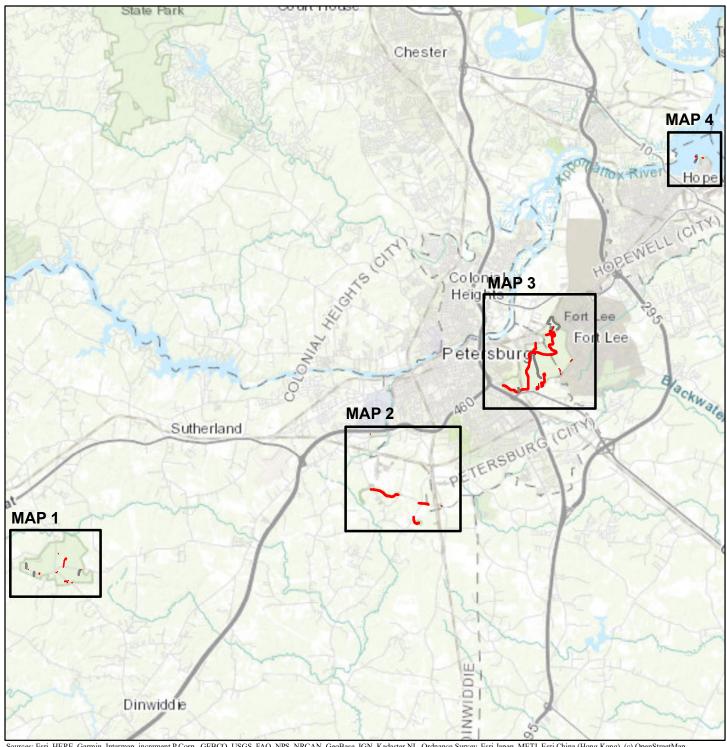

Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community


NPS Collected Routes






Petersburg National Battlefield ROUTE LOCATION MAP

MAP 1

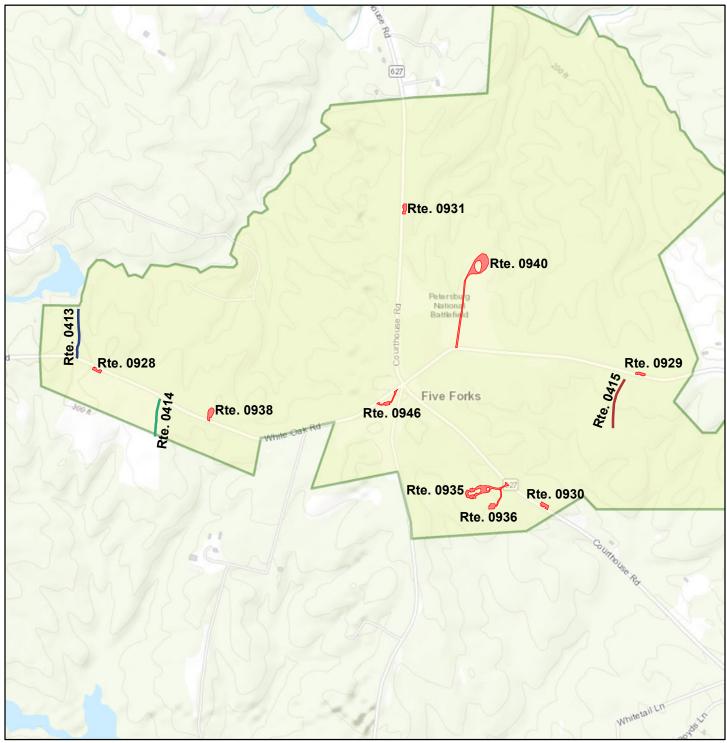


Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community







ROUTE LOCATION MAP MAP 2

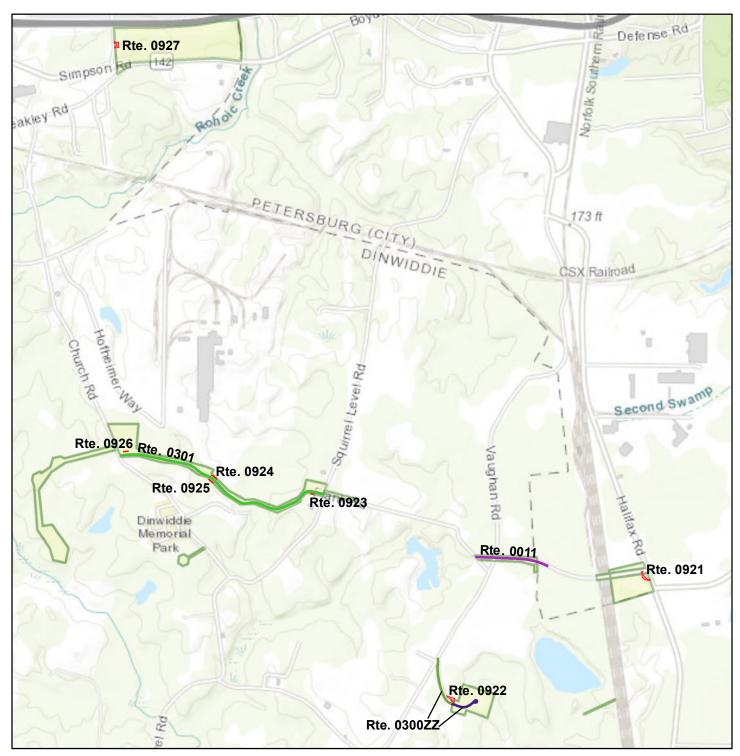


Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community



ROUTE LOCATION MAP MAP 3

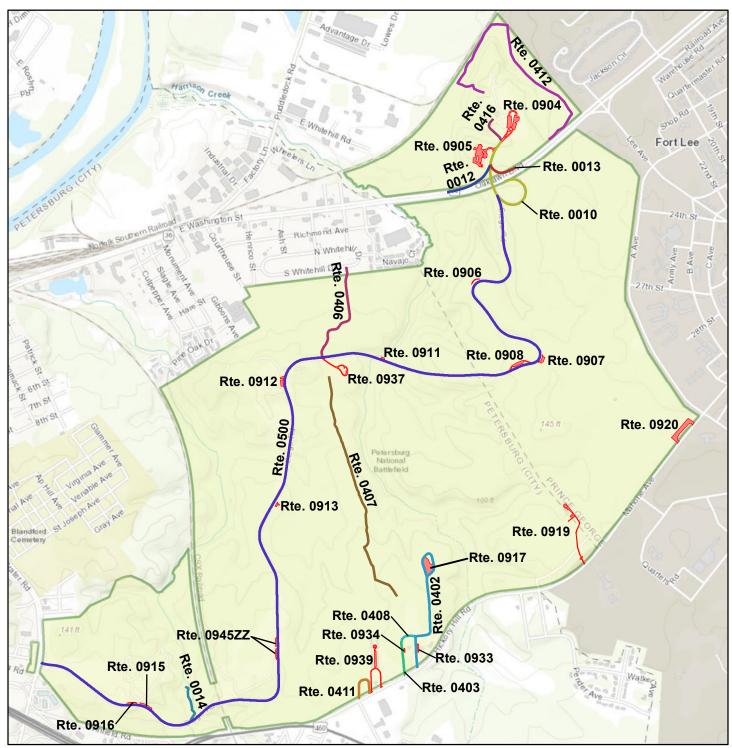

Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community






Petersburg National Battlefield ROUTE LOCATION MAP

MAP 4




Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community





ROUTE CONDITION MAP PCR - MILE BY MILE Key Map

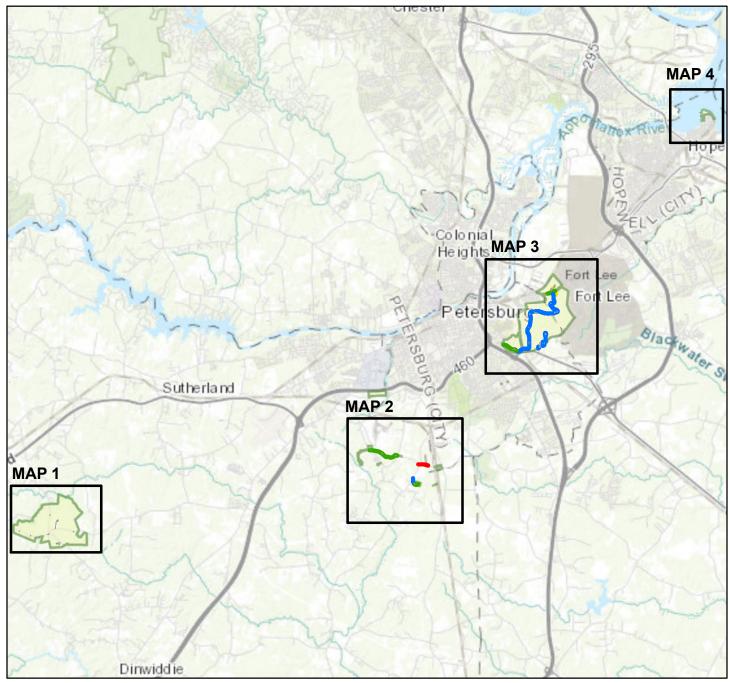

Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community


Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)
Fair (61- 84)
Colors on map represent condition scores at 1-mile intervals. See Appendix for definitions and formulas
Only Data Collection Vehicle and Manually Rated Roads are displayed


Miles 0 5.5 11



ROUTE CONDITION MAP PCR - MILE BY MILE Area Map 1

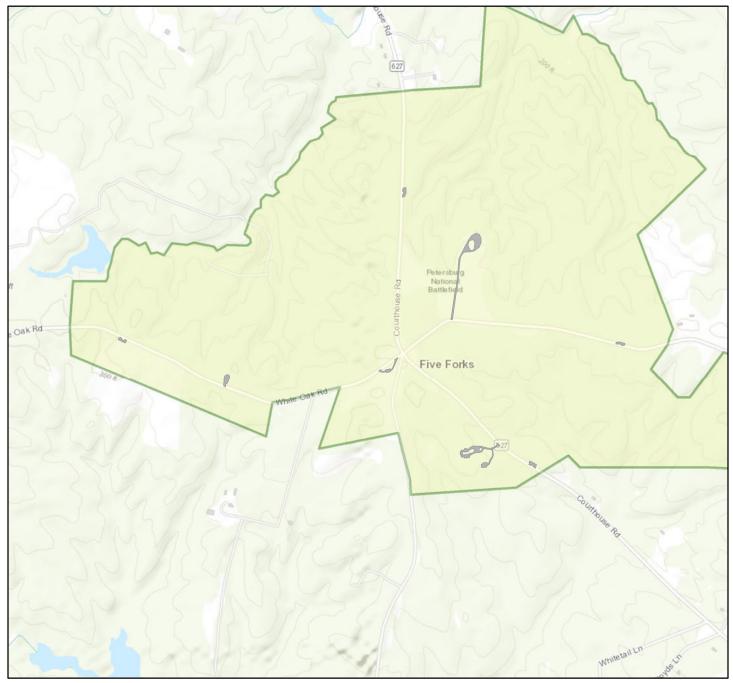


Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community




	Mi	les	
0	0.	75	1.5



ROUTE CONDITION MAP PCR - MILE BY MILE Area Map 2

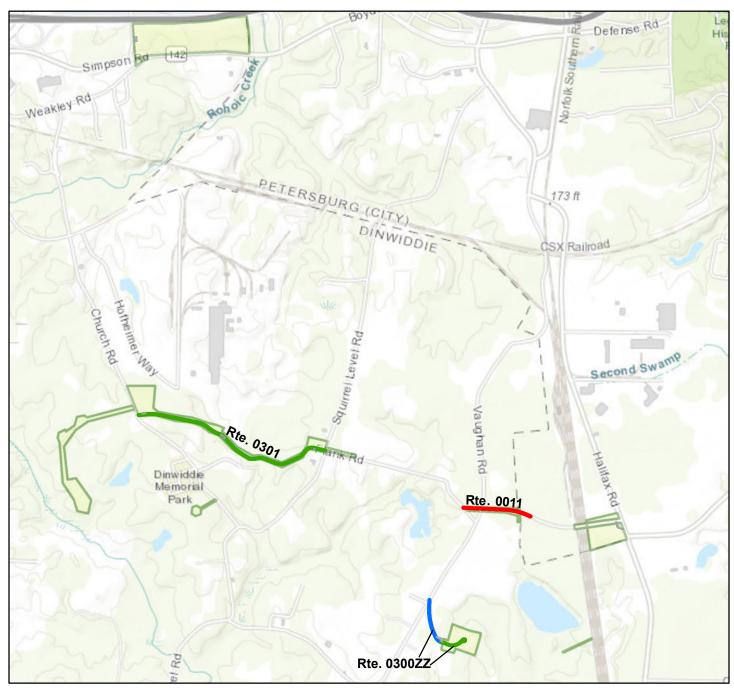


Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community




	Miles	
0	1	2



ROUTE CONDITION MAP PCR - MILE BY MILE Area Map 3

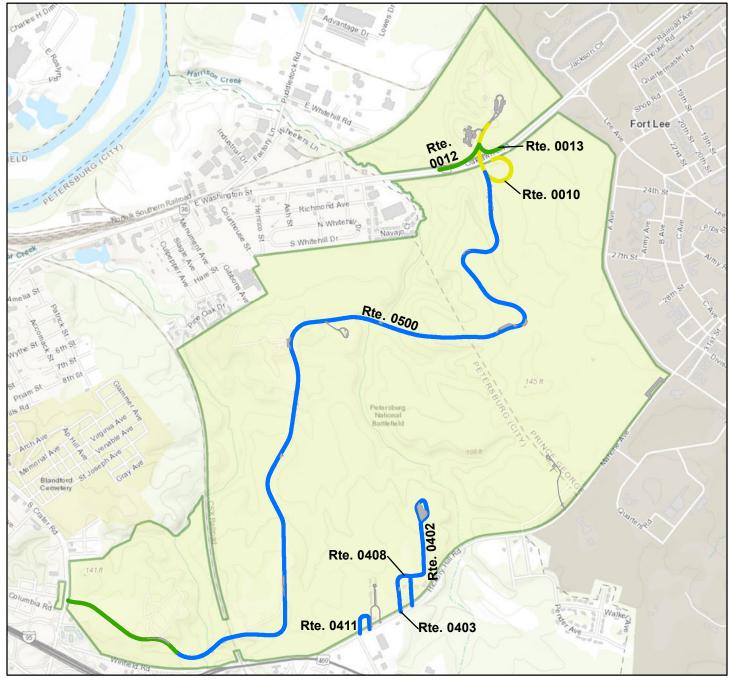


Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community




Miles 0 0.85 1.7



ROUTE CONDITION MAP PCR - MILE BY MILE Area Map 4

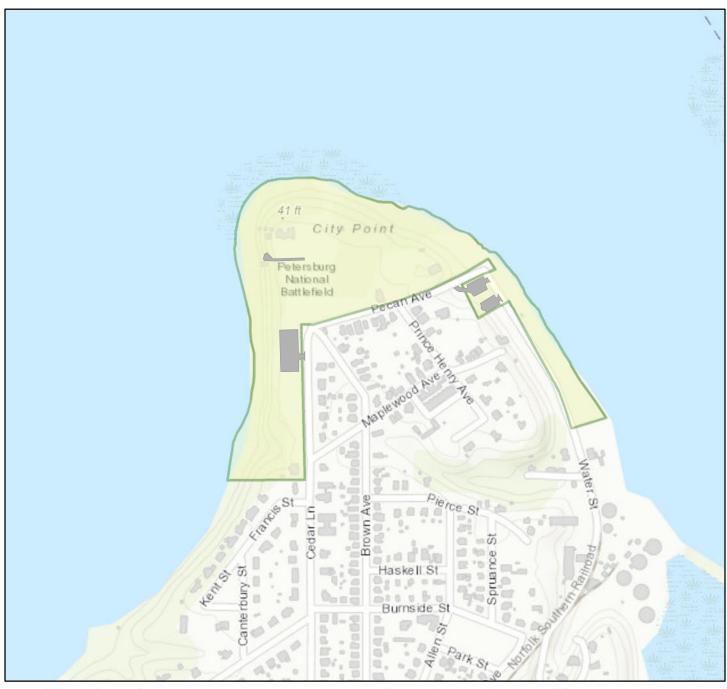

Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap contributors, and the GIS User Community



	Miles	
0	0.25	0.5

Section 5 Paved Road Condition Rating Sheets




Petersburg National Battlefield



ROUTE 0010: VA 36 EAST TO VISITOR CENTER


Data Collection Vehicle (DCV) Rating

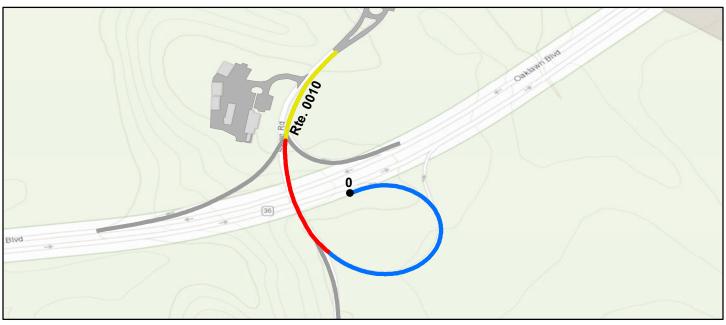

	Route (Condition Legend – Pav	ement Condi	ition Rating (PCR)		
Poor (0 - 60			(85 - 94)	Excellent (Not Ra	ted
Colors	on map represent con-	dition scores at 0.10-mile	S	e Appendix fo	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Mile	s): 0.39	Section Length (MI)	0.39				
Surface Type:	ASPHALT	Route Summary		!		!	
Roadway Condition	Information						
Pavement Condition	n Rating (PCR)	80	80				
Surface Condition Ra	ating (SCR)	80	80				
Roughness Condition	n Index (RCI)	N/A	N/A				
Distress Index Value	es						
Structural Crack Inc	dex	80	80				
Alligator Crack Ind	ex	100	100				
Longitudinal Crack	Index	80	80				
Transverse Cracking	g Index	80	80				
Patching Index		95	95				
Rutting Index		99	99				
International Rough	nness Index (IRI)	N/A	N/A				
Lane & Width Infor	rmation						
Number of Lanes		2	2				
Paved Width (ft)		33.4	33.4				
Lane Width (ft)		16.7	16.7				

ROUTE 0011: SHORT FLANK ROAD


Data Collection Vehicle (DCV) Rating

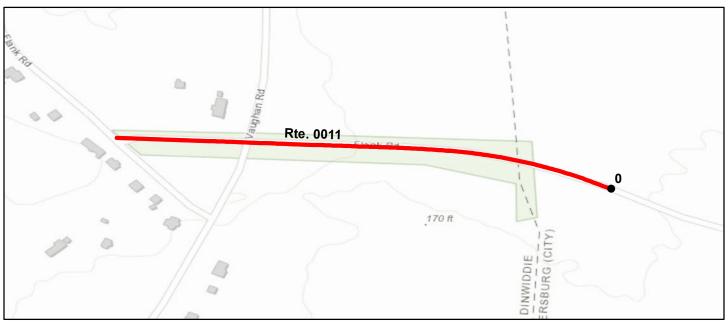

	Doute (Condition Legend – Pav	omant Candi	tion Doting (DCD)		
Poor (0 - 60)	Fair (6		(85 - 94)	Excellent (Not Ra	tod
	•	*	× /	,	5		ieu
	map represent con-	dition scores at 0.10-mile	intervals. Se	e Appendix fo	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Miles):	0.29	Section Length (MI)	0.29				
Surface Type:	ASPHALT	Route Summary					
Roadway Condition In	formation						
Pavement Condition R	ating (PCR)	44	44				
Surface Condition Ratin	ng (SCR)	44	44				
Roughness Condition Ir	ndex (RCI)	N/A	N/A				
Distress Index Values							
Structural Crack Index		90	90				
Alligator Crack Index		100	100				
Longitudinal Crack Inc	dex	90	90				
Transverse Cracking In	ndex	44	44				
Patching Index		99	99				
Rutting Index		99	99				
International Roughne	ss Index (IRI)	N/A	N/A				
Lane & Width Informa	ation						
Number of Lanes		2	2				
Paved Width (ft)		20.5	20.5				
Lane Width (ft)		9.3	9.3				

Petersburg National Battlefield ROUTE 0012: VA 36 WEST ON RAMP


Data Collection Vehicle (DCV) Rating

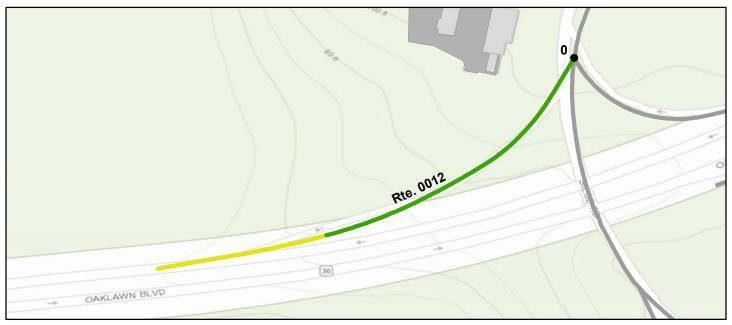

	Pouto (Condition Legend – Pav	amant Candi	ition Poting (PCD)		
Poor (0 - 60)	Fair (6		(85 - 94)	Excellent (Not Ra	ted
` ` `	•	dition scores at 0.10-mile	× /	*	5		icu
				e Appendix id	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Miles)	: 0.16	Section Length (MI)	0.16				
Surface Type:	ASPHALT	Route Summary				-	
Roadway Condition I	nformation						
Pavement Condition	Rating (PCR)	93	93				
Surface Condition Rat	ing (SCR)	93	93				
Roughness Condition	Index (RCI)	N/A	N/A				
Distress Index Values							
Structural Crack Inde	ex	93	93				
Alligator Crack Index	K	100	100				
Longitudinal Crack In	ndex	93	93				
Transverse Cracking	Index	93	93				
Patching Index		100	100				
Rutting Index		100	100				
International Roughn	ess Index (IRI)	N/A	N/A				
Lane & Width Inforn	nation						
Number of Lanes		1	1				
Paved Width (ft)		13.5	13.5				
Lane Width (ft)		13.5	13.5				

Petersburg National Battlefield ROUTE 0013: VA 36 WEST OFF RAMP


Data Collection Vehicle (DCV) Rating

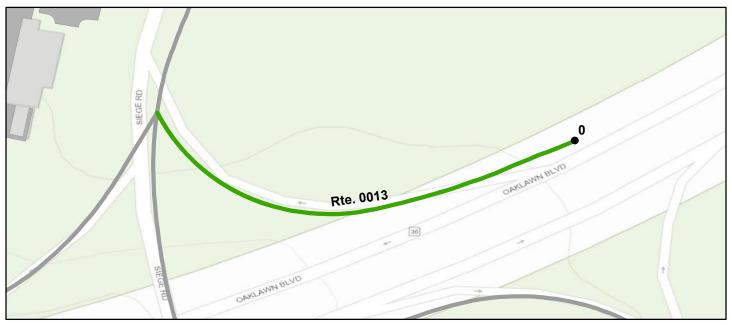

	Route (Condition Legend – Pav	ement Condi	ition Rating (PCR)		
Poor (0 - 60			(85 - 94)	Excellent (Not Ra	ted
Colors	on map represent con-	dition scores at 0.10-mile	intervals. Se	e Appendix fo	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Mile	es): 0.09	Section Length (MI)	0.09				
Surface Type:	ASPHALT	Route Summary		!		!	
Roadway Condition	1 Information						
Pavement Conditio	n Rating (PCR)	91	91				
Surface Condition R	ating (SCR)	91	91				
Roughness Conditio	n Index (RCI)	N/A	N/A				
Distress Index Valu	es						
Structural Crack In	dex	94	94				
Alligator Crack Inc	lex	100	100				
Longitudinal Crack	Index	94	94				
Transverse Crackin	ig Index	91	91				
Patching Index		100	100				
Rutting Index		99	99				
International Rough	hness Index (IRI)	N/A	N/A				
Lane & Width Info	rmation						
Number of Lanes		1	1				
Paved Width (ft)		16.8	16.8				
Lane Width (ft)		16.8	16.8				

ROUTE 0300ZZ: CARRIAGE LANES

Summary Route

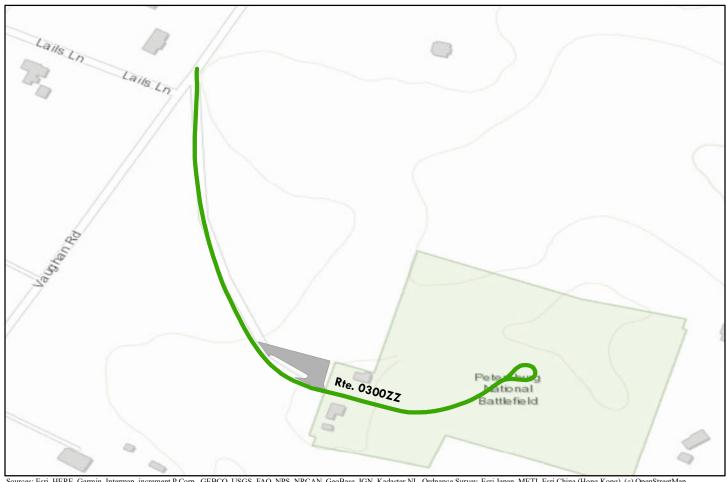


Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), (c) OpenStreetMap

Note: The weighted average summary PCR value is calculated from only the sections of road where the PCR was collected. The overall PCR for the summary route may not reflect individual subcomponent ratings.

Toute may not reflect mur	viduai subcomponent i a	ımgs.						
	Route C	Condition Leg	gend – Pav	ement Cond	ition Rating (PCR)		
Poor (0 - 60)	Fair (6	Good ((85 - 94)	Excellent (95 - 100)		Not Ra	ted
		See Appen	dix for def	finitions and f	ormulas			
Inspection Date:	12/10/2020							
Paved Length (Miles): 0.33							
Surface Type:	ASPHALT	Route Summ	nary					
Roadway Condition	Information							
Pavement Condition	Rating (PCR)	94						
Lane & Width Inform	mation							
Number of Lanes		1						
Paved Width (ft)		11						
Lane Width (ft)		11						

ROUTE 0300AZ: CARRIAGE LANE A


Subcomponent of Route PETE-0300ZZ Data Collection Vehicle (DCV) Rating

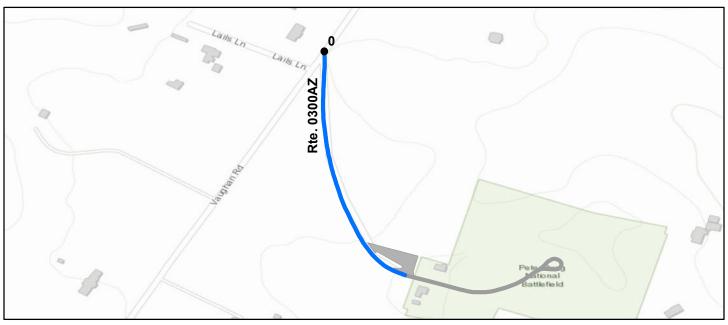

Rout	e Condition Legend – Pav	ement Candi	ition Rating (PC	' P)	
		(85 - 94)	Excellent (95		Not Rated
	ondition scores at 0.10-mile		· · · · · · · · · · · · · · · · · · ·		
Inspection Date: 12/10/2020	Beginning Section MP	0			
Paved Length (Miles): 0.2	Section Length (MI)	0.2			
Surface Type: ASPHALT	Route Summary			· · · · · · · · · · · · · · · · · · ·	'
Roadway Condition Information					
Pavement Condition Rating (PCR)	96	96			
Surface Condition Rating (SCR)	96	96			
Roughness Condition Index (RCI)	N/A	N/A			
Distress Index Values					
Structural Crack Index	98	98			
Alligator Crack Index	100	100			
Longitudinal Crack Index	98	98			
Transverse Cracking Index	96	96			
Patching Index	100	100			
Rutting Index	99	99			
International Roughness Index (IRI)	N/A	N/A			
Lane & Width Information					
Number of Lanes	1	1			
Paved Width (ft)	11	11			
Lane Width (ft)	11	11			

ROUTE 0300BZ: CARRIAGE LANE B

Subcomponent of Route PETE-0300ZZ Manual Rating

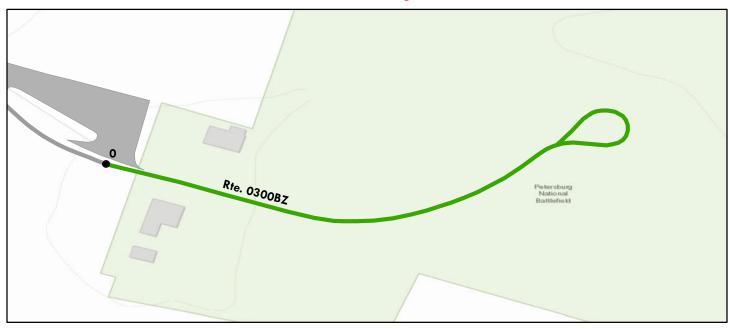

	Pouta (Condition Legend – Pav	amant Candi	tion Rating (PCD)		
Poor (0 - 60			(85 - 94)	Excellent (Not Ra	ted
1001 (0 00	7 mi (0	See Appendix for det	· /		70 100)	1100 110	· · ·
Ingression Dates	12/10/2020			l	Ι	T	
Inspection Date:		Beginning Section MP					
Paved Length (Mile	s): 0.13	Section Length (MI)	0.13				
Surface Type:	ASPHALT	Route Summary					
Roadway Condition	Information						
Pavement Condition	n Rating (PCR)	90	90				
Surface Condition Ra	ating (SCR)	90	90				
Roughness Condition	n Index (RCI)	N/A	N/A				
Distress Index Value	es						
Structural Crack Inc	dex	N/A	N/A				
Alligator Crack Ind	ex	97	97				
Longitudinal Crack	Index	90	90				
Transverse Cracking	g Index	90	90				
Patching Index		97	97				
Rutting Index		97	97				
International Rough	nness Index (IRI)	N/A	N/A				
Lane & Width Infor	rmation						
Number of Lanes		1	1				
Paved Width (ft)		11	11				
Lane Width (ft)		11	11				

ROUTE 0300BZ: CARRIAGE LANE B

Condition Photos

Condition photos are shown only for manually rated roads. Use the PathView program to see images of DCV rated roads.



PETE_0300BZ_1.jpg



PETE_0300BZ_3.jpg



PETE_0300BZ_5.jpg



PETE_0300BZ_2.jpg



PETE_0300BZ_4.jpg



PETE_0300BZ_6.jpg

ROUTE 0301: LONG FLANK ROAD


Data Collection Vehicle (DCV) Rating



	Route (Condition Legend – Pav	ement Condi	tion Rating (PCR)		
Poor (0 - 60			(85 - 94)	Excellent (Not Ra	ted
Colors	on map represent con	dition scores at 0.10-mile		e Appendix fo	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Mile	es): 0.9	Section Length (MI)	0.9				
Surface Type:	ASPHALT	Route Summary				!	
Roadway Condition	1 Information						
Pavement Conditio	n Rating (PCR)	91	91				
Surface Condition R	ating (SCR)	98	98				
Roughness Conditio	n Index (RCI)	81	81				
Distress Index Valu	es						
Structural Crack In	dex	99	99				
Alligator Crack Inc	lex	100	100				
Longitudinal Crack	Index	99	99				
Transverse Crackin	ig Index	98	98				
Patching Index		100	100				
Rutting Index		100	100				
International Rough	hness Index (IRI)	165	165				
Lane & Width Info	rmation						
Number of Lanes		2	2				
Paved Width (ft)		19.5	19.5				
Lane Width (ft)		9.4	9.4				

ROUTE 0402: HEADQUARTERS ACCESS ROAD


Data Collection Vehicle (DCV) Rating

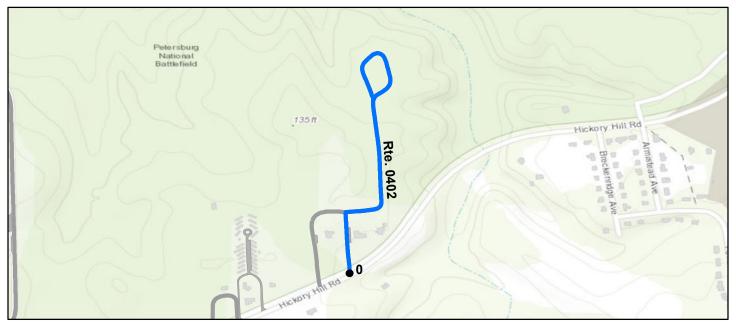

	Route (Condition Legend – Pav	ement Condi	ition Rating (PCR)		
Poor (0 - 60			(85 - 94)	Excellent (Not Ra	ted
Colors	on map represent con-	dition scores at 0.10-mile	intervals. Se	e Appendix fo	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Mile	es): 0.49	Section Length (MI)	0.49				
Surface Type:	ASPHALT	Route Summary		!		!	
Roadway Condition	Information						
Pavement Conditio	n Rating (PCR)	98	98				
Surface Condition R	ating (SCR)	98	98				
Roughness Condition	n Index (RCI)	N/A	N/A				
Distress Index Value	es						
Structural Crack In-	dex	99	99				
Alligator Crack Ind	lex	100	100				
Longitudinal Crack	Index	99	99				
Transverse Crackin	g Index	100	100				
Patching Index		100	100				
Rutting Index		98	98				
International Rough	nness Index (IRI)	N/A	N/A				
Lane & Width Info	rmation						
Number of Lanes		1	1				
Paved Width (ft)		11.5	11.5				
Lane Width (ft)		11.5	11.5				

ROUTE 0403: RANGER STATION ACCESS ROAD

Data Collection Vehicle (DCV) Rating

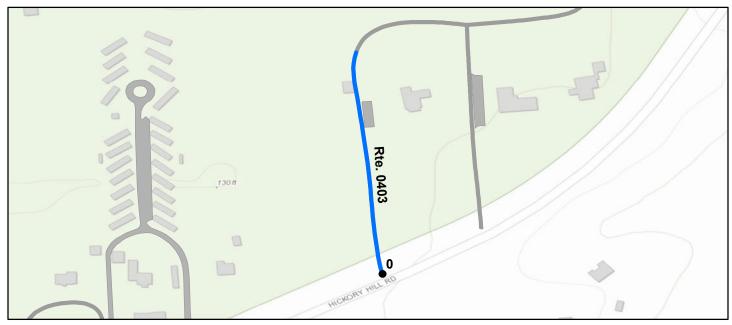


	Pouto (Condition Legend – Pav	ramant Candi	ition Poting (PCD)		
Poor (0 - 60)	Fair (6		(85 - 94)	Excellent (Not Ra	ted
	`	dition scores at 0.10-mile	· /	*	1		icu
				e Appendix ic	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Miles):	0.11	Section Length (MI)	0.11				
Surface Type:	ASPHALT	Route Summary					
Roadway Condition In	formation						
Pavement Condition R	ating (PCR)	99	99				
Surface Condition Ratin	g (SCR)	99	99				
Roughness Condition In	dex (RCI)	N/A	N/A				
Distress Index Values							
Structural Crack Index		100	100				
Alligator Crack Index		100	100				
Longitudinal Crack Inc	lex	100	100				
Transverse Cracking In	ndex	100	100				
Patching Index		100	100				
Rutting Index		99	99				
International Roughnes	ss Index (IRI)	N/A	N/A				
Lane & Width Informa	ntion						
Number of Lanes		1	1				
Paved Width (ft)		11.5	11.5				
Lane Width (ft)		11.5	11.5				

ROUTE 0406: OPERATIONS SERVICE ROAD

Not rated in Cycle 6 due to low hanging tree branches and debris on pavement surface.

ROUTE 0408: RANGER STATION TO HQ SHORTCUT


Data Collection Vehicle (DCV) Rating

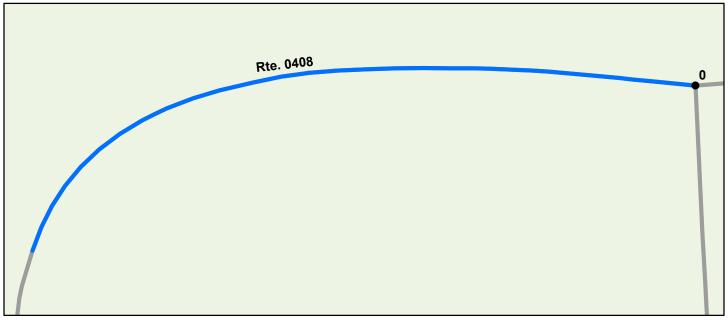

	Route (Condition Legend – Pav	ement Condi	ition Rating (PCR)		
Poor (0 - 6			(85 - 94)	Excellent (Not Ra	ted
Colors	on map represent con	dition scores at 0.10-mile	intervals. Se	e Appendix fo	or definitions	and formulas.	
Inspection Date:	12/10/2020	Beginning Section MP	0				
Paved Length (Mil	es): 0.05	Section Length (MI)	0.05				
Surface Type:	ASPHALT	Route Summary		!			
Roadway Conditio	n Information						
Pavement Condition	on Rating (PCR)	99	99				
Surface Condition I	Rating (SCR)	99	99				
Roughness Condition	on Index (RCI)	N/A	N/A				
Distress Index Valu	ies						
Structural Crack In	ndex	100	100				
Alligator Crack In	dex	100	100				
Longitudinal Crack	k Index	100	100				
Transverse Cracking	ng Index	100	100				
Patching Index		100	100				
Rutting Index		99	99				
International Roug	ghness Index (IRI)	N/A	N/A				
Lane & Width Info	ormation						
Number of Lanes		1	1				
Paved Width (ft)		12.8	12.8				
Lane Width (ft)		12.8	12.8				

ROUTE 0411: QUARTERS #29 ACCESS ROAD


Data Collection Vehicle (DCV) Rating

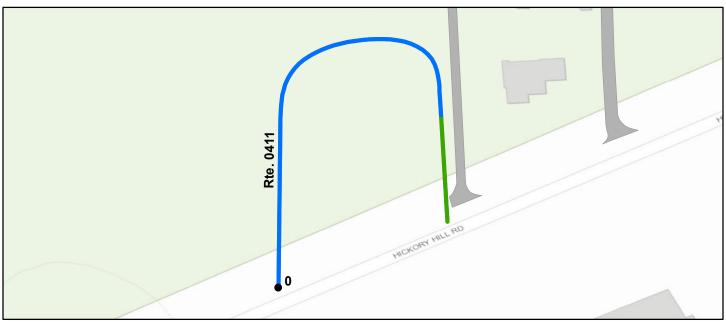

Route Condition Legend – Pavement Condition Rating (PCR)							
Poor (0 - 60)	Fair (61		d (85 - 94)	Excellent (9		Not Ra	ted
Colors on map represent con-		· ·		· · · · · · · · · · · · · · · · · · ·	100		
Inspection Date: 12/10		Beginning Section M				T	
Paved Length (Miles): 0.13		Section Length (MI)					
			0.13				
Surface Type: ASPH		Route Summary					
Roadway Condition Informa	ation						
Pavement Condition Rating	(PCR)	96	96				
Surface Condition Rating (SC)	R)	96	96				
Roughness Condition Index (F	RCI)	N/A	N/A				
Distress Index Values							
Structural Crack Index		100	100				
Alligator Crack Index		100	100				
Longitudinal Crack Index		100	100				
Transverse Cracking Index		100	100				
Patching Index		100	100				
Rutting Index		96	96				
International Roughness Inde	ex (IRI)	N/A	N/A				
Lane & Width Information							
Number of Lanes		1	1				
Paved Width (ft)		12.7	12.7				
Lane Width (ft)		12.7	12.7				

ROUTE 0500: SIEGE ROAD

Data Collection Vehicle (DCV) Rating

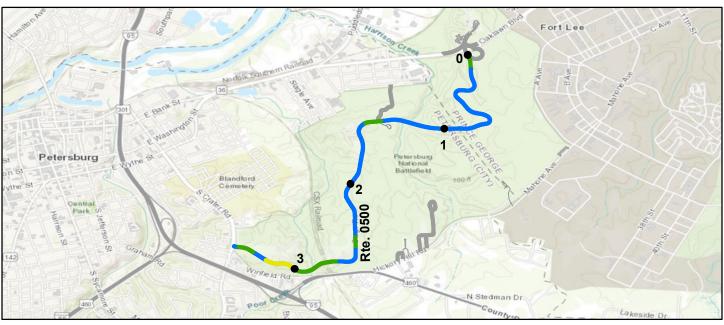

Route Condition Legend – Pavement Condition Rating (PCR)						
l		(85 - 94)	Excellent (Not Ra	ted
Colors on map represent of	ondition scores at 0.10-mile	intervals. Se	e Appendix fo	or definitions	and formulas.	
Inspection Date: 12/10/2020	Beginning Section MP	0	1	2	3	
Paved Length (Miles): 3.43	Section Length (MI)	1	1	1	0.43	
Surface Type: ASPHALT	Route Summary		!		!	
Roadway Condition Information						
Pavement Condition Rating (PCR)	98	99	99	97	86	
Surface Condition Rating (SCR)	98	99	99	98	88	
Roughness Condition Index (RCI)	97	100	100	95	84	
Distress Index Values						
Structural Crack Index	98	100	100	100	91	
Alligator Crack Index	100	100	100	100	100	
Longitudinal Crack Index	98	100	100	100	91	
Transverse Cracking Index	98	99	100	99	88	
Patching Index	100	100	100	100	100	
Rutting Index	99	99	99	98	97	
International Roughness Index (IRI)	122	112	113	127	156	
Lane & Width Information						
Number of Lanes	1	1	1	1	1	
Paved Width (ft)	20.1	20.7	19.9	20	19.2	
Lane Width (ft)	12.6	12.1	12.9	12.7	12.6	

Section 6 Paved Parking Area Condition Rating Sheets



Petersburg National Battlefield



ROUTE 0900: GRANT'S HEADQUARTERS VISITOR PARKING


Manual Rating

FROM CEDAR LANE

TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type		
8/25/2020	24557	PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation		
23,750	0.409	NOT APPLICABLE	NOT APPLICABLE		
Curb	Туре	Curb & G	utter Type		
NO C	CURB	NO CURB AND GUTTER			
Pavement Rec	commendation	Condition Rating / PCR			
RECONST	RUCTION	POOR / 30			
	Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated		
	See Appendix for definitions and formulas				



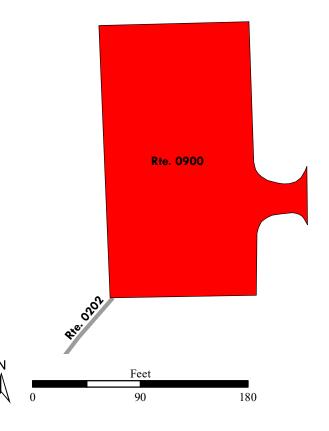

ROUTE 0901: WATER STREET RECREATIONAL PARKING #1

Manual Rating

FROM WATER STREET

TO PECAN STREET

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	24532	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
9,106	0.157	4	LIGHT REPAIR
Curb	Туре	Curb & Gutter Type	
CONCRETE	AND WOOD	NO CURB AND GUTTER	
Pavement Rec	commendation	Condition R	ating / PCR
HEAVY 3R T	REATMENTS	POOR	2 / 53
Pouts Condition Legand Payament Condition Pating (PCP)			

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)


Excellent (95 - 100)

Not Rated







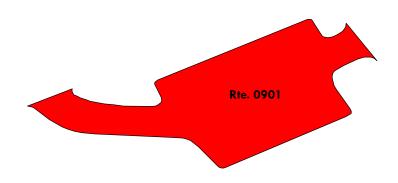



ROUTE 0902: WATER STREET RECREATIONAL PARKING #2

Manual Rating

FROM WATER STREET


TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type		
8/25/2020	46014	PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation		
6,137	0.106	6	LIGHT REPAIR		
Curb	Curb Type		Curb & Gutter Type		
CONC	CRETE	NO CURB AND GUTTER			
Pavement Rec	Pavement Recommendation		ating / PCR		
LIGHT 3R TREATMENTS		FAIR / 73			
Route Condition Legend – Pavement Condition Rating (PCR)					
Poor (0 - 60)	Fair (61- 84) Good	(85 - 94) Excellent (95 - 10	0) Not Rated		







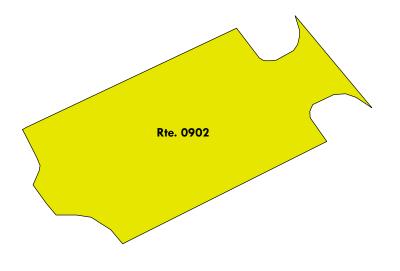




ROUTE 0904: VISITOR CENTER PARKING

Manual Rating

FROM END OF ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)

TO PARKING

Inspection Date	FMSS Numb	per	User Access	Surface Type		
8/25/2020	51262		PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' V	Widths) Curb	Reveal (Inches)	Curb Recommendation		
42,542	0.732		4	DO NOTHING		
Cur	Curb Type			Curb & Gutter Type		
CON	CONCRETE		NO CURB AND GUTTER			
Pavement Ro	ecommendation		Condition Rating / PCR			
PREVENTIVE	MAINTENANCE		GOOD	0 / 90		
	gend – Pavement Cor	ndition Rating (PCR)				
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 10	Not Rated		

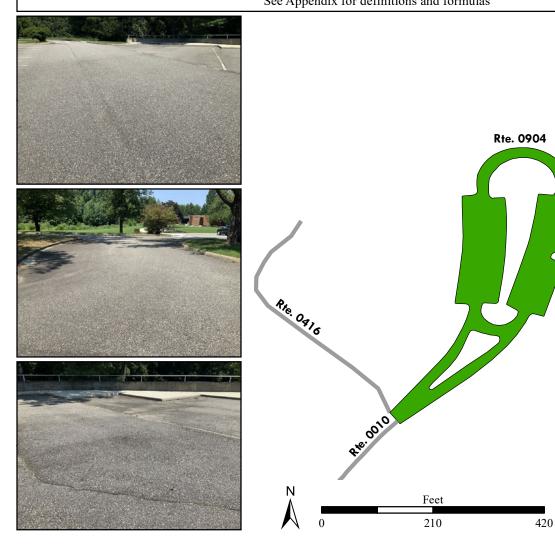

ROUTE 0905: MAINTENANCE AREA ACCESS ROAD & PARKING

Manual Rating

FROM ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)

TO MAINTENANCE AREA

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	45869	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
47,678	0.821	NOT APPLICABLE	NOT APPLICABLE
Curb	Туре	Curb & Gutter Type	
NO (CURB	NO CURB AND GUTTER	
Pavement Rec	Pavement Recommendation		Rating / PCR
PREVENTIVE MAINTENANCE		GOOD / 90	
Route Condition Legend – Payement Condition Rating (PCR)			

Poor (0 - 60)


Fair (61-84)

Good (85 - 94)

Excellent (95 - 100)


Not Rated









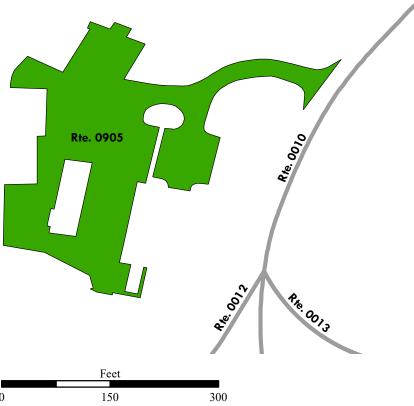

ROUTE 0906: FORT FRIEND PARKING

Manual Rating

FROM ROUTE 0500 (SIEGE ROAD)

TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	51168	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
1,420	0.024	5	DO NOTHING
Curb	Curb Type		utter Type
CONC	CRETE	NO CURB AND GUTTER	
Pavement Rec	commendation	Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	
Route Condition Legend – Pavement Condition Rating (PCR)			

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)


Excellent (95 - 100)

Not Rated







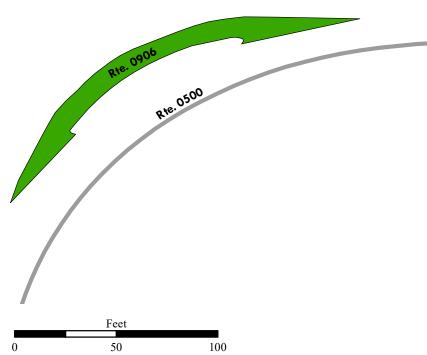

ROUTE 0907: SUTLER STORE PARKING

Manual Rating

FROM ROUTE 0500 (SIEGE ROAD)

TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type		
8/25/2020	51191	PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation		
5,239	0.09	6	DO NOTHING		
Curb	Туре	Curb & Gutter Type			
CONC	CONCRETE		NO CURB AND GUTTER		
Pavement Rec	commendation	Condition R	ating / PCR		
PREVENTIVE MAINTENANCE		GOOD / 90			
	Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60)	, ,	(85 - 94) Excellent (95 - 10	0) Not Rated		
See Appendix for definitions and formulas					



ROUTE 0908: SUTLER STORE OVERFLOW PARKING

Manual Rating

FROM ROUTE 0500 (SIEGE ROAD)

TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	51192	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
11,644	0.2	NOT APPLICABLE	NOT APPLICABLE
Curb	Туре	Curb & Gutter Type	
NO (CURB	NO CURB AND GUTTER	
Pavement Rec	Pavement Recommendation		ating / PCR
LIGHT 3R TREATMENTS		FAIR / 73	
Route Condition Legend – Pavement Condition Rating (PCR)			

Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61-84)

Good (85 - 94) See Appendix for definitions and formulas


Excellent (95 - 100)

Not Rated







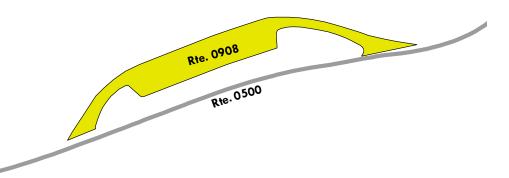



ROUTE 0911: HARRISON CREEK PARKING

Manual Rating

ADJACENT TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type		
8/25/2020	51211	PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches) Curb Recommend			
1,382	0.024	4	MODERATE REPAIR		
Cur	Curb Type		Curb & Gutter Type		
CON	CONCRETE		ND GUTTER		
Pavement Ro	Pavement Recommendation		ating / PCR		
NOT AP	NOT APPLICABLE NOT RATED		RATED		
Route Condition Legend – Pavement Condition Rating (PCR)					

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated


See Appendix for definitions and formulas



NOTE: SURFACE NOT RATED - COVERED WITH SAND.





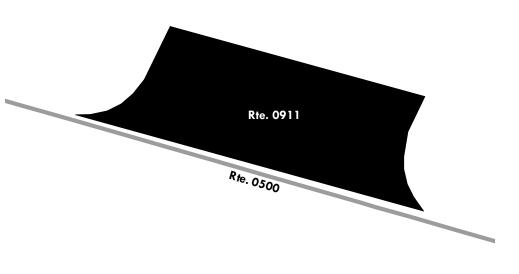



ROUTE 0912: FORT STEDMAN PARKING

Manual Rating

FROM ROUTE 0500 (SIEGE ROAD)

TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	51212	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
7,247	0.125	3	MODERATE REPAIR	
Curb	Type	Curb & Gutter Type		
CONC	RETE	NO CURB AND GUTTER		
Pavement Rec	Pavement Recommendation		ating / PCR	
PREVENTIVE M	MAINTENANCE	GOOD / 90		
Douts Condition Legand Devement Condition Dating (DCD)				

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)


Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated



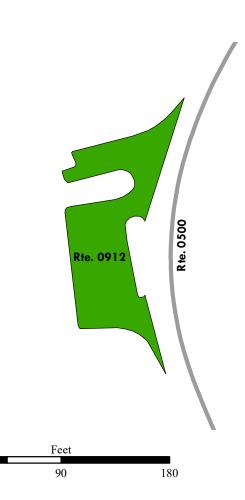


ROUTE 0913: FORT HASKELL PARKING

Manual Rating

ADJACENT TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	51213	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
2,102	0.036	NOT APPLICABLE	NOT APPLICABLE	
Curb Type		Curb & Gutter Type		
NO CURB		NO CURB AND GUTTER		
Pavement Recommendation		Condition Rating / PCR		
HEAVY 3R TREATMENTS		POOR / 53		
Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60) Fair (61- 84) Good (85 - 94) Excellent (95 - 100) Not Rated		0) Not Rated		
See Appendix for definitions and formulas				

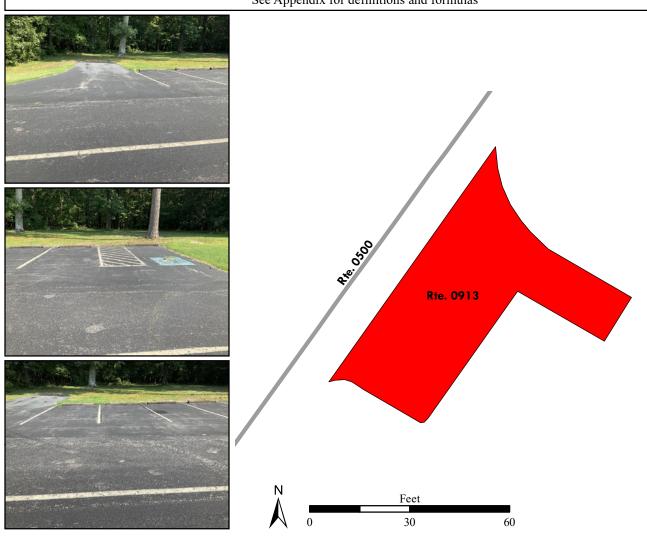


ROUTE 0915: CRATER & MINE TUNNEL PARKING

Manual Rating

FROM ROUTE 0500 (SIEGE ROAD)

TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	51215	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
6,784	0.117	6	DO NOTHING	
Curb Type		Curb & Gutter Type		
CONCRETE		NO CURB AND GUTTER		
Pavement Recommendation		Condition Rating / PCR		
HEAVY 3R TREATMENTS		POOR / 53		
Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60) Fair (61- 84) Good (85 - 94) Excellent (95 - 100)		0) Not Rated		
	See Appendix for definitions and formulas			

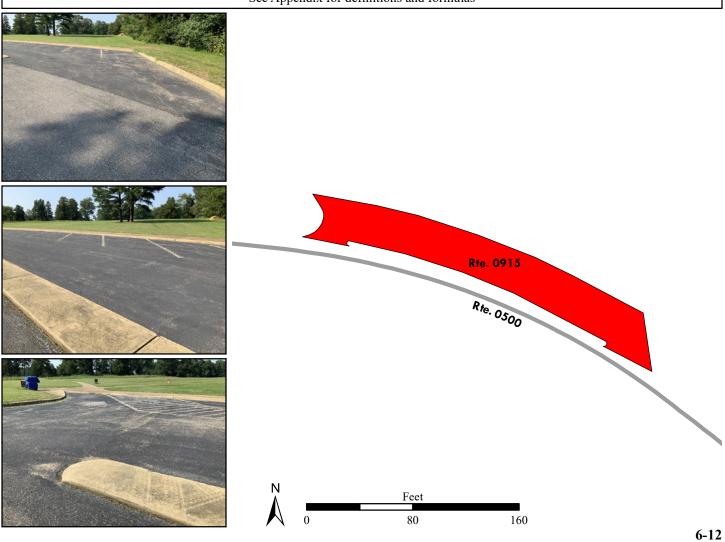

ROUTE 0916: CRATER & MINE TUNNEL BUS PARKING

Manual Rating

FROM ROUTE 0500 (SIEGE ROAD)

TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	51216	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
1,797	0.031	5	DO NOTHING
Curb Type		Curb & Gutter Type	
CONCRETE		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R T	HEAVY 3R TREATMENTS POOR		2 / 53
Route Condition Legend – Pavement Condition Rating (PCR)			

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)

Excellent (95 - 100)


Not Rated











ROUTE 0919: RESOURCE MANAGEMENT PARKING

Manual Rating

FROM MAHONE AVENUE

TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	51224	NONPUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
18,015	0.31	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)


Excellent (95 - 100)

Not Rated







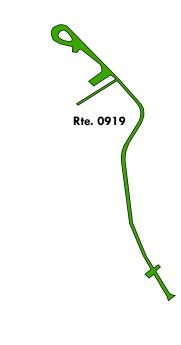



ROUTE 0920: MAHONE PARKING

Manual Rating

FROM MAHONE AVENUE

TO MAHONE AVENUE

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	45371	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
34,269	0.59	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)


Excellent (95 - 100)


Not Rated







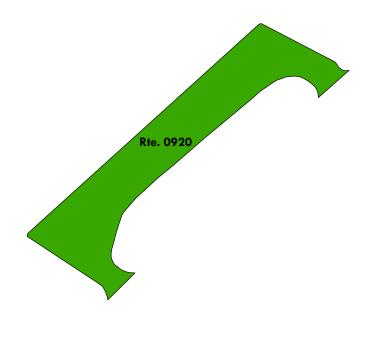



ROUTE 0921: FORT WADSWORTH PARKING

Manual Rating

FROM HALIFAX ROAD

TO FLANK ROAD

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	43966	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
8,309	0.143	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	
Route Condition Legend – Pavement Condition Rating (PCR)			

Poor (0 - 60)

Fair (61-84)

Good (85 - 94)


Excellent (95 - 100)

Not Rated







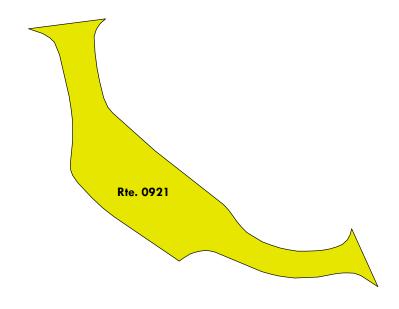




ROUTE 0922: PUBLIC PARKING

Manual Rating

FROM ROUTE 0300AZ (CARRIAGE LANE A)

TO ROUTE 0300AZ (CARRIAGE LANE A)

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	51225	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
8,841	0.152	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	
Route Condition Legend – Pavement Condition Rating (PCR)			
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated
See Appendix for definitions and formulas			

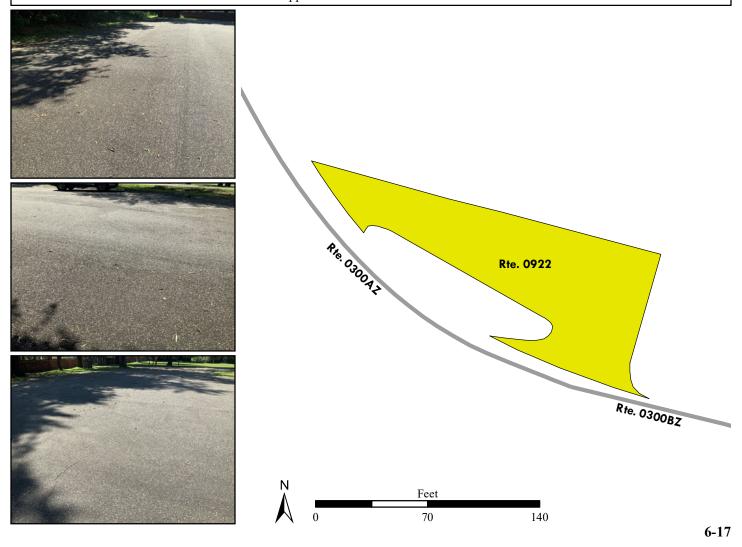

ROUTE 0923: FORT URMSTON PARKING

Manual Rating

ADJACENT TO ROUTE 0301 (LONG FLANK ROAD)

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	51239	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
1,127	0.019	3	MODERATE REPAIR
Curb Type		Curb & Gutter Type	
CONCRETE		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90	
Route Condition Legend - Pavement Condition Rating (PCR)			
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated
See Appendix for definitions and formulas			



ROUTE 0924: FORT CONAHEY PARKING AREA #1

Manual Rating

ADJACENT TO ROUTE 0301 (LONG FLANK ROAD) ON RIGHT

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	51242	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
2,300	0.04	4	DO NOTHING	
Curb Type		Curb & Gutter Type		
CONC	CONCRETE		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR		
PREVENTIVE N	PREVENTIVE MAINTENANCE (D / 90	
Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60) Fair (61- 84) Good (85 - 94) Excellent (95 - 100) Not Rated See Appendix for definitions and formulas				




ROUTE 0925: FORT CONAHEY PARKING AREA #2

Manual Rating

ADJACENT TO ROUTE 0301 (LONG FLANK ROAD) ON LEFT

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	51248	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
1,694	0.029	3	DO NOTHING	
Curb	Curb Type		Curb & Gutter Type	
CONCRETE		NO CURB AND GUTTER		
Pavement Recommendation		Condition Rating / PCR		
PREVENTIVE N	MAINTENANCE	GOOL) / 90	
Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated	
See Appendix for definitions and formulas				

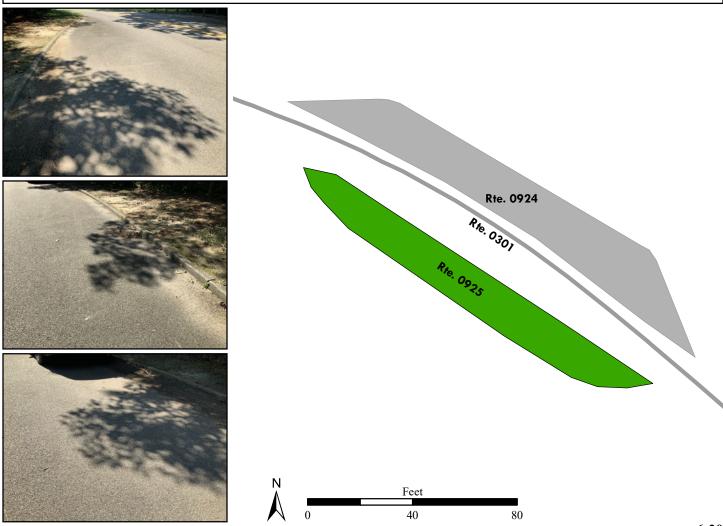

ROUTE 0926: FORT FISHER PARKING

Manual Rating

ADJACENT TO ROUTE 0301 (LONG FLANK ROAD)

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	51249	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
2,056	0.035	3	DO NOTHING	
Curb	Curb Type		Curb & Gutter Type	
CONC	CRETE	NO CURB AND GUTTER		
Pavement Recommendation		Condition Rating / PCR		
PREVENTIVE MAINTENANCE		GOOD / 90		
Route Condition Legend – Pavement Condition Rating (PCR)				

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)


Excellent (95 - 100)

Not Rated











ROUTE 0927: CONFEDERATE FORT GREGG PARKING


Manual Rating

FROM 7TH AVE

TO 7TH AVE

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	43968	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
8,227	0.142	NOT APPLICABLE	NOT APPLICABLE	
Curb	Curb Type Curb & Gutter Type		utter Type	
NO C	NO CURB		NO CURB AND GUTTER	
Pavement Recommendation Conditio		Condition R	Rating / PCR	
PREVENTIVE MAINTENANCE		GOOD / 90		
Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated	
See Appendix for definitions and formulas				



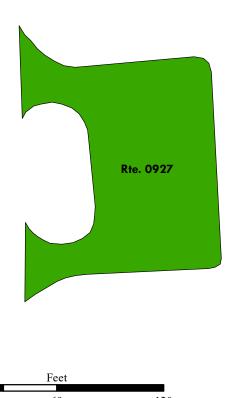



ROUTE 0928: FINAL STAND WAYSIDE PARKING

Manual Rating

FROM STATE HIGHWAY 613 (WHITE OAK ROAD)

TO STATE HIGHWAY 613 (WHITE OAK ROAD)

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	43964	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
5,536	0.095	NOT APPLICABLE	NOT APPLICABLE	
Curb Type		Curb & Gutter Type		
NO C	NO CURB		NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR		
PREVENTIVE MAINTENANCE		GOOD / 90		
Route Condition Legend – Pavement Condition Rating (PCR)				

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)


Excellent (95 - 100)


Not Rated







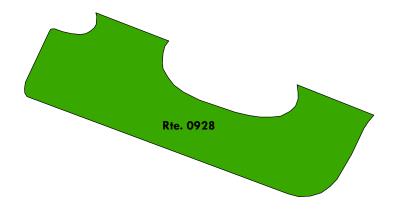



ROUTE 0929: ANGLE ATTACK WAYSIDE PARKING

Manual Rating

FROM STATE HIGHWAY 613 (WHITE OAK ROAD)


TO STATE HIGHWAY 613 (WHITE OAK ROAD)


Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	43962	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
5,356	0.092	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO CURB AND GUTT		ND GUTTER	
Pavement Rec	Pavement Recommendation Condition Rating / PCR		ating / PCR
LIGHT 3R TREATMENTS		FAIR / 73	
Route Condition Legend – Pavement Condition Rating (PCR)			
Poor (0 - 60) Fair (61- 84) Good (85 - 94) Excellent (95 - 100) Not Rated			0) Not Rated







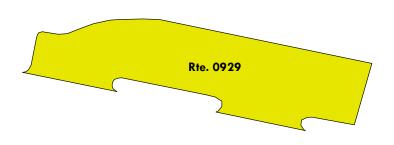



ROUTE 0930: UNION CAVALRY ATTACK WAYSIDE PARKING

Manual Rating

FROM STATE HIGHWAY 627 (COURTHOUSE ROAD)


TO STATE HIGHWAY 627 (COURTHOUSE ROAD)


Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	43961	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
6,996	0.12	NOT APPLICABLE	NOT APPLICABLE	
Curb Type		Curb & Gutter Type		
NO C	NO CURB		NO CURB AND GUTTER	
Pavement Recommendation Condition Rat		ating / PCR		
HEAVY 3R T	REATMENTS	POOR	2 / 53	
	Route Condition Legend – Pavement Condition Rating (PCR)			
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated	
See Appendix for definitions and formulas				







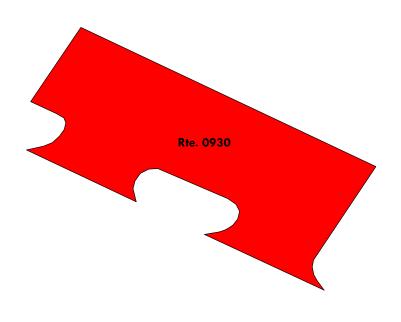



ROUTE 0931: CRAWFORD'S SWEEP WAYSIDE PARKING

Manual Rating


FROM STATE HIGHWAY 627 (COURTHOUSE ROAD)

TO STATE HIGHWAY 627 (COURTHOUSE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	43965	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
6,999	0.121	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO (NO CURB AND GUTTER		ND GUTTER
Pavement Re	commendation	Condition Rating / PCR	
LIGHT 3R TREATMENTS		FAIR / 73	
	Route Condition Legend – Pav	vement Condition Rating (PCR)	
Poor (0 - 60)	Fair (61- 84) Good	(85 - 94) Excellent (95 - 10	0) Not Rated





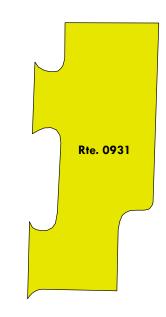




ROUTE 0933: PARK HEADQUARTERES PARKING

Manual Rating

ADJACENT TO ROUTE 0402 (HEADQUARTERS ACCESS ROAD)

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	51258	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
2,846	0.049	NOT APPLICABLE	NOT APPLICABLE	
Curb Type		Curb & Gutter Type		
NO C	NO CURB		NO CURB AND GUTTER	
Pavement Rec	Pavement Recommendation Condition Rating / PCR		ating / PCR	
PREVENTIVE N	MAINTENANCE	GOOL) / 90	
	Route Condition Legend – Pavement Condition Rating (PCR)			
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated	
See Appendix for definitions and formulas				



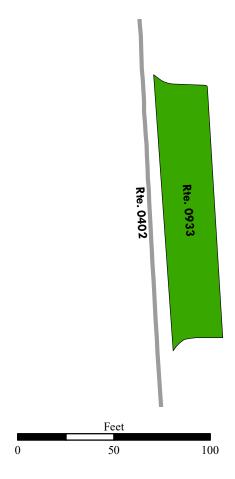


ROUTE 0934: RANGER STATION PARKING

Manual Rating

ADJACENT TO ROUTE 0403 (RANGER STATION ACCESS ROAD)

51259				
31237	PUBLIC	ASPHALT		
Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation		
0.023	NOT APPLICABLE	NOT APPLICABLE		
Curb Type Curb & Gutter Type		utter Type		
NO CURB NO CUR		AND GUTTER		
commendation Condition Rating / PCR		ating / PCR		
PREVENTIVE MAINTENANCE GOOD / 90		0 / 90		
Route Condition Legend – Pavement Condition Rating (PCR)				
· /		Not Rated		
	0.023 Type CURB commendation MAINTENANCE Route Condition Legend – Pav Fair (61-84) Good (0.023 NOT APPLICABLE Type Curb & G CURB NO CURB AN Commendation Condition R MAINTENANCE GOOD Route Condition Legend – Pavement Condition Rating (PCR)		



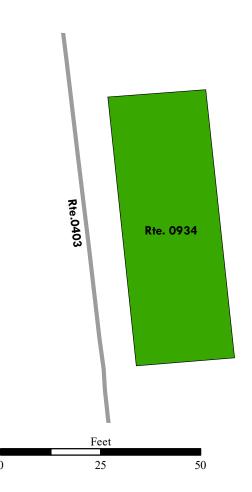

ROUTE 0935: VCS ACCESS ROAD & PARKING

Manual Rating

FROM STATE HIGHWAY 627 (COURTHOUSE ROAD)

TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type
8/25/2020	114397	PUBLIC	ASPHALT
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation
39,258	0.676	NOT APPLICABLE	NOT APPLICABLE
Curb Type		Curb & Gutter Type	
NO C	CURB	NO CURB AND GUTTER	
Pavement Recommendation		Condition Rating / PCR	
HEAVY 3R T	HEAVY 3R TREATMENTS		2 / 53

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)

Fair (61- 84)

Good (85 - 94)


Excellent (95 - 100)

Not Rated







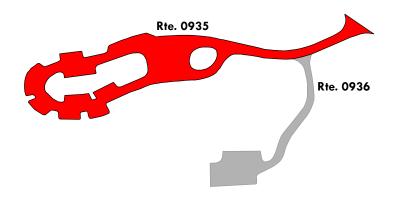




ROUTE 0936: MAINTENANCE AREA ACCESS ROAD & PARKING AREA

Manual Rating

FROM ROUTE 0935 (VCS ACCESS ROAD & PARKING)

TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	114398	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
11,697	0.201	NOT APPLICABLE	NOT APPLICABLE	
Curb	Curb Type Curb & Gutter Type		utter Type	
NO C	NO CURB		NO CURB AND GUTTER	
Pavement Rec	Pavement Recommendation Condition Rating / PCR		ating / PCR	
LIGHT 3R TI	LIGHT 3R TREATMENTS FAIR / 73		/ 73	
Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated	
See Appendix for definitions and formulas				

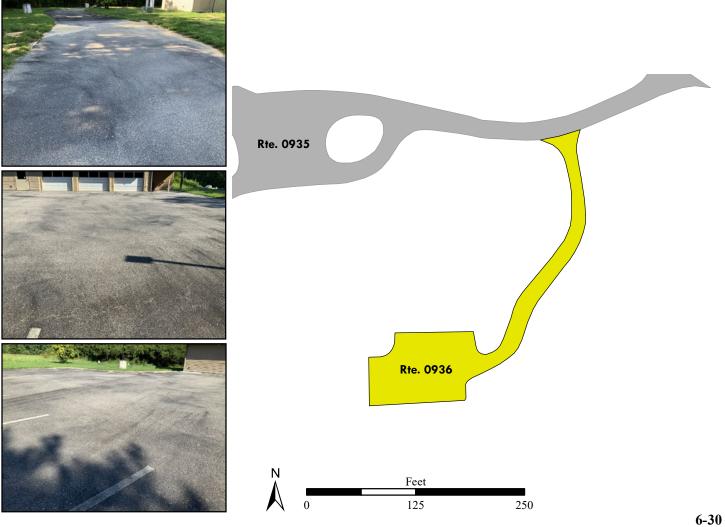


ROUTE 0937: OPERATIONS PARKING

Manual Rating

FROM INTERSECTION OF ROUTE 0500 (SIEGE ROAD) AND ROUTE 0406 (OPERATIONS SERVICE ROAD)

TO PARKING

Inspection Date	FMSS Number	User Access	Surface Type		
8/25/2020	116479	PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation		
12,414	0.214	NOT APPLICABLE	NOT APPLICABLE		
Curb	Туре	Curb & Gutter Type			
NO C	CURB	NO CURB AND GUTTER			
Pavement Rec	commendation	Condition Rating / PCR			
HEAVY 3R T	REATMENTS	POOR / 53			
	Route Condition Legend – Pavement Condition Rating (PCR)				
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated		
See Appendix for definitions and formulas					

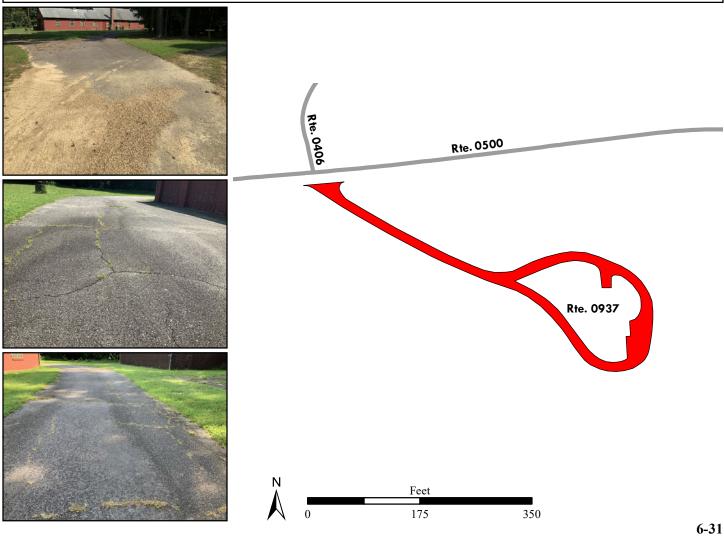

ROUTE 0939: HICKORY HILL HIKE / BIKE PARKING

Manual Rating

FROM STATE HIGHWAY 109 (HICKORY HILL ROAD)


TO STATE HIGHWAY 109 (HICKORY HILL ROAD)


Inspection Date	FMSS Number		User Access		Surface Type	
8/25/2020	228716		PUBLIC		ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' V	Widths)	Curb Reveal (Inches)		urb Recommendation	
20,144	0.347		NOT APPLICABLE		NOT APPLICABLE	
Curk	Curb Type			Curb & Gutter Type		
NO (CURB		NO CURB AND GUTTER			
Pavement Re	commendation		Condition	Rating	/ PCR	
HEAVY 3R TREATMENTS			POOR / 53			
	gend – Paveme	nt Condition Rating (PC	R)			
Poor (0 - 60)	Fair (61- 84)	Good (85 -	Excellent (95 -	100)	Not Rated	







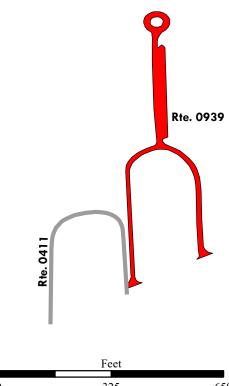



ROUTE 0945ZZ: TAYLOR HOUSE SITE PARKING

Summary Route Manual Rating


FROM ROUTE 0500 (SIEGE ROAD)

TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type			
8/25/2020	228082	PUBLIC	ASPHALT			
Area (Sq. Ft.)	Lane Miles (11' Widths)	Condition R	ating / PCR			
6,695	0.115	SUMMARY	7 / 90			
	Route Condition Legend – Pavement Condition Rating (PCR)					
Poor (0 - 60)	Fair (61- 84) Good ((85 - 94) Excellent (95 - 10	0) Not Rated			
	See Appendix for definitions and formulas					

The condition shown on this page reflects the overall route condition and may not reflect individual subcomponent ratings.

Rte. 0945ZZ (2 Subcomponents)

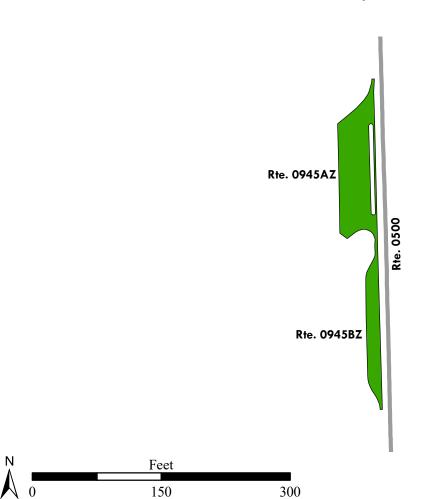

ROUTE 0945AZ: TAYLOR HOUSE SITE MAIN PARKING

Subcomponent of Route PETE-0945ZZ **Manual Rating**

FROM ROUTE 0500 (SIEGE ROAD)

TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type	
8/25/2020	228082	PUBLIC	ASPHALT	
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation	
4,711	0.081	NOT APPLICABLE	DO NOTHING	
Curb	Туре	Curb & Gutter Type		
NO (CURB	CONC	CRETE	
Pavement Rec	commendation	Condition R	ating / PCR	
PREVENTIVE N	MAINTENANCE	GOOI) / 90	
Route Condition Legend – Pavement Condition Rating (PCR)				


Poor (0 - 60)


Fair (61-84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated

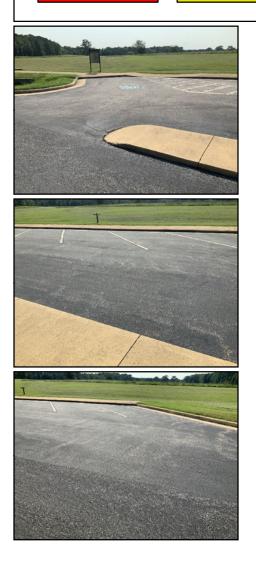

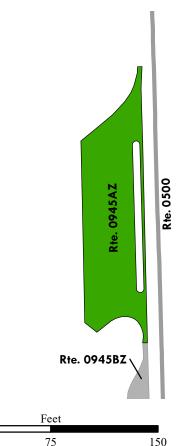

ROUTE 0945BZ: TAYLOR HOUSE SITE BUS PARKING

Subcomponent of Route PETE-0945ZZ **Manual Rating**

ADJACENT TO ROUTE 0500 (SIEGE ROAD)

Inspection Date	FMSS Number	User Access	Surface Type		
8/25/2020	228082	PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' Widths)	Curb Reveal (Inches)	Curb Recommendation		
1,984	0.034	NOT APPLICABLE	DO NOTHING		
Curb	Туре	Curb & Gutter Type			
NO C	CURB	CONCRETE			
Pavement Rec	commendation	Condition R	Rating / PCR		
PREVENTIVE N	MAINTENANCE	GOOI	O / 90		
$\mathbf{p}_{\mathbf{r}}$ \mathbf{r}					

Route Condition Legend – Pavement Condition Rating (PCR)

Poor (0 - 60)


Fair (61-84)

Good (85 - 94)

Excellent (95 - 100)

Not Rated



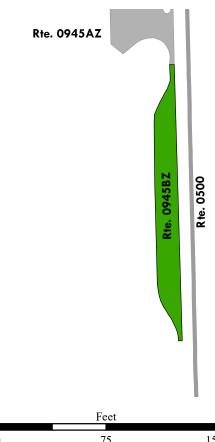

ROUTE 0946: WHITE OAK VISITOR PARKING

Manual Rating

FROM STATE HIGHWAY 613 (WHITE OAK ROAD)


TO STATE HIGHWAY 613 (WHITE OAK ROAD)

Inspection Date	FMSS Number		User Access	Surface Type		
8/25/2020	238419		PUBLIC	ASPHALT		
Area (Sq. Ft.)	Lane Miles (11' Width	s) Curb	Reveal (Inches)	Curb Recommendation		
9,870	0.17	NO.	TAPPLICABLE	NOT APPLICABLE		
Curk	Curb Type			Curb & Gutter Type		
NO (CURB		NO CURB AND GUTTER			
Pavement Re	commendation		Condition R	ating / PCR		
LIGHT 3R T	LIGHT 3R TREATMENTS			/ 73		
	Route Condition Legend	– Pavement Cor	dition Rating (PCR)			
Poor (0 - 60)	Fair (61- 84)	Good (85 - 94)	Excellent (95 - 10	0) Not Rated		







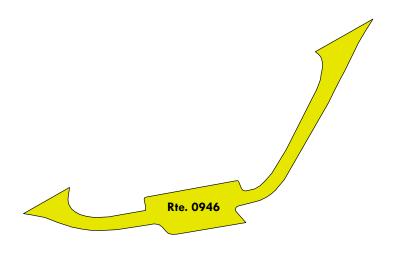



Section 7 Road Milepost Information



Petersburg National Battlefield



Road Milepost Information

This report section contains road milepost information for all paved roads in the park that were collected with the Data Collection Vehicle (DCV). The milepost data is obtained from the DCV by using a distance measuring instrument (DMI) that is calibrated to record mileage to the nearest thousandth of a mile. Park roads that were manually rated did not have milepost data collected, and thus are not included in this report section.

For Cycle 6, the information presented in this section differs from previous RIP cycles in that it does not contain the roadside features inventories for the paved park roads. Some examples of the features previously collected are signs, culverts/drop inlets, guardrails, curbing, pullouts, etc. If the park was collected in a previous RIP cycle, then the latest features data can be obtained by referencing the following:

Where to find the latest Features Inventories for NPS Parks:

- For Small Parks (parks with less than 10 miles of paved roads):
 - o Refer to Cycle 5 data (collected 2010 2014)
 - Features were reported in Section 9 of the *Cycle 5* RIP report
 - Video of features can be viewed using the PathViewVO program and Cycle 5 data
- For Large Parks (parks with more than 10 miles of paved roads):
 - o Refer to Cycle 4 data (collected 2006 2009)
 - Features were reported in Section 9 of the *Cycle 4* RIP report
 - Video of features can be viewed using the *VisiData* program and *Cycle 4* data
 - O Note: Features inventories were updated in Large Parks in *Cycle 5* only on a route by route basis if the route was new or modified in *Cycle 5*. If this is the case for a particular route, then features for the route can be obtained using the *PathViewVO* program and *Cycle 5* data (same as above for Small parks).

Milepost Events Verified in Cycle 6

In Cycle 6, the following events were collected and reported in Section 7 of this report:

- Intersections with roads and parking areas
- All bridges and culverts with BIP Numbers (bridge inspection program numbers)
- Mile Marker Signs
- One-Way travel directions
- Overpasses
- Tunnels
- Low Water Crossings (LWCR)
- Surface type changes
- Construction areas where no pavement condition data was obtained

GPS Mileage Matching

A consistent survey milepost and constant route length as recorded by the Data Collection Vehicle (DCV) is a challenge to maintain from one collection cycle to the next. The challenge is due to many factors such as driver characteristics, DMI calibration, tire pressure etc. After Cycle 4 (~2010), a decision was made to hold constant the length of roads so long as there was no physical change from reconstruction projects or realignments that would result in a change to the length of a road. Consequently, the "GPS Mileage Match" was implemented to specify which cycle the route length is being matched. Route mileages and GPS are matched to a previous collection whenever there is no physical change to a route alignment. The route mileage and GPS is not matched to previous cycles whenever it is determined that a road length and GPS needs to be updated. When this happens the GPS and length is updated to the cycle that displays the change, and that collection cycle is used as the matching cycle in subsequent collections of the road. Thus, the Cycle 6 GIS could be either the survey length collected in Cycle 4, Cycle 5, or Cycle 6 and therefore, may not match the survey milepost displayed in the latest Cycle 6 DCV video which is viewable in *PathView VO*.

The features inventories and road logs collected on NPS routes contain mileposts that are determined from the corresponding cycle that the GPS is matched to. Therefore, the mileposts contained in the Cycle 4 or 5 features inventories or the Cycle 6 road logs may not exactly match the survey milepost collected in the latest Cycle 6 video of the road.

Locating Mile Marker Signs

For routes that have mile marker signs along them, the milepost reported by RIP will most likely not line up exactly with the sign located in the field. This could be happening for many reasons, most likely due to either the error falling within the acceptable calibration range of the vehicle, or the level of accuracy that the mile marker signs were placed in the field.

Because mile marker signs are important features in many project plans and location descriptions, RIP is reporting locations of mile marker signs in three ways in Cycle 6:

- 1. Mileposts from Cycle 6 GIS: the official RIP milepost taken from the features inventories and the matching GPS/mileage cycle as described above. This is the milepost that should be used on project plans and when finding locations in the field
- 2. Mileposts from Cycle 6 Video: milepost shown to help locate the mile marker sign in the latest *Path View VO* video.
- 3. Latitude / Longitude: a constant way of locating a mile marker sign so long as the park has not moved the sign

The mileposts from Cycle 6 Video and GIS should be nearly the same, but on longer roads it has been observed that the Video milepost deviates more from the official GIS milepost that comes from the matching cycle.

ROUTE 0010: VA 36 EAST TO VISITOR CENTER

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 5.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 36 (OAKLAWN BOULEVARD) / NON NPS)
0.00	0.00	ONE-WAY START	N/A	N/A
0.00	0.00	INTERSECTION	N/A	PAVED ROUTE (STATE ROUTE 36 (OAKLAWN BOULEVARD) / NON NPS)
0.01	0.01	INTERSECTION	L	ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)
0.02	0.02	CULVERT	N/A	N/A
0.21	0.21	ONE-WAY END	N/A	N/A
0.21	0.21	INTERSECTION	L	ROUTE 0500 (SIEGE ROAD)
0.22	0.26	BRIDGE	N/A	4770-002 (VA ROUTE 36 BRIDGE)
0.30	0.30	INTERSECTION	L	ROUTE 0012 (VA 36 WEST ON RAMP)
0.31	0.31	INTERSECTION	R	ROUTE 0013 (VA 36 WEST OFF RAMP)
0.35	0.35	INTERSECTION	L	ROUTE 0905 (MAINTENANCE AREA PARKING)
0.39	0.39	INTERSECTION	L	UNPAVED ROUTE
0.39	0.39	INTERSECTION	N/A	ROUTE 0904 (VISITOR CENTER PARKING)

ROUTE 0011: SHORT FLANK ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	N/A	PAVED ROUTE (FLANK ROAD / NON NPS)
0.22	0.22	INTERSECTION	L	PAVED ROUTE (VAUGHAN ROAD)
0.22	0.22	CULVERT	N/A	N/A
0.22	0.22	INTERSECTION	R	PAVED ROUTE (VAUGHAN ROAD)
0.29	0.29	INTERSECTION	R	PAVED ROUTE (FLANK ROAD / NON NPS)
0.29	0.29	INTERSECTION	L	PAVED ROUTE (FLANK ROAD / NON NPS)

ROUTE 0012: VA 36 WEST ON RAMP

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 5.

FROM	TO			
MILEPOST	MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	N/A	ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)
0.00	0.00	INTERSECTION	L	ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)
0.16	0.16	INTERSECTION	N/A	PAVED ROUTE (STATE ROUTE 36 (OAKLAWN BOULEVARD) / NON NPS)
0.16	0.16	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 36 (OAKLAWN BOULEVARD) / NON NPS)

ROUTE 0013: VA 36 WEST OFF RAMP

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 5.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	N/A	PAVED ROUTE (STATE ROUTE 36 (OAKLAWN BOULEVARD) / NON NPS)
0.00	0.00	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 36 (OAKLAWN BOULEVARD) / NON NPS)
0.05	0.05	CULVERT	N/A	N/A
0.09	0.09	INTERSECTION	N/A	ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)
0.09	0.09	INTERSECTION	L	ROUTE 0010 (VA 36 EAST TO VISITOR CENTER)

ROUTE 0300AZ: CARRIAGE LANE A

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 6.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 675 (VAUGHAN ROAD) / NON NPS)
0.00	0.00	INTERSECTION	R	PAVED ROUTE (STATE ROUTE 675 (VAUGHAN ROAD) / NON NPS)
0.02	0.02	CULVERT	N/A	N/A
0.13	0.13	INTERSECTION	L	UNPAVED ROUTE / NON NPS
0.17	0.17	INTERSECTION	L	ROUTE 0922 (PUBLIC PARKING)
0.20	0.20	INTERSECTION	L	ROUTE 0922 (PUBLIC PARKING)
0.20	0.20	INTERSECTION	N/A	ROUTE 0300BZ (CARRIAGE LANE B)

Data Collected on 12/2020

ROUTE 0301: LONG FLANK ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	PAVED ROUTE (SQUIRREL LEVEL ROAD / NON NPS)
0.00	0.00	INTERSECTION	N/A	PAVED ROUTE (FLANK ROAD / NON NPS)
0.00	0.00	INTERSECTION	L	PAVED ROUTE (SQUIRREL LEVEL ROAD / NON NPS)
0.01	0.01	CULVERT	N/A	N/A
0.05	0.05	INTERSECTION	L	ROUTE 0923 (FORT URMSTON PARKING)
0.09	0.09	CULVERT	N/A	N/A
0.19	0.19	CULVERT	N/A	N/A
0.27	0.27	CULVERT	N/A	N/A
0.51	0.51	INTERSECTION	L	ROUTE 0925 (FORT CONAHEY PARKING AREA #2)
0.51	0.51	INTERSECTION	R	ROUTE 0924 (FORT CONAHEY PARKING AREA #1)
0.59	0.59	CULVERT	N/A	N/A
0.70	0.70	CULVERT	N/A	N/A
0.79	0.79	CULVERT	N/A	N/A
0.88	0.88	INTERSECTION	R	ROUTE 0926 (FORT FISHER PARKING)
0.90	0.90	INTERSECTION	L	PAVED ROUTE (CHURCH ROAD / NON NPS)
0.90	0.90	INTERSECTION	R	PAVED ROUTE (CHURCH ROAD / NON NPS)

ROUTE 0402: HEADQUARTERS ACCESS ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	R	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)
0.00	0.00	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)
0.01	0.01	CULVERT	N/A	N/A
0.06	0.06	INTERSECTION	R	ROUTE 0933 (PARK HEADQUARTERES PARKING)
0.10	0.10	INTERSECTION	L	ROUTE 0408 (RANGER STATION TO HQ SHORTCUT)
0.32	0.32	INTERSECTION	L	ROUTE 0402 (HEADQUARTERS ACCESS ROAD)
0.32	0.32	ONE-WAY START	N/A	N/A
0.36	0.36	INTERSECTION	L	ROUTE 0917 (HORSE TRAILER PARKING)
0.44	0.44	INTERSECTION	L	ROUTE 0917 (HORSE TRAILER PARKING)
0.44	0.44	CULVERT	N/A	N/A
0.49	0.49	ONE-WAY END	N/A	N/A
0.49	0.49	INTERSECTION	N/A	ROUTE 0402 (HEADQUARTERS ACCESS ROAD)
0.49	0.49	INTERSECTION	L	ROUTE 0402 (HEADQUARTERS ACCESS ROAD)

ROUTE 0403: RANGER STATION ACCESS ROAD

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 5.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	ONE-WAY START	N/A	N/A
0.00	0.00	INTERSECTION	R	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)
0.00	0.00	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)
0.01	0.01	CULVERT	N/A	N/A
0.08	0.08	INTERSECTION	R	ROUTE 0934 (RANGER STATION PARKING)
0.11	0.11	ONE-WAY END	N/A	N/A
0.11	0.11	INTERSECTION	N/A	ROUTE 0408 (RANGER STATION TO HQ SHORTCUT)
0.11	0.11	INTERSECTION	L	UNPAVED

ROUTE 0406: OPERATIONS SERVICE ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	PAVED ROUTE (SOUTH WHITEHILL DRIVE / NON NPS)
0.00	0.00	INTERSECTION	R	PAVED ROUTE (SOUTH WHITEHILL DRIVE / NON NPS)
0.03	0.03	CULVERT	N/A	N/A
0.16	0.16	INTERSECTION	L	UNPAVED ROUTE
0.16	0.16	INTERSECTION	R	UNPAVED ROUTE
0.33	0.33	INTERSECTION	R	ROUTE 0500 (SIEGE ROAD)
0.33	0.33	INTERSECTION	L	ROUTE 0500 (SIEGE ROAD)
0.33	0.33	CULVERT	N/A	N/A

ROUTE 0408: RANGER STATION TO HQ SHORTCUT

Road logs are verified in Cycle 6 and mileposts for this route are matched to GPS collected in Cycle 5.

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	ROUTE 0402 (HEADQUARTERS ACCESS ROAD)
0.00	0.00	INTERSECTION	N/A	ROUTE 0402 (HEADQUARTERS ACCESS ROAD)
0.00	0.00	ONE-WAY START	N/A	N/A
0.05	0.05	INTERSECTION	N/A	ROUTE 0403 (RANGER STATION ACCESS ROAD)
0.05	0.05	INTERSECTION	R	UNPAVED ROUTE
0.05	0.05	ONE-WAY END	N/A	N/A

ROUTE 0411: QUARTERS #29 ACCESS ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.00	0.00	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)
0.00	0.00	INTERSECTION	R	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)
0.09	0.09	INTERSECTION	L	PAVED ROUTE
0.13	0.13	INTERSECTION	R	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)
0.13	0.13	INTERSECTION	L	PAVED ROUTE (STATE ROUTE 109 (HICKORY HILL ROAD) / NON NPS)

ROUTE 0500: SIEGE ROAD

0.00	0.00			COMMENT
		INTERSECTION	N/A	ROUTE 0010 (VA 36 EAST TO VISITOR CENTER) OPPOSITE LANE
0.00	0.00	INTERSECTION	L	ROUTE 0010 (VA 36 EAST TO VISITOR CENTER) OPPOSITE LANE
0.01	0.01	CULVERT	N/A	N/A
0.01	0.01	ONE-WAY START	N/A	N/A
0.06	0.06	CULVERT	N/A	N/A
0.14	0.14	CULVERT	N/A	N/A
0.25	0.25	CULVERT	N/A	N/A
0.34	0.34	INTERSECTION	R	ROUTE 0906 (FORT FRIEND PARKING)
0.37	0.37	INTERSECTION	R	ROUTE 0906 (FORT FRIEND PARKING)
0.42	0.42	CULVERT	N/A	N/A
0.63	0.63	CULVERT	N/A	N/A
0.70	0.70	INTERSECTION	L	ROUTE 0907 (SUTLER STORE PARKING)
0.72	0.72	INTERSECTION	L	ROUTE 0907 (SUTLER STORE PARKING)
0.73	0.73	CULVERT	N/A	N/A
0.75	0.75	INTERSECTION	R	ROUTE 0908 (SUTLER STORE OVERFLOW PARKING)
0.82	0.82	INTERSECTION	R	ROUTE 0908 (SUTLER STORE OVERFLOW PARKING)
0.99	0.99	INTERSECTION	R	UNPAVED ROUTE
1.23	1.23	INTERSECTION	R	ROUTE 0911 (HARRISON CREEK PARKING)
1.24	1.24	CULVERT	N/A	N/A
1.42	1.42	INTERSECTION	R	ROUTE 0406 (OPERATIONS SERVICE ROAD)
1.42	1.42	INTERSECTION	L	ROUTE 0937 (OPERATIONS PARKING)
1.50	1.50	INTERSECTION	R	UNPAVED ROUTE /NON NPS
1.57	1.57	INTERSECTION	R	ROUTE 0912 (FORT STEDMAN PARKING)
1.58	1.58	CULVERT	N/A	N/A
1.59	1.59	INTERSECTION	R	ROUTE 0912 (FORT STEDMAN PARKING)
1.66	1.66	CULVERT	N/A	N/A
1.84	1.84	CULVERT	N/A	N/A
1.94	1.94	CULVERT	N/A	N/A

ROUTE 0500: SIEGE ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
1.98	1.98	INTERSECTION	L	ROUTE 0913 (FORT HASKELL PARKING)
2.14	2.14	CULVERT	N/A	N/A
2.22	2.22	CULVERT	N/A	N/A
2.42	2.42	INTERSECTION	R	ROUTE 0945AZ (TAYLOR HOUSE SITE MAIN PARKING)
2.45	2.45	INTERSECTION	R	ROUTE 0945AZ (TAYLOR HOUSE SITE MAIN PARKING)
2.45	2.45	CULVERT	N/A	N/A
2.47	2.47	INTERSECTION	R	ROUTE 0945BZ (TAYLOR HOUSE SITE BUS PARKING)
2.59	2.59	CULVERT	N/A	N/A
2.77	2.79	BRIDGE	N/A	4770-001 (RAILROAD BRIDGE)
2.87	2.87	CULVERT	N/A	N/A
2.91	2.91	CULVERT	N/A	N/A
2.98	2.98	INTERSECTION	R	ROUTE 0014 (CRATER VISTA ACCESS ROAD)
3.02	3.02	CULVERT	N/A	N/A
3.04	3.04	INTERSECTION	R	ROUTE 0915 (CRATER & MINE TUNNEL PARKING)
3.08	3.08	INTERSECTION	R	ROUTE 0915 (CRATER & MINE TUNNEL PARKING)
3.10	3.10	INTERSECTION	R	ROUTE 0916 (CRATER & MINE TUNNEL BUS PARKING)
3.14	3.14	CULVERT	N/A	N/A
3.22	3.22	CULVERT	N/A	N/A
3.34	3.34	CULVERT	N/A	N/A
3.43	3.43	ONE-WAY END	N/A	N/A
3.43	3.43	INTERSECTION	L	PAVED ROUTE (CRATER ROAD / NON NPS)
3.43	3.43	INTERSECTION	R	PAVED ROUTE (CRATER ROAD / NON NPS)

Section 8 Appendix



Petersburg National Battlefield



Improvements to the RIP Index Equations and Determination of PCR

In 2005, the Federal Highway Administration (FHWA) began implementing the use of a Pavement Management System (PMS) to assist the National Park Service (NPS) in prioritizing Pavement Maintenance and Rehabilitation activities. The PMS used by FHWA is the Highway Pavement Management Application (HPMA) which has the ability to store inventory and condition data from the Road Inventory Program (RIP) and forecast future performance using prediction models. Outputs include performance and condition reports at the National, Region, Park, or Route level. A regional prioritized list and optimization have been produced for most regions and the Federal Highway Deferred Maintenance is calculated via the HPMA as well.

In an effort to improve the accuracy of treatment recommendations and pavement condition descriptions the distresses and indexes that comprise the Pavement Condition Rating (PCR), an extensive study was completed throughout 2010 that has resulted in changes to the RIP condition reporting method and specifically, the calculation of PCR. It was determined that a better representation of PCR could be achieved by modifying the relative impact certain distresses would have on the overall rating.

Through the use of HPMA data, it was noted that false failure indicators existed with the existing PCR model, and that it would be necessary to reduce their impact. The distresses affected in this way were Rutting and Roughness. Conversely, experience showed that roadways with extensive cracking present were often shown to have a high PCR. Therefore, the crack index models were adjusted to be more sensitive to changes in crack severity or quantity. It was also determined that these issues were not due to a problem with data acquisition (i.e. the RIP "van"), but with the way the collected data was processed. The final change was to provide guidance on when to use the Roughness Condition Index (RCI) in the PCR calculation. Roughness data is of little value to determining overall condition on routes that, due to their length or geometrics, have lower vehicle operating speeds. Therefore, in Cycle 5, only routes that have lengths of one half mile or greater and posted speed limits of 25 mph or greater will have RCI reported and included in the PCR calculations.

Additionally, methodologies were updated in 2013 for Manually Rated Routes (paved routes that the collection vehicle is unable to drive) as well as Parking Areas to provide more accurate condition data to the HPMA. These updated methodologies allow for the efficient assessment of pavement conditions using a visual inspection method to denote specific distresses. These distresses are indicative of current conditions, the causes for current and future deterioration, and identify the level of targeted repair and rehabilitation practices required.

The changes that were implemented were endorsed by management at both the FHWA and NPS. In order to show the effectiveness of these changes, several sites were ground truth tested in early 2014 to ensure that an improvement was achieved between the relationship of PCR and the actual Maintenance and Rehabilitation needs that were represented. The changes will allow greater use of RIP and HPMA data for not simply condition data reporting, but also as a reliable tool for project identification and selection.

Description of the Rating System

The Federal Highway Administration, National Park Service Road Inventory Program (NPS-RIP), collects roadway condition data on paved surfaces (asphalt, concrete, brick, and cobblestone) on roads, parkways, and parking areas in national parks nationwide. The road surface condition data is collected using an automated Data Collection Vehicle (DCV) and manually using Manually Rated Route (MRR) procedures. Roads having brick or cobblestone surfacing are not normally surveyed with the DCV, but are manually rated for condition rating.

The FHWA RIP is implemented based on the premise that an accurate pavement surface condition assessment can be accomplished using automated crack detection technology as applied to digital images. Various methods of pavement condition assessment have been developed over the years with varying degrees of accuracy and acceptance. The use of digital photography to record pavement images and subsequent crack detection and classification has undergone continuous improvements over the past decade. Digital cameras with increasingly superior resolution and high definition have become more affordable, and the proprietary programming code and algorithms have been improved in crack detection software.

With the use of quality digital photography and automated crack detection software, FHWA RIP is tasked with executing a pavement condition assessment on a network of roughly 5,700 miles of National Park Service roads and parkways. Because a subset of roads will be collected multiple times this cycle, the total collection length will be around 13,000 miles. Foremost in setting up the basis of pavement distress identification is employing the distress identification protocols used by FHWA. There is no single distress identification system that is universal among entities conducting a program of distress identification. For the purpose of the NPS RIP, FHWA employs distress identification protocols that are specific to this program.

FHWA has referenced the "Distress Identification Manual for the Long-Term Pavement Performance Program", Publication No. FHWA-RD 03-031, June 2003, as the point-of- reference for distress types on NPS pavement. In truth, the FHWA RIP distress types are similar to those described in the LTPP manual with some modifications. This document, "Distress Identification Manual for the NPS Road Inventory Program, Cycle 6, 2014-2020" was developed using the "Distress Identification Manual for the Long-Term Pavement Performance Program" as a guideline. Definitions of severity levels based on crack width contained in this document adhere to the LTPP Distress ID Manual. Modifications have been made to the definition of Alligator and Longitudinal Cracking and determination of Alligator Cracking severity. This manual also addresses Rutting and Roughness and its application to RIP.

Cycle 6 has launched in the spring of 2014 and will again comprise all parks, large and small, that are served by paved roads and/or parking areas. For Cycle 6, roughly 333 large and small parks will have all paved routes and parking areas collected at least once in the cycle, some will have multiple collections depending on the size of the park and the functional class of the route.

This "Distress Identification Manual for the NPS Road Inventory Program, Cycle 6, 2014-2020" will be used as a reference resource in crack detection and classification, determination of distress severity and extent, and in the calculation of distress index values for the FHWA RIP Cycle 6.


Explanation of the Condition Descriptions

In addition to the RIP Index changes that were implemented in Cycle 5, we will also aim to provide greater assistance in translating good/fair/poor categories into pavement needs categories. The PCR can be used to indicate the place in the Pavement Life Cycle and the types of treatments that should be considered now and into the future.

- Excellent/New: PCR of 95-100. Pavements in this range will require only spot repairs
- Good: PCR of 85-94. Pavements in this range will likely be candidates for preventive maintenance. Examples include Chip and Slurry Seals, Micro Surfacing and Thin Overlays.
- Fair: PCR of 61-84. Pavements in this range will likely be candidates of Light Rehabilitation (L3R). Examples include single-lift overlays up to 2.5 inches in total thickness, milling and overlays.
- Poor: PCR of 60 or below. Pavements in this range will likely be candidates of Heavy Rehabilitation or Reconstruction (H3R or 4R). Examples include Pulverization, Multiple Lift Overlays, and Reconstruction.

At this time, specific maintenance and rehabilitation activities should be evaluated and recommended at the project level. Site-specific conditions that influence treatment type should be determined based on performing a subsurface investigation and/or pavement condition survey, and not be based solely on RIP data. Additionally, RIP produces a snapshot of conditions the year in which the data was collected. For further information or to obtain additional PMS data from our (HPMA) please contact the Eastern Federal Lands pavement team.

Condition Categories and Treatments

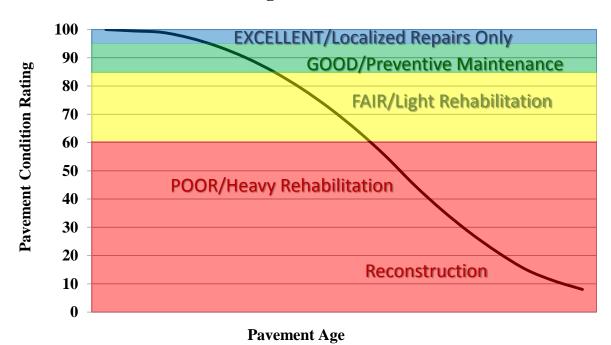

Description of Pavement Treatment Types

- 1. **Preventive Maintenance** is a planned strategy of cost-effective treatments to an existing roadway system and its appurtenances that preserves the system, retards future deterioration, and maintains or improves the functional condition of the system (without significantly increasing the structural capacity). Preventive maintenance is typically applied to pavements in good condition having significant remaining service life. As a major component of pavement preservation, preventive maintenance is a strategy of extending the service life by applying cost-effective treatments to the surface or near-surface of structurally sound pavements. Examples of preventive treatments include asphalt crack sealing, chip sealing, slurry or micro-surfacing, thin and ultrathin hot-mix asphalt overlay, concrete joint sealing, diamond grinding, dowel-bar retrofit, and isolated, partial and/or full-depth concrete repairs to restore functionality of individual slabs.
- 2. Pavement Rehabilitation consists of structural enhancements that extend the service life of an existing pavement and/or improve its load carrying capacity. Rehabilitation techniques include restoration treatments and structural overlays. Rehabilitation projects extend the life of existing pavement structures either by restoring existing structural capacity through the elimination of age-related, environmental cracking of embrittled pavement surface or by increasing pavement thickness to strengthen existing pavement sections to accommodate existing or projected traffic loading conditions. Two sub-categories result from these distinctions, which are directly related to the restoration or increase of structural capacity.
 - **Light Rehabilitation (L3R)** Examples include single-lift overlays up to 2.5 inches in total thickness and milling and overlays for flexible pavements
 - **Heavy Rehabilitation (H3R)** Requires rehabilitation with grade improvement. H3R stands for resurfacing, restoration, and rehabilitation projects. H3R projects typically involve multi-depth (overlays greater than 2.5 inches) pavement improvement work (short of full-depth replacement) and targeted safety improvements. H3R projects generally involve retention of the existing three-dimensional alignment.
- 3. **Reconstruction** (**4R**) is defined as the replacement of the entire existing pavement structure by the placement of the equivalent or increased pavement structure. Reconstruction usually requires the complete removal and replacement of the existing pavement structure. Reconstruction may utilize either new or recycled materials incorporated into the materials used for the reconstruction of the complete pavement section. Reconstruction is required when a pavement has either failed or has become functionally obsolete.

Appendix A

Methodology for Determining Condition Ratings with the Data Collection Vehicle (DCV)

Surface Distresses Identified by the Data Collection Vehicle

<u>Surface Condition Rating – SCR</u>

Surface distresses are measured in the primary lane only. In the classification and measurement of all paved surface condition data, results will be reported in the database in record intervals of 0.02 miles (105.6 feet) (smallest granularity) along the route.

Surface distresses and rutting are determined from digital images that provide both the longitudinal and transverse profile. The images also provide an elevation profile of the road, creating a 3-dimensional image of the paved surface.

- Transverse Cracks
- Longitudinal Cracks
- Alligator Cracks
- Patching/Potholes
- Rutting

Each of the five surface distresses is assigned a computed surface distress index

- Transverse Crack Index
- Longitudinal Crack Index
- Alligator Crack Index
- Patching/Pothole Index
- Rutting Index

Surface distress data are classified as listed above, measured for severity, and quantified for extent. Classification, severity, and extent of these five surface distresses comprise the three main elements for calculation of Surface Condition Rating (SCR).

In addition to the five surface distresses, a Structural Crack Index is computed, which is a combination of the Longitudinal Crack Index and the Alligator Crack Index. The Structural Crack Index is then used in lieu of the LC and AC indices to compute SCR.

Roughness Condition Index - RCI

Additional condition data measured by DCV (lasers and accelerometers)

• Roughness (IRI)

Roughness is measured by FHWA's DCV and reported as International Roughness Index (IRI) in inches/mile. Using IRI, the Roughness Condition Index (RCI) is computed.

Pavement Condition Rating - PCR

Using the SCR (computed from the five surface distresses) and the RCI, an overall Pavement Condition Rating (PCR) is computed. The formula for PCR is:

Asphalt PCR =
$$(0.60 * SCR) + (0.40 * RCI)$$

Concrete PCR = RCI

A detailed description of each distress index formula, roughness index formula, SCR and PCR is provided in this document.

Each classified surface distress will fall into one or more severity - LOW, MEDIUM, or HIGH based on criteria listed. For each severity, an extent is established based on the measured quantity of the distress within that severity. Within each severity individual distresses are assigned a Maximum Allowable Extent (MAE). For example, LOW severity transverse cracking may be allowed up to 21.1 cracks within a 0.02 mile interval before it reaches MAE and fails.

The index formulas are based on a scale of 0 to 100. A PCR index value of 100 would indicate a "new" road with no measurable distresses or rough ride. A PCR value of 60 is determined to be terminable serviceability and the road is considered failed. The range of index values with condition descriptors is:

POOR = (less than or equal to 60), FAIR= (61 – 84), GOOD= (85 - 94), EXCELLENT= (95 - 100)

Index values are generally computed based on cumulative deducts of the measured severities. As shown in the index formulas below, as any single severity reaches or exceeds MAE, the index computes to a value of 60 or less, and the road fails for that 0.02 interval.

Note: As a result of a unique combination of measured surface distresses and IRI, index values occasionally compute to less than 0 or greater than 100. In this instance, an index value less than 0 defaults to 0. Index values greater than 100 defaults to 100. For all indices, a higher value indicates a better road condition, and a lower value indicates a poorer road condition.

On the following page, Table 1 summarizes the different types of distresses measured.

ASPHALT-SURFACED PAVEMENT DISTRESS TYPES WITH RUTTING AND ROUGHNESS				
Distress Type	Units Of Measure	Converted To	Defined Severity Levels?	Measured By
Alligator Cracking	Square Feet	Percent of Lane Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Transverse Cracking	Linear feet	Number of Cracks Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Longitudinal Cracking	Linear feet	Percent of Lane Length Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Patching / Potholes	Square Feet	Percent of Lane Per 0.02 Mile	No	3 Dimensional pavement imaging system
Rutting	Inches	Rut Depth Per 0.02 Mile	Yes	3 Dimensional pavement imaging system
Roughness	IRI	*RCI Per 0.02 Mile	No	DCV – Lasers / Accelerometers

^{*}Note: Roughness is measured on concrete roadways, but surface distresses and rutting are not measured.

For concrete, PCR = RCI

Table 1. Distress summary

Alligator Cracking

Description:

Alligator cracking is considered a combination of fatigue and block cracking. It is a series of interconnected cracks in various stages of development. Alligator cracking develops into a many-sided pattern that resembles chicken wire or alligator skin. It can occur anywhere in the road lane. Alligator cracking must have a quantifiable area.

Severity Levels:

LOW

An area with little to no interconnecting cracks with no visible spalling. Cracks are less than or equal to a mean width of 0.25 in. (6mm). Cracks in the pattern are no further apart than 1 foot (0.328 m). May be sealed cracks with sealant in good condition and a crack width that cannot be determined.

MEDIUM

An area of interconnected cracks that form a complete pattern. Cracks may be slightly spalled. Cracks are greater than 0.25 in. (6 mm) but less than or equal to 0.75 in. (19 mm) or any crack with a mean width less than or equal to 0.75 in. (19 mm) and adjacent low severity cracking. Cracks in the pattern are no further apart than 6 in. (150 mm).

HIGH

An area of interconnected cracks forming a complete pattern. Cracks are moderately or severely spalled. Cracks are greater than 0.75 in. (19mm) or any crack with a mean width less than or equal to 0.75 in. (19mm) and adjacent medium to high severity random cracking.

A combination of observed crack width and crack pattern is used to determine overall severity of alligator cracking. Based on above description of each severity, the highest level of crack width and crack pattern determines overall severity as shown in Table 2.

ALLIGATOR CRACKING SEVERITY LEVELS				
	CRACK	CRACK CRACK PATTERN		
	SEVERITY	LOW	MED	HIGH
CD A CIZ	LOW	LOW	MED	HIGH
CRACK WIDTH	MED	MED	MED	HIGH
111 (11)	HIGH	HIGH	HIGH	HIGH

Table 2. Alligator Crack Severity Levels

Longitudinal Cracking

Description:

Longitudinal cracking occurs predominantly parallel to the pavement centerline. It can occur anywhere within the lane. Longitudinal cracks occurring in the wheelpath may be noteworthy.

Severity Levels:

LOW

Cracks with a mean width less than or equal to 0.25 in. (6 mm). This also includes sealed cracks with sealant in good condition and a width that cannot be determined.

MEDIUM

Cracks with a mean width greater than 0.25 in. (6 mm) but less than 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random low severity cracking.

HIGH

Cracks with a mean width greater than 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random medium to high severity cracking.

Transverse Cracking

Description:

Transverse cracking occurs predominantly perpendicular to the pavement centerline. It can occur anywhere within the lane.

Severity Levels:

LOW

Cracks with a mean width of less than or equal to 0.25 in. (6 mm). Sealed cracks with sealant in good condition and a width that cannot be determined.

MEDIUM

Cracks with a mean width greater 0.25 in. (6 mm) and less than or equal to 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random low severity cracking.

HIGH

Cracks with a mean width greater than 0.75 in. (19 mm). Also, any crack with a mean width less than 0.75 in. (19 mm) and adjacent random medium to high severity cracking.

Patching and Potholes

Description:

Patching is an area of pavement surface that has been removed and replaced with patching material or an area of pavement surface that has had additional patching material applied. Patching may encompass partial lane or full lane width. On full lane width patching; the total, contiguous length of patch may not exceed 0.100 mi. (0.161 km). (Any full-lane patch exceeding 0.100 mi. in length is considered a pavement change). Patching must have a quantifiable area.

Potholes are bowl-shaped holes of various sizes occurring in the pavement surface.

Manhole covers should not be rated as patches unless there is obvious patching around the manhole.

Speed bumps should not be rated as patches

Severity Levels:

There are no stratified severities for Patching and Potholes. They either are present or they are not.

RUTTING

Description:

Rutting is a longitudinal surface depression in the wheelpath.

Severity Levels:

LOW

Ruts with a measured depth of 0.20 inches to 0.49 inches Ruts less than 0.20 in. are not included in the distress calculations.

MEDIUM

Ruts with a measured depth of 0.50 inches to 0.99 inches

HIGH

Ruts with a measured depth greater than 1.00 inch

ROUGHNESS

Description:

Roughness is the measurement of the unevenness of the pavement in the direction of travel. It is measured in units of IRI (International Roughness Index), inches per mile, and is indicative of ride comfort.

Severity Levels:

There are no stratified severity levels for roughness. The roughness (or smoothness) of a road surface can be defined by IRI in the following table.

IRI DESCRIPTIONS		
Type of Road	Typical IRI (in/mile)	
New Road, no noticeable roughness	<90	
Small level of roughness	90 – 126	
Road of average roughness	126 – 190	
Road with above average roughness	190 – 253	
Road with severe roughness	253 – 380	
Nearly impassable	>380	

Table 3. International Roughness Index

Roughness Collection Parameters

On shorter roads with a lower speed limit the usefulness in collecting and reporting IRI is negligible. Lower, inconsistent speeds can lead to a less accurate IRI value. Therefore RIP has put in place the following protocols for reporting IRI.

International Roughness Index (IRI) is not reported on routes with the following criteria:

- Posted speed limit is less than 25 mph
- Length of route is less than 0.50 miles

When a collected route has a posted speed limit of at least 25 mph and length of at least 0.50 miles, IRI will be collected except on road sections where the speed is less than 20 mph

Other situations may arise where the speed and length factors are met, but reporting IRI could lead to an inaccurate PCR. RIP will determine whether or not it is reasonable to report IRI on these routes on a case by case basis.

Index Formulas

Note: All index formulas listed below contain MAE applicable to 0.02 mile (105.6 feet) interval.

Alligator Crack Index

AC INDEX =
$$100 - 40 * [(\%LOW / 35) + (\%MED / 15) + (\%HI / 5)]$$

Where:

The values %LOW, %MED and %HI report the percentage of the observed pavement (0.02 mile, primary lane) that contains alligator cracking within the respective severities. These values range from 0 to 100.

%LOW = Percent of total area (primary lane, 0.02 in length), low severity %MED = Percent of total area (primary lane, 0.02 in length), medium severity %HI = Percent of total area (primary lane, 0.02 in length), high severity

Percent of total area is computed as:

square foot area of alligator crack severity (0.02 mile)*(lane width)

In AC_INDEX, the denominators 35, 15, and 5 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 35% of low severity alligator cracking for a 0.02 interval before failure, 15% for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Longitudinal Crack Index

$$LC_{INDEX} = 100 - 40 * [(\%LOW / 175) + (\%MED / 75) + (\%HI / 25)]$$

Where:

The values %LOW, %MED, and %HI report the length of longitudinal cracking within each severity as a percent of the section length (0.02 mile, primary lane). These values are greater than or equal to 0 and can exceed 100.

%LOW = Percent of interval length (primary lane, 0.02 in length), low severity %MED = Percent of interval length (primary lane, 0.02 in length), medium severity %HI = Percent of interval length (primary lane, 0.02 in length), high severity

Percent of interval length is computed as:

length of respective longitudinal cracking (0.02 mile)*(105.6 ft.)

In LC_INDEX, the denominators 175, 75, and 25 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 175% of low severity longitudinal cracking for a 0.02 interval before failure, 75% for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Structural Crack Index

$$SC_{INDEX} = [100 - ((100 - AC_{INDEX}) + (100 - LC_{INDEX}))]$$

Structural Crack Index is a combination of Alligator Cracking and Longitudinal Cracking, and is used in the SCR formula in lieu of AC and LC separately.

Transverse Crack Index

$$TC_{INDEX} = 100 - 40 * [(LOW / 21.1) + (MED / 4.4) + (HI / 2.6)]$$

Where:

The values LOW, MED and HI report a count of the total number of transverse cracks (reported to three decimals) within each severity level, where one transverse crack is equal to the lane width. These values are greater than or equal to 0.

LOW = Number of cracks in interval (primary lane, 0.02 in length), low severity MED = Number of cracks in interval (primary lane, 0.02 in length), medium severity HI = Number of cracks in interval (primary lane, 0.02 in length), high severity

Number of cracks is computed as:

Total length of transverse cracks
Lane width

In TC_INDEX, the denominators 21.1, 4.4, and 2.6 are the Maximum Allowable Extents (MAE) for each severity. In other words, we will allow up to 21.1 low severity transverse cracks for a 0.02 interval before failure, 4.4 cracks for medium severity, and so on. As you can see, if any single severity reaches MAE the resulting index value is 60, or failure.

Patching Index

PATCH_INDEX =
$$(100 - 40) * (\% PATCHING / 80)$$

Where:

The value %PATCHING reports the percentage of the observed pavement (0.02 mile, primary lane) that contains patching/potholes. This value ranges from 0 to 100.

%PATCHING = Percent of total area (primary lane, 0.02 in length)

Percent of total area is computed as:

square foot area of patching/potholes (0.02 mile)*(lane width)

There are no severity levels for patching. It either exists or does not.

There are no severity levels for patching. It either exists or does not. In PATCH_INDEX, the denominator 80 is the Maximum Allowable Extent (MAE) for each severity. In other words, we will allow up to 80% patching for a 0.02 interval before failure. As you can see, if patching/potholes reaches MAE the resulting index value is 60, or failure.

Rutting Index

RUT_INDEX =
$$100 - 40 * [(\%LOW / 535) + (\%MED / 205) + (\%HI / 40)]$$

Where:

20 rut depth measurements are taken per 0.02 interval for each of 2 wheel paths (left and right), resulting in a total of 40 measurements taken for both wheel paths. Each wheelpath is analyzed independently for rut severities. The values %LOW, %MED and %HI report the percentage of the 40 measurements within that severity. These values range from 0 to 200.

%LOW = Percent of LOW ruts in left wheelpath based on 20 ruts, plus percent of LOW ruts in right wheelpath based on 20 ruts.

%MED = Percent of MED ruts in left wheelpath based on 20 ruts, plus percent of MED ruts in right wheelpath based on 20 ruts.

%HI = Percent of HI ruts in left wheelpath based on 20 ruts, plus percent of HI ruts in right wheel path based on 20 ruts.

Percent of rut measurements within each severity can also be computed as:

$$\frac{(total\ number\ of\ ruts\ within\ each\ severity\ in\ both\ wheelpaths)}{20}\times 100$$

In RUT_INDEX, the denominators 535, 205, and 40 are the Maximum Allowable Extents for each severity; Low, Medium, and High, respectively. Only the MAE for high severity rutting can fail a section, since 200% of *only* low severity ruts would yield a rut index of 85 and 200% of *only* medium severity ruts would yield a rut index of 61.

Roughness Condition Index (Asphalt)

$$RCI = 32 * [5 * (2.718282^{(-.0041 * AVG IRI)})]$$

Where:

The value AVG IRI reports the average value of the Left IRI and Right IRI measurements for the interval (0.02 mile, primary lane). This value can range from approximately 40 to 999.0.

Average IRI is computed as:

There is no applicable threshold for failure for this index.

Roughness Condition Index (Concrete)

$$RCI = (-0.0012)(IRI^2) + (0.0499)(IRI) + 99.542$$

For concrete, PCR = RCI

Surface Condition Rating Index

SCR = Lowest Index Value Of: [SC_INDEX, TC_INDEX, PATCH_INDEX, RUT_INDEX]

Note: The modified SCR equation above combines AC_INDEX and LC_INDEX, and considers that a single AC/LC index value of the Structural Crack Index (SC_INDEX). The lowest of the four computed index values (SC_INDEX, TC_INDEX, PATCH_INDEX, or RUT_INDEX) becomes the SCR.

Where:

See above for determinations of SC_INDEX, TC_INDEX, PATCH_INDEX and RUT_INDEX.

The threshold for failure for this index is SCR = 60.Data Collection Vehicle Subsystems

Data on paved roads is collected by FHWA using a Pathway Services Inc. Data Collection Vehicle (DCV), called a PathRunner. The DCV is driven in the primary-direction lane at posted speed limits and less.

Cameras

Forward-facing and rear-facing video is collected as jpeg digital imagery files at a frequency of every 26.4feet.

Two forward-facing cameras are mounted above the vehicle cab, one pointed straight ahead and the other to the right shoulder providing seamless roughly 120 degree viewing. A third camera is mounted in the rear of the vehicle, recording the left shoulder.

CAMERA SPECIFICATIONS TWO FORWARD / ONE REAR FACING CAMERA		
Camera lens/type	Prosilica GT 2750 (GigE Technology)	
Image format	*.jpg	
Image resolution	2750 x 2200, 18 frames/second	
Image pixel size	depends on distance	
Zoom ratio	16mm Fixed	
	Aperture Range F 1.8 – Infinity (P-Iris,	
Iris range	Automatic	

Pavement Imaging and Rutting

High resolution rutting data and surface imaging are collected in a single data stream using a three-dimensional (3D) pavement surface transverse profile data acquisition system. The 3D camera captures a laser line as it is projected over the pavement surface and uses the location of this line to measure the height deviations of the pavement surface. These height deviations can be used to calculate rutting in both wheelpaths. These deviations also provide a grayscale image detailing the change in height throughout the surface, i.e. providing depth measurements for cracking.

THREE-DIMENSIONAL PAVEMENT SURFACE AND TRANSVERSE PROFILE DATA ACQUISITION SYSTEM		
Surface Image Specifications		
Image size	1536 pixels/scan @3000 Hz	
Image width	4 meters (3950 mm nominal)	
Laser class	3B	
Power	16W (Two lasers @ 8W Ea)	
Vehicle speed limitations	62 mph	
Environment	Dry pavement, day or night	
Sensor size (approximate)	1536 pixels x 512 pixels	
Image display length	26.4 feet	
Rutting Specifications		
Reported rut depth units	Inches	
Vehicle speed limitations	Up to 62 mph	
Sampling rate	3000 profiles/second	
Transverse resolution	1536 points/profile	
Transverse field-of-view	14 feet	
Depth accuracy (nominal)	<1mm	
Environment	Dry pavement, day or night, above 32 degrees F	
Adherence to specifications	ASTM E1703M-95 (reapproved 2005)	

Distance Measuring Instrument (DMI)

The DMI (Distance Measuring Instrument) obtains road length measurements that are accurate to 0.15% for speeds up to 60 mph. The DMI is connected to the hub of the rear wheel on the driver's side, and is calibrated to the revolutions of the rear vehicle axle on a regular basis.

Roughness (IRI)

IRI SPECIFICATIONS		
Reported IRI units	Inches/mile	
Vehicle speed limitations	12-62 mph	
IRI equipment certification	Texas Transportation Institute (TTI)	
Wavelengths accommodated	0.5 feet to 300 feet	
IRI computed & reported	World Bank Technical Paper Number 46	
Environment	Dry pavement, day or night, above 32 degrees	
Adherence to specifications	ASTM E950 Class 1 & AASHTO M 328	

The collection system includes a South Dakota type laser profiler manufactured based on active Class 1 ASTM E950 standards. The dynamic profile of the pavement surface is collected from which the IRI roughness data is computed. The sensors include one accelerometer on each wheelpath, one height sensor (laser) on each wheelpath, and a distance transducer.

GPS & Inertial Systems

GPS is collected by an onboard system employing Omnistar real time correction and a spinning gyroscope to provide accurate positioning data in instances of satellite obstruction. All GPS coordinates are tied to an image and linear distance measurements.

GPS SPECIFICATIONS		
Static accuracy	Sub-meter	
Dynamic accuracy	2-3 meters	
Receiver	12 satellite tracking	
Coordinate system	Lat Lon WGS 84	
Environment	Day or night	
Cross-slope	± 1.75%	
Grade	± 1.75%	
Adherence to specifications	ASTM E1703M-95 (reapproved 2005)	

*NOTE – GPS accuracy is dependent on many different factors. Satellite constellation, tree coverage, GPS receiver quality, and real-time correction availability can all affect the locational and elevation accuracies. The elevation (z coordinate) accuracy is less dependable than locational or horizontal accuracy (x/y coordinates or latitude/longitude). In areas of heavy tree coverage or poor satellite constellations, elevation data can vary by as much as +/- 100 feet.

Appendix B

Methodology for Determining Condition Ratings Using Manual Rating Procedures

Description of Manual Rating Methods

In 2013, the Federal Highway Administration updated existing Manual Rating Procedures in an effort to better align pavement conditions for Manually Rated Routes and Parking with the Highway Pavement Management Application (HPMA). HPMA is the Pavement Management System used by the FHWA to store inventory and condition data from the Road Inventory Program (RIP) and forecast future performance using prediction models. HPMA uses pavement condition data (collected by the Road Inventory Program) to develop life cycles for pavements and recommend treatments to maximize useable pavement life while minimizing costs associated with maintenance and repair.

The Federal Highway Administration (FHWA) developed a set of manual rating methods for pavement that are appropriate for Federal Roadways. Two different methods were developed for linear roads and a separate method was developed for parking areas and nonlinear roads. These methods employ a 0 to 100 rating scale and improve consistency and objectivity in the manual evaluation of surface distresses. They are compatible with ratings that are collected by the automated Data Collection Vehicle (DCV).

- The first of the two manual evaluation methods for roads uses rating criteria to assign index values to each distress type based on a visual evaluation of severity and extent.
- The second manual evaluation method for roads is very time demanding and is best employed on only a select set of routes which may have the highest visitor use and require a more intensive assessment. This method will be used for the Manual Rating of Function Class 1, 2, 7, and 8 Roads. This method is based on measurements that are recorded for each instance of a surface distress. These measurements are converted into index values using conversion formulas.
- Parking areas and non-linear roads are rated similar to the first method shown above, however, there are some slight differences due to the non-linear nature.

The details and criteria used for each of these rating methods are outlined below.

Visual Inspection Method for Manually Rating Secondary Roads

The visual inspection method for manually rated roads uses condition rating criteria that have been developed by FHWA. This criteria is based on a visual evaluation of the severity and extent of distresses to determine the overall condition of the roadway. This method is used for secondary roads that are Functional Class 3, 4, 5, and 6. This constitutes the majority of manually rated roads collected by the Road Inventory Program.

Rating Section Lengths

For this method, Manually Rated Roads are rated in sections. These sections may be made based on length of changes in surface type or condition as described below. The ratings are then aggregated to give an overall rating for the Route:

- Rating sections should be no longer than 0.25 miles in order to keep the area being rated manageable.
- A new rating section may be started based on changes in condition, width, or surface type if these changes represent a significant portion of the route (are not isolated instances).
- If the road condition, width, and surface type remain constant then new sections do not need to be created unless the road exceeds 0.25 miles.

Rating Criteria

For this method, Manually Rated Roads are evaluated using a visual inspection of the six distress types listed below. Each distress is assigned one of five index values. An overall Surface Condition Rating (SCR) and Pavement Condition Rating (PCR) are calculated based on these index values.

- Alligator Cracking
 - o Rating based on percentage of road surface affected
- Longitudinal Cracking
 - o Rating based on severity level (crack width) and percentage of road section length of longitudinal cracks
- Transverse Cracking
 - o Rating based on crack width, crack spacing, and percentage of surface affected
- Patching
 - o Rating based on percentage of road surface affected
- Rutting
 - o Rating based on percentage of road section length affected by visible rutting (>1 inch depth) that requires remediation
- Roughness
 - o Manual assessments of roughness are not made due to the subjectivity of the measurement. Therefore, roughness is not incorporated into the PCR calculation of manually rated roads.

Concrete Routes also receive a PCR rating based on visual evaluation of the following six distress types.

- Slab Faulting at Joints
- Slab Cracking and breakup
- Surface Delamination and Pop-outs
- Joint Distresses
- Patching

Distress Measurement Method for Manually Rating Primary Roads

A more intensive and time demanding assessment than our standard method was developed for Primary roads that are functional class 1, 2, 7, or 8. These high visitation roads are usually accessible by the automated Data Collection Vehicle but in rare instances may need to be manually rated. The method developed is based on measuring each instance of a distress. These measurements are totaled over each section length being measured and are then converted into index values between 0 and 100 (100 being a road with no distress) using index formula equations outlined below. The goal of this method is to produce measured index values which are directly comparable to the automated DCV.

Rating Section Lengths

For the distress measurement method roads are broken into sections in order to rate. Distress measurements are totaled for each section separately in order to determine the index value for that particular section. The section length to be rated is determined based on the following rules:

- Rating sections are between 0.25 and 0.50 miles long
- A new rating section is created if there is a significant change in condition or pavement width
- If there are no significant changes in condition or pavement width, rating sections are broken at equal intervals, typically 0.50 miles

Manual Distress Measurements

Alligator Cracking

- Alligator cracking is measured by area (square feet). Instances of Alligator cracking are measured along the length and multiplied by the average width of the distressed area.
- The index for alligator cracking takes the total area of cracking compared to the interval length and converts it to a percentage. That percentage is then input into an index formula that yields a value between 0 and 100 (0 being the most distressed).
- Severity levels are not defined for manually measured Alligator cracks. The Alligator Crack Index formula is calculated based on an assumption of medium severity.

Longitudinal Cracking

- Longitudinal cracking (cracking in the direction parallel to the roadway) is measured by length (ft.).
- The index for longitudinal cracking takes the total length of cracking compared to the interval length and converts it to a percentage broken down by severity. That percentage is then input into a formula that yields a value between 0 and 100 (0 being the most distressed).
- Two severity levels are defined for manually measured Longitudinal Cracks. Lower severity cracks are those with a mean width of less than 0.25 inches. Sealed cracks with sealant in good condition are also considered lower severity. Higher severity cracks are those with a mean width of greater than 0.25 inches.

Transverse Cracking

- Transverse cracking (cracking in the direction perpendicular to the roadway) is measured by length (ft).
- The index for transverse cracking takes the total number of cracks (1 crack would encompass the full lane) broken down by severity. The total numbers of each severity are then put into a formula that yields a value between 0 and 100 (0 being the most distressed).
- Two severity levels are defined for manually measured Transverse Cracks. Lower severity cracks are those with a mean width of less than or equal to 0.25 inches. Sealed cracks with sealant in

good condition are also considered lower severity. Higher severity cracks are those with a mean width of greater than 0.25 inches.

Patching and Potholes

- Patching and Potholes are measured by area (square feet). Instances of Patching are measured along the length and multiplied by the average width of the patch.
- Instances of full lane width patching cannot be longer than 0.100 miles, otherwise is should be considered a pavement change rather than a distress.
- There are no stratified severities for Patching. It is either present or it is not.

Rutting

- Visible rutting is measured by length (ft.) in each wheel path. Only visible ruts are rated, which are ruts greater than 1 inch deep.
- All rutting recorded in a manual rating is considered to be high severity (> 1 inch). Lesser severities are generally not distinguishable in a visual inspection.

Roughness

• Manual assessments of roughness are not made due to the subjectivity of the measurement. Therefore, roughness is not incorporated into the PCR calculation of manually rated roads.

Index Formulas for Distress Measurement Method:

The method used to convert distress measurements into index values is shown below. The Surface Condition Rating and Pavement Condition Rating are calculated based on these index values.

Alligator Crack Index for Manual Rating:

AC INDEX =
$$100 - 40 * (\% ALLIGATOR / 15)$$

Where:

% ALLIGATOR = Percent of total area of section being rated that contains Alligator cracking.

Longitudinal Crack Index for Manual Rating:

$$LC_{INDEX} = 100 - 40 * [(\%LOW / 175) + (\%MED / 75)]$$

Where:

%LOW = Percent length of longitudinal cracks where crack width less than or equal to 0.25 inches

%HIGH = Percent length of longitudinal cracks where crack width greater than 0.25 inches

Transverse Crack Index for Manual Rating:

$$TC_{INDEX} = (100 - 40) * [(LOW / 21.1) + (MED / 4.4)]$$

Where:

LOW = Count of the total number of transverse cracks within the section length where one transverse crack is equal to the lane width and the crack width ≤ 0.25 inches HIGH = Count of the total number of transverse cracks within the section length where one transverse crack is equal to the lane width and the crack width ≥ 0.25 inches

Number of cracks is computed as:

Total length of transverse cracks/Lane width

Patching Index for Manual Rating:

Where:

%PATCHING = Percentage of pavement section that contains patching/potholes.

Rutting Index for Manual Rating:

$$RUT_INDEX = 100 - 40 * (\% RUTTING / 40)$$

Where:

%RUTTING = Percentage length of high severity rutting within the section being measured.

Method for Manually Rating Paved Parking Areas and Non-Linear Roads

Parking areas are evaluated based on a visual inspection using condition rating criteria that has been developed by FHWA. This criteria is based on a visual evaluation of the severity and extent of distresses to determine the overall condition of the parking area. This overall condition rating is linked to the level of repair and rehabilitation practices required.

A distress index is determined for each of the distresses listed below for Asphalt and Concrete Parking areas. The overall Pavement Condition Rating (PCR) of the parking lot is driven by the most severe distress present.

Rating Criteria:

Asphalt Parking Distress Types

- Alligator Cracking
 - o Rating based on percentage of road surface affected
- Longitudinal, Transverse and Block cracking
 - o Rating based on crack width, crack spacing, and percentage of surface affected
- Rutting and Distortions
 - o Rating based on percentage of road surface affected
- Hot Mix Asphalt Patches
 - o Rating based on overall percentage of HMA patches
- Potholes and Cold Patches
 - o Rating based on percentage of road surface affected
- Surface Raveling and Bleeding
 - o Rating based on percentage of road surface affected

Concrete Parking Distress Types

- Slab Faulting at Joints
 - o Rating based on height differential between adjacent slabs or pieces of broken slabs
- Slab Cracking and breakup
 - o Rating based on quantity of cracks and if slab is acting to able distribute load as designed
- Surface Delamination and Pop-outs
 - o Rating based on percentage of road surface affected to include pop-outs, spalls and surface delamination
- Joint Distresses
 - o Rating based on sealant condition and concrete distresses at/or adjacent to joints
- Patching
 - o Rating based on percentage of road surface affected

Curb Inspection and Treatments

During inspections of manually rated parking lots and routes, the curb reveal and overall curb condition are evaluated. The curb condition is used to determine a recommendation.

Curb Reveal

The vertical distance on the curb face from the gutter flow line or pavement surface to the top of curb. When resurfacing adjacent to curb, the resulting curb reveal should be no less than 4 inches. Additionally, when resurfacing adjacent to a gutter, the resulting pavement surface should be flush with the gutter pan. In cases where a resurfacing would violate either of these parameters, the surface may need to be milled or removed to adjust to these field conditions.

Curb Recommendations

The following treatment categories are based on the overall percentage of distresses along the entire curb structure for a specific pavement structure. Distresses include spalling, cracking, loss of material and any other damage which prevents the curb from conveying storm runoff or failing to perform in its intended function.

- Overall curb damage ranging 0%-5%:
 - o DO NOTHING
- Overall curb damage ranging 5%-20%
 - o LIGHT REPAIR
- Overall curb damage ranging 20%-50%
 - o MODERATE REPAIR
- Overall curb damage greater than 50%:
 - o REPLACE

GPS for Manually Rated Roads and Parking

GPS information for Manually Collected Cycle 6 Routes will be recorded using the latest hardware and software by TRIMBLE 6000 Series GeoXT. Cycle 6 GPS collection units will allow access to GPS and GLONASS, improving overall GPS reliability, accuracy and precision to submeter accuracy. Additionally, the new GPS units have an enhanced ability to collect accurate signals underneath tree cover or adjacent to buildings or natural terrain with extreme vertical gradations that typically reduce GPS accuracy. Trees and buildings create "satellite shadows", limiting the areas where you can reliably collect high-accuracy GPS data. The updated GPS receiver will deliver improved usable data under tree canopy or in natural or urban canyons. Routes that were previously collected accurately will not be recollected in Cycle 6.

TRIMBLE 6000 SERIES GeoXT GPS SPECIFICATIONS		
Receiver	Trimble Maxwell™ 6 GNSS chipset	
Channels	220 channels	
Systems	GPS / GLONASS / WAAS	
Accuracy	Sub-meter	
Operation Temperature	-20 °C to +60 °C (-4 °F to +140 °F)	
Cellular and Wireless	UMTS / HSDPA / GPRS / EDGE / Wi-Fi / Bluetooth	
Internal Still Camera w/ GEOTAG ability	Autofocus 5 MP (JPG) and WMV w/ Audio	

Appendix C Description of Cycle 6 Deliverables

Final Report Delivery

The Final Report will contain all data collected by Manual Inspection and the Data Collection Vehicle. All information provided in the Interim Report will be included in the Final report. Manually collected information reported in the Interim Report may be updated in the Final Report if pavement conditions have substantially changed between the Manual Inspection and Data Collection Vehicle Inspection or other unforeseen circumstances.

The final report will be released approximately 8 months after the Data Collection Vehicle completes its collection of that specific park.

Data included in the Final Report package consists of the following:

- Condition Photos: All photos taken during Cycle 6.
- **Data Video:** Data and video of each route collected by the DCV will viewable through PATHVIEW software. PATHVIEW Software and training will be provided to NPS personnel by Eastern Federal Lands.
- **GPS on All Rated Routes:** All GPS data collected from the DCV will be provided. Parking areas, some roads, and other paved areas that are not fully drivable with the DCV are collected manually by field technicians. GPS is collected for these routes using portable Trimble GPS units.
 - o GPS will be provided as Shapefiles and KMLs
 - o All GPS data related to road collection with be linear referenced to the collected length
- Geodatabase Background and Metadata: In addition to this park report, a geodatabase containing both tabular and spatial data specific to this park has been provided.
 - o All data disseminated in the preceding report has been obtained from the tables and fields within said geodatabase. The geodatabase can be referenced for tabular data via Microsoft Access or for both tabular and spatial data via ESRI's ArcGIS Suite of software which consists of; ArcMap, ArcCatalog and ArcExplorer.
 - o Consolidating the RIP data into one database creates a seamless relationship of tables and geographic data. It allows RIP to facilitate easier updates and enhancements in the future. A geodatabase can be thought of as simply a database containing spatial data. A complete and thorough description of the tables and fields contained within this geodatabase can be found in the metadata. The metadata is attached directly within the geodatabase and can be accessed via ESRI's ArcCatalog.
- **Report (RIP Report and Route ID):** A PDF report will be provided that includes a list of all routes and key data. Condition reports for each route will be included. All changes, additions and deletions to any route will be included in the report. Features along routes will not be collected in Cycle 6.

Partial DCV Collections

Additional Partial DCV Collections may be done on specific parks depending on their size and overall mileage of routes within its boundaries during Cycle 6. Parks with greater than 10 miles of paved roadways will receive at least one additional Partial DCV collection during Cycle 6. Data collected during these Partial DCV Collections will not result in the delivery of an additional report to the park.

Data collected by the DCV during Partial DCV Collection will be used to improve HPMA modeling by providing additional "snapshots in time" of park pavement conditions. This improved HMPA modeling will assist in the programing and budgeting of future projects which will help maximize the life of pavement infrastructures.

Instead of receiving a report of conditions collected during the Partial DCV collection, the park will receive a formal letter from the Road Inventory Program requesting coordination for the additional Partial DCV collection, identifying the dates of the Partial DCV Collection and will reinforce the purpose and importance of the Partial DCV Collection.

Appendix D Glossary of Terms and Abbreviations

Glossary of Terms and Abbreviations

TERM OR ABBREVIATION	DESCRIPTION OR DEFINITION
AC	Alligator Cracking
CRS	Condition Rating Sheets (Section 5)
Curb Recommendation	Curb remediation based on overall percentage of curb distress
Curb Reveal	Height of curb exposed from gutter flow line to top of curb
DCV	Data Collection Vehicle
Excellent	Excellent rating with an index value of 95 to 100
Fair	Fair rating with an index value from 61 to 84
FUNCT_CLASS	Functional Classification (see Route ID, Section 2)
Good	Good rating with an index value from 85 to 94
IRI	International Roughness Index
HPMA	Highway Pavement Management Application
Lane Width	Width from road centerline to fogline, or from centerline to edge- of-pavement when no fogline exists
LC	Longitudinal Cracking
MRR	Manually Rated Route
MRL	Manually Rated Line
MRP	Manually Rated Polygon
N/A	Not Applicable
NC	Not Collected
PATCH	Patching and Potholes
Paved Width	Width from edge-of-pavement to edge-of-pavement
PCR	Pavement Condition Rating
PKG	Parking Area
Poor	Poor rating with an index value of 0 to 60
RCI	Roughness Condition Index
SC	Structural Cracking
SCR	Surface Condition Rating
TC	Transverse Cracking