


The Road Inventory of Fort Raleigh National Historic Site FORA – 5185 Cycle 4





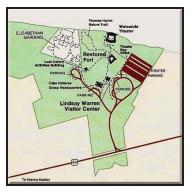

Prepared By: Federal Highway Administration Road Inventory Program Cycle 4



Fort Raleigh National Historic Site in North Carolina

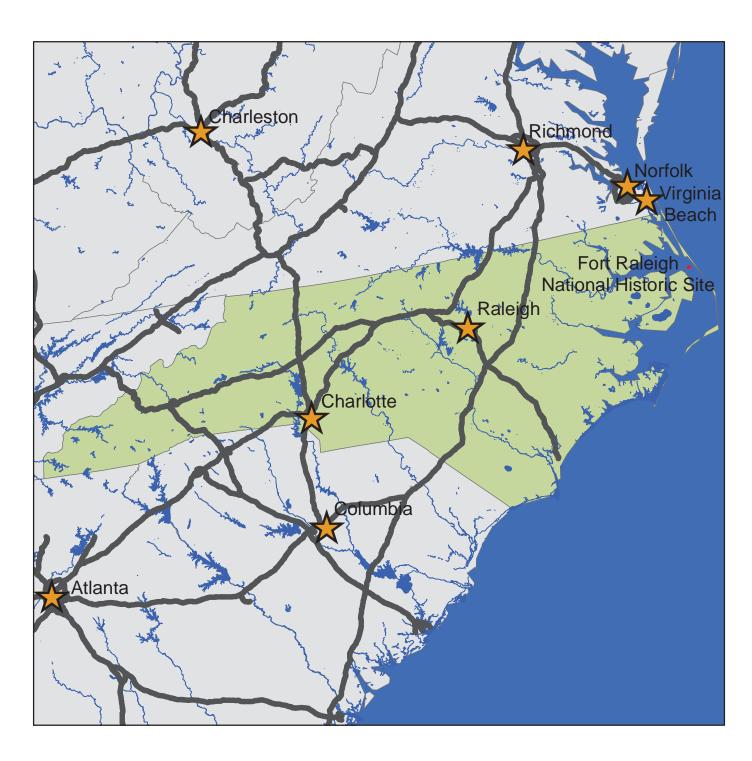




TABLE OF CONTENTS

	SECTION	PAGE
1.	INTRODUCTION	1-1
2.	PARK SUMMARY INFORMATION Paved Route Miles and Percentages by Functional Class and PCR ARAN Road Condition Summary Parkwide Condition Summary Cycle 2 vs Cycle 3 vs Cycle 4 Condition Comparisons	$ \begin{array}{r} 2 - 1 \\ 2 - 2 \\ 2 - 3 \\ 2 - 4 \end{array} $
3.	PARK ROUTE LOCATION / CONDITION MAPS Route Location Key Map Route Location Area Map Route Condition Key Map – PCR Mile by Mile Route Condition Area Map – PCR Mile by Mile	3-1 $3-2$ $3-3$ $3-4$
4.	PARK ROUTE INVENTORY Route Identification Report	4 – 1
5.	PAVED ROUTE CONDITION RATING SHEETS (CRS) CRS Pages	5 – 1
6.	MANUALLY RATED PAVED ROUTE CONDITION RATING SHEETS (MRR) MRR Pages	6 – 1
7.	PARKING AREA CONDITION RATING SHEETS Paved Parking Area Pages	7 – 1
8.	PARKWIDE / ROUTE MAINTENANCE FEATURES SUMMARIES Parkwide Maintenance Features Summary Route Maintenance Features Summary Structure List	$8-1 \\ 8-2 \\ 8-3$
9.	PARK ROUTE MAINTENANCE FEATURES ROAD LOGS Route Maintenance Features Road Logs	9 – 1
10.	APPENDIX A. Glossary of Terms and Abbreviations B. Description of Rating System C. General Information on RIP Systems D. Metadata	10 - 1 $10 - 2$ $10 - 8$



Section 1 Introduction

INTRODUCTION

Background: In 1976, the National Park Service (NPS) and the Federal Highway Administration (FHWA) entered into a Memorandum of Agreement (MOA), establishing the Road Inventory Program (RIP). In 1980, the NPS and the FHWA terminated the 1976 MOA and entered into a new MOA that provided for the completion of the initial phase of the RIP. The purpose of the RIP, per the 1980 MOA was to maintain and update RIP data in order to develop long-range costs and programs to bring National Park Service (NPS) roads up to, or to maintain, designated standards, and establish a maintenance management program.

The FHWA's Federal Lands Highway (FLH) was assigned the task of identifying condition deficiencies and corrective priorities along with associated corrective costs, inventorying maintenance features (e.g., culverts, signs, guardrail, etc.), summarizing the data and findings in a report and providing a photographic record of the road system.

The FLH completed the initial phase of the RIP in the early 1980's. As a result of this effort, each park received a RIP book, also known as the "Brown Book," that included the information collected during this initial RIP phase.

In an effort to maintain and update the RIP data, a cyclical data collection and reporting process was reestablished in the 1990's. The FLH completed two cycles of RIP data collection between 1994 and 2001. Cycle 1 was collected in 44 large parks from 1994 to 1996. This data was found to be unusable for comparison to future cycles. Cycle 2 data was collected from March 1997 to January 2001 in 79 large parks and 5 small parks containing 4,874 route miles. Each park received a copy of a Cycle 2 RIP Report, also known as the "Blue Book". Cycle 3 was completed from 2001 through 2004, and included data collection in all parks that contain pavement.

Since 1984, the RIP Program has been funded through the Federal Lands Highway Program's Park Roads and Parkways (PRP) Program. Currently, the NPS Washington Headquarters' Park Facility Management Division is responsible for coordinating the RIP program with the FLH. The FLH Washington office coordinates policy and prepares national reports and needs assessment studies for congress.

In 1998, the Transportation Equity Act for the 21st Century (TEA-21) amended Title 23 U.S.C., and inserted Section 204(a)(6) which requires the Federal Highway Administration and the National Park Service, to develop, by rule, a Pavement Management System (PMS) for the park roads and parkways serving the National Park System. As a result of the requirements in TEA-21, the NPS and FHWA are in the process of developing a PMS. The PMS will assist the decision-makers in effectively spending limited PRP Program funds. The PMS

1 - 1

will provide information for planning and programming road maintenance, rehabilitation, and reconstruction activities. RIP data will provide the basic information for this system.

Key information included in the RIP is the mileage inventory and condition assessments accomplished by the RIP Program. The mileage and condition data are used in the current allocation formula of PRP Program funds.

RIP Cycle 4: Cycle 4 data collection was initiated in spring 2006, where 86 large parks, consisting of 5,553 route miles and 6,232 paved parking areas, were selected as a representative sample of the entire NPS paved road network. Cycle 4 is scheduled for completion in spring 2009 and will serve the PMS in further development of its pavement preservation techniques.

In the Cycle 4 Reports, a general condition rating of excellent, good, fair and poor is ascribed to each one-mile section of paved roadway, and to each paved parking area. This condition rating system provides a realistic means of assessing the general funding needs for road improvements. Along with these descriptive condition ratings, a numerical rating between 0 and 100 is ascribed to each mile of road and to each parking area. This numerical rating is called a Pavement Condition Rating (PCR). The PCR rating system is described in Section 10 of this report.

All of the fieldwork required for obtaining inventory, condition, and maintenance feature information is coordinated with each park and the regional offices to ensure that the information in the RIP reports is accurate.

The FLH is responsible for all the data presented in this report. Anyone having questions or comments regarding the contents of this report is encouraged to contact the FHWA RIP Coordinator. It is our aim to provide exceptional customer satisfaction in our delivery of the RIP program.

The FHWA RIP Team

FHWA/EFLHD 21400 Ridgetop Circle Sterling, VA 20166 (703) 404-6371 FHWA/CFLHD 12300 West Dakota Ave. Lakewood, CO 80228 (720) 963-3560




Section 2
Park Summary Information

FORA: PAVED ROUTE MILES AND PERCENTAGES BY FUNCTIONAL CLASS AND PCR

		F	avement C	ondition R	ating (PCF	₹)			
	Poor (<=60)	Fair (6	1-84)	Good	(85-94)	Excellent	TOTAL	
F.C.	MILES	%	MILES	%	MILES	%	MILES	%	MILES
1	0.02	1.26%	0.39	24.53%	0.12	7.55%	0.28	17.61%	0.81
2									
3									
4									
5			0.24	15.09%	0.25	15.72%	0.29	18.24%	0.78
6									
7									
8									
Totals	0.02	1.26%	0.63	39.62%	0.37	23.27%	0.57	35.85%	1.59

FORA: ARAN ROAD CONDITION SUMMARY

ROUTE NUMBER	ROUTE NAME		ROUTE LENGTH		AVERAGE SURFACE CONDITION RATING (SCR)	AVERAGE PAVEMENT CONDITION RATING (PCR)
0010	FR RD FORT RALEIGH ROAD	1	0.51	ASPHALT	84	84
0011	FR RD NATIONAL PARK DRIVE	1	0.30	ASPHALT	83	84
0400	FR RD THEATER ACCESS ROAD	5	0.11	ASPHALT	82	82
0401	FR RD PEAR PAD ROAD	5	0.55	ASPHALT	92	92
0404	FR RD WATER TOWER ROAD	5	0.12	ASPHALT	79	75

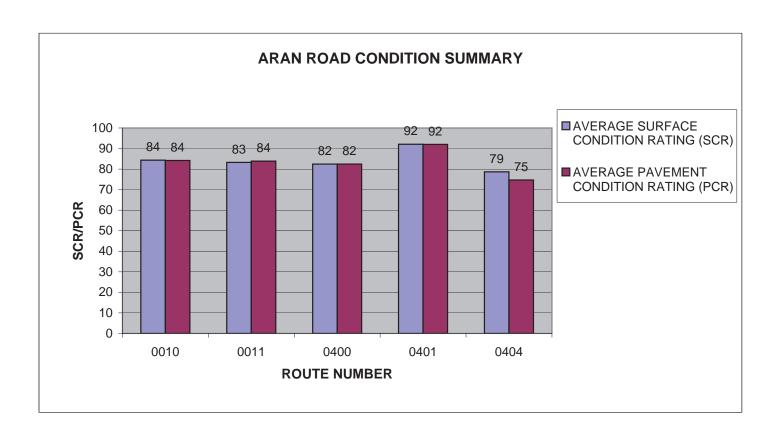


FORA: PARKWIDE CONDITION SUMMARY

**AVERAGE	*AVERAGE	*AVERAGE		*AVERAGE	*AVERAGE	*AVERAGE	
PAVEMENT	ROUGHNESS	SURFACE		ALLIGATOR	LONGITUDINAL	TRANSVERSE	*AVERAGE
CONDITION	CONDITION	CONDITION	*AVERAGE	CRACKING	CRACKING	CRACKING	PATCHING
RATING (PCR)	INDEX (RCI)	RATING (SCR)	RUT INDEX	INDEX	INDEX	INDEX	INDEX
87	87	87	90	100	99	98	100

^{**} PCR Index is based on all ARAN-driven roads, parking areas, and manually rated routes.


^{*} Index values are based on ARAN-driven roads only.

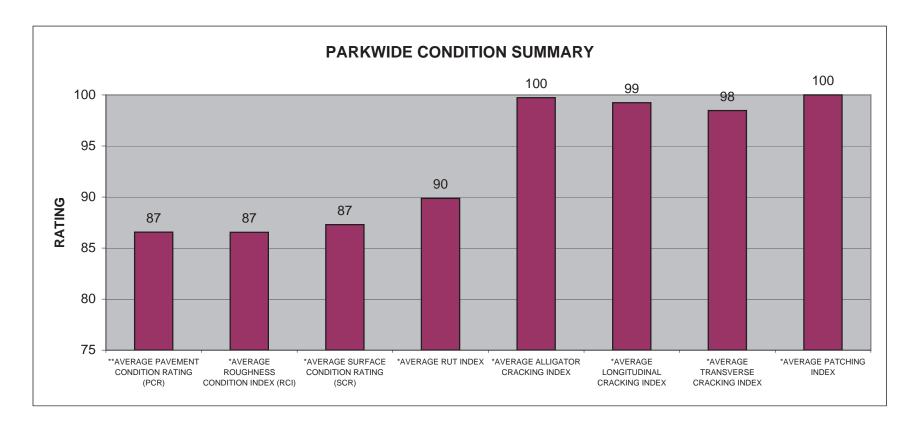



Data Collected 03/18/2007 2-3

FORA: CYCLE 2 vs CYCLE 3 vs CYCLE 4 CONDITION COMPARISONS

				PAVEMENT CONDTION RATING (PCR)				SURFACE CONDITION RATING (SCR) ROUGHNESS CONDITION INDEX (RCI)									
ROUTE NUMBER	PAVED MILES	FROM MILEPOST	TO MILEPOST	CYCLE 2	CYCLE 3	CYCLE 4	PERCENT CHANGE	CYCLE 2	CYCLE 3	CYCLE 4	PERCENT CHANGE		CYCLE 2	CYCLE 3	CYCLE 4	PERCENT CHANGE	COMMENT
0010	0.51	0.00	0.51	N/A	87	84	-3%	N/A	85	84	-1%		N/A	94	83	-12%	
0011	0.30	0.00	0.30	N/A	83	84	+1%	N/A	80	83	+4%		N/A	88	81	-8%	
0400	0.11	0.00	0.11	N/A	N/A	82	N/A	N/A	N/A	82	N/A		N/A	N/A	N/A	N/A	Route not collected in Cycle 3. No RCI collected in Cycle 4.
0401	0.55	0.00	0.55	N/A	82	92	+12%	N/A	78	92	+18%		N/A	93	93	0%	
0404	0.12	0.00	0.12	N/A	60	75	+25%	N/A	64	79	+23%		N/A	30	52	+73%	

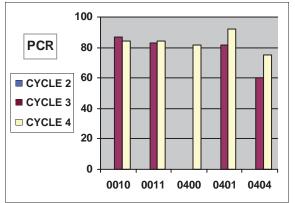

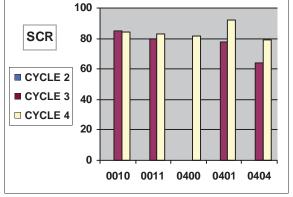

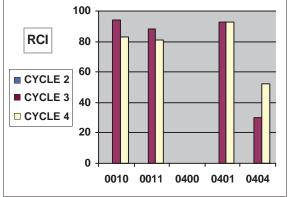


Cycle 4 Data Collected 3/18/2007 - 3/18/2007

Page 2 - 4



Section 3
Park Route Location / Condition
Maps

Fort Raleigh National Historic Site Route Location Map Key Map

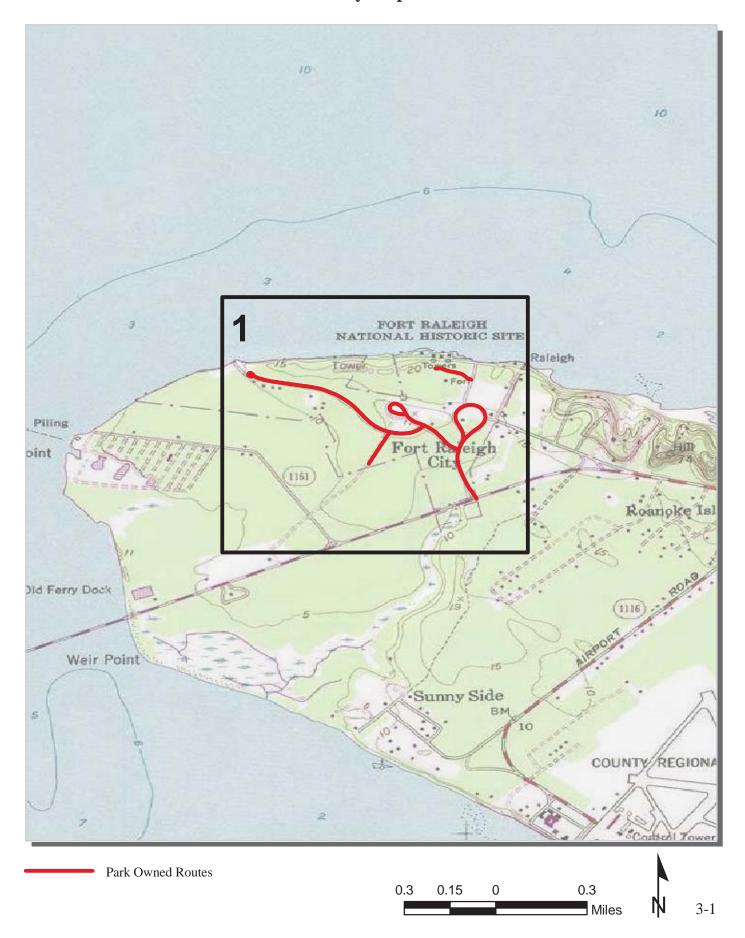


Fort Raleigh National Historic Site **Route Location Map** Area 1



Unique colors used to differentiate routes

Fort Raleigh National Historic Site Route Condition Map PCR - Mile by Mile Key Map

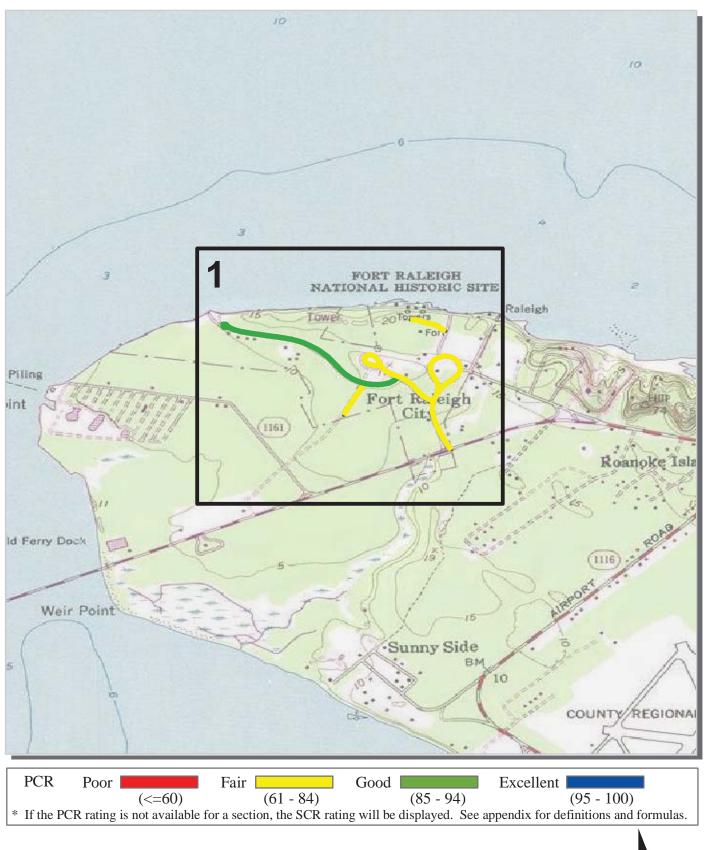

Fort Raleigh National Historic Site Route Condition Map PCR - Mile by Mile Area 1





Section 4
Park Route Inventory

NPS/RIP Route ID Report

Road Inventory Program 06/09/2008

(Numerical By Route #)

Shading Color Key: Red text denotes approx. mileage White = Paved Routes, ARAN Driven

Yellow = Unpaved Routes, ARAN not Driven

** Unpaved Routes displayed on report were obtained from FMSS database and not inventoried by Road Inventory Program (RIP)

Blue = All Paved Parking Areas

Green = All Unpaved Parking Areas

Page 1 of 3

Grey = Paved Routes, ARAN not Driven

Black = Paved State, Local or Private non-NPS Routes, ARAN Driven

=

= Concession Route Flag ON

FORA

Rte. No.	FMSS No.	Concess Route	Route Name	Route De From	scription To	Maint. District	Paved Miles	Un- Paved Miles	Total Route Length	Func. Class	Rte. Lanes	Manual Rated SQ/FT	Surf. Type	Area Maps
0010	29869		FR RD FORT RALEIGH ROAD	FROM STATE HIGHWAY 64	TO END OF LOOP	FORT RALEIGH	0.510	0.000	0.510	1		0	AS	1
0011	29868		FR RD NATIONAL PARK DRIVE	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.17 (ON LEFT)	TO END OF LOOP	FORT RALEIGH	0.300	0.000	0.300	1		0	AS	1
0400	104977		FR RD THEATER ACCESS ROAD	FROM ROUTE 0903 AT NORTHWEST CORNER	TO END AT THEATER TURNAROUND AREA	FORT RALEIGH	0.110	0.000	0.110	5		0	AS	1
0401	29866		FR RD PEAR PAD ROAD	FROM ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.13 (ON LEFT)	TO END OF LOOP	FORT RALEIGH	0.550	0.000	0.550	5		0	AS	1
0404	29831		FR RD WATER TOWER ROAD	FROM ROUTE 0401 (FR RD PEAR PAD ROAD) AT MP 0.09 (ON LEFT)	TO END AT SHED ON LEFT	FORT RALEIGH	0.120	0.000	0.120	5		0	AS	1
0405	104940		FR RD THEATER BACKSTAGE ACCESS ROAD	FROM END OF ROUTE 0400	TO THEATER BACKSTAGE	FORT RALEIGH	0.000	0.050	0.050	5		0	GR	
0900ZZ	104946		FR RD VISITOR CENTER PARKING AREAS	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.34 (ON RIGHT)	TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.47 (ON RIGHT)	FORT RALEIGH	0.000	0.000	0.000			20,844	AS	1
0901	93047		FR RD GROUP HEADQUARTERS PARKING	FROM ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.08 (ON RIGHT)	TO ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.12 (ON RIGHT)	FORT RALEIGH	0.000	0.000	0.000			12,548	AS	1
0902	93046		FR RD MAINTENANCE AREA PARKING	FROM ROUTE 0401 (FR RD PEAR PAD ROAD) AT MP 0.29 (ON LEFT)	TO PARKING	FORT RALEIGH	0.000	0.000	0.000			32,154	AS	1
0903	89488		FR RD THEATER PARKING	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.30 (ON RIGHT)	TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.37 (ON RIGHT)	FORT RALEIGH	0.000	0.000	0.000			190,716	AS	1
0904	93048		FR RD ELIZABETHAN GARDEN PARKING	FROM ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.24 (ON RIGHT)	TO PARKING	FORT RALEIGH	0.000	0.000	0.000			15,869	AS	1
0905			ELIZABETHAN GARDEN MAINTENANCE FACILITY	FROM ROUTE 0401 (FR RD PEAR PAD ROAD) AT MP 0.28 (ON RIGHT)	TO MAINTENANCE FACILITY	FORT RALEIGH	0.000	0.000	0.000			1,474	AS	1
0907	104741		FR RD FREEDMAN'S COLONY PARKING	FROM STATE HIGHWAY 64	TO PARKING	FORT RALEIGH	0.000	0.000	0.000			22,500	GR	

NPS/RIP Route ID Report

Road Inventory Program 06/09/2008 (Numerical By Route #) Page 2 of 3

Shading Color Key: Red text denotes approx. mileage White = Paved Routes, ARAN Driven

Yellow = Unpaved Routes, ARAN not Driven

Blue = All Paved Parking Areas

Green = All Unpaved Parking Areas

Grey = Paved Routes, ARAN not Driven

Black = Paved State, Local or Private non-NPS Routes, ARAN Driven

= Concession Route Flag ON

** Unpaved Routes displayed on report were obtained from FMSS database and not inventoried by Road Inventory Program (RIP)

SUMMARY TOTALS FOR FORT RALEIGH NATIONAL HISTORIC SITE												
ROUTE TOTAL	<u>s</u>		LANE MIL	E TOTALS		CONCESSION TOTALS						
ARAN Driven Route Miles	ARAN Driven Route Miles 1.590				2.922		Concessi	e Miles	0.000			
All Paved Route Miles	1.590	Paved	Parking Lane	Miles	4.711		Concession	Unpaved Rout	e Miles	0.000		
All Unpaved Route Miles	0.050	Pa	Paved MRR Lane Miles 0.0			Concession Paved Parking Area SQFT				0		
TOTAL PARK ROUTE MILES	1.640	TOTAL	PAVED LANE N	1ILES	7.633	Concession Unpaved Parking Area SQFT				0		
All Manually Rated Roads (SQFT)	0						R SQFT	0				
PARKING AREA TO	TALS	WEIGHTED AVERAGE PARK VALUES										
All Paved Parking (SQFT)	273,605	PCR (Rating)	SCR (Rating)	RCI (Rating)	RUT (Index)	AC (Index)	LC (Index)	TC (Index)	PATCH (Index)	PCR (Concession)		
All Unpaved Parking (SQFT)	22,500	86.56	87.30	86.54	89.87	99.73	99.24	98.47	100.00	- `		
TOTAL ALL PARKING (SQFT)			00.54	05.07				100.00	N/A			

NPS/RIP Route ID Report

Road Inventory Program 06/09/2008 (Numerical By Route #) Page 3 of 3

Shading Color Key: Red text denotes approx. mileage White = Paved Routes, ARAN Driven

Yellow = Unpaved Routes, ARAN not Driven

Blue = All Paved Parking Areas

Green = All Unpaved Parking Areas

Grey = Paved Routes, ARAN not Driven

Black = Paved State, Local or Private non-NPS Routes, ARAN Driven

.

= Concession Route Flag ON

General Park Road Functional Classification Table

Class 1	Principal Park Road/Rural Parkway (Public Roads)	Roads which constitute the main access route, circulatory tour	, or thoroughfare for park visitors.
	Route Numbers 1 - 99. Note: Rural parkways (e.	.g. Natchez Trace) are numbered 1 - 9.	State Routes Inventoried for Park. Route Numbers 5000-5999

- Class 2 Connector Park Road (Public Roads) Roads which provide access within a park to areas of scenic, scientific, recreational or cultural interest, such as overlooks, campgrounds, etc. Route Numbers 100-199.
- Class 3 Special Purpose Park Road (Public Roads) Roads which provide circulation within public areas, such as campgrounds, picnic areas, visitor center complexes, concessionaire facilities, etc. These roads generally serve low-speed traffic and are often designed for one-way circulation. Route Numbers 200-299.
- Class 4 Primitive Park Roads (Public Roads) Roads which provide circulation through remote areas and/or access to primitive campgrounds and undeveloped areas. These roads frequently have no minimum design standards and their use may be limited to specially equipped vehicles. Route Numbers 200-299.
 Note: Functional Classes 3 and 4 have the same route numbers because, historically, they were numbered similarly.
- Class 5 Administrative Access Road (Administrative Roads) All public roads intended for access to administrative developments or structures such as park offices, employee quarters, or utility areas. Route Numbers 400-499.
- Class 6 Restricted Road (Administrative Roads) All roads normally closed to the public, including patrol roads, truck trails, and other similar roads. Route Numbers 400-499.

 Note: Functional Classes 5 and 6 have the same route numbers because historically they were numbered similarly and often there is little distinction between these routes. For example, because utility areas and employee housing are often closed to the public, this restriction would result in classification of FC 6 rather than FC 5.
- Class 7 Urban Parkway (Urban Parkways and City Streets) These facilities serve high volumes of park and non-park related traffic and are restricted, limited-access facilities in an urban area. This category of roads primarily encompasses the major parkways which serve as gateways to our nation's capital. Other major park roads or portions thereof, however, may be included in this category. Route Numbers 1-9.
- Class 8 City Streets (Urban Parkways and City Streets) City streets are usually extensions of the adjoining street system that are owned and maintained by the National Park Service. The construction and/or reconstruction should conform with accepted local engineering practice and local conditions. Route Numbers 600-699.

A park road system contains those roads within or giving access to a park or other unit of the NPS which are administered by the NPS, or by the Service in cooperation with other agencies. The assignment of a functional classification (FC) to a park road is not based on traffic volumes or design speed, but on the intended use or function of that road or route.

The historic route numbering system also included a 300 number series for interpretive roads, and a 500 series for one-way roads. There are approximately 250 roads nationwide which are designated by the 300 and 500 series. The numbers for these roads will be maintained for reporting consistency. However, since these interpretive and one-way routes are not as clearly tied to a specific functional class, the 300 and 500 series will be discontinued for future use.

5000 route numbers are assigned to Non-NPS Routes that are State, County or City owned which border, traverse, or provide access to Park Facilities or Assets. 5000 Routes are driven for GPS, Video Log and Road Features only.

Surface Type Abbreviations:

- **AS Asphaltic Concrete Pavement**
- **CO Portland Cement Concrete Pavement**
- **BR** Brick or Pavers Road Bed
- CB Cobble Stone Road Bed
- GR Gravel Road Bed
- SA Sand Road Bed
- NV Native or Dirt Material Road Bed
- **OT Other Materials Road Bed**

^{**} Unpaved Routes displayed on report were obtained from FMSS database and not inventoried by Road Inventory Program (RIP)

NPS/RIP Subcomponent Details for FORA

Road Inventory Program 06/09/2008 (Numerical By Subcomponent #) Page 1 of 1

Shading Color Key: Red text denotes approx. mileage White = Paved Routes, ARAN Driven Yellow = Unpaved Routes, ARAN not Driven

** Unpaved Routes displayed on report were obtained from FMSS database and not inventoried by Road Inventory Program (RIP)

lue = All Paved Parking Areas

Green = All Unpaved Parking Areas

Grey = Paved Routes, ARAN not Driven

Black = Paved State, Local or Private non-NPS Routes, ARAN Driven

= Concession Route Flag ON

= Subcomponent Flag ON


FORA

Asset E	sset Entered in FMSS System										
Rte. FMSS & Route Name From To						Concess Route	Func. Class	Paved Miles	Un- Paved Miles	Total Route Length	Manual Rated SQ/FT
0900ZZ	104946		FR RD VISITOR CENTER PARKING AREAS	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.34 (ON RIGHT)	TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.47 (ON RIGHT)			0.00	0.00	0.00	20,844

Asset F	Asset FORA-0900ZZ Subcomponent Breakdown										
Rte.	FMSS	d E		Route De	escription	ncess ute	Jc. Ss	Paved	Un- Paved	Total Route	Manual Rated
No.	No.	Sub	Route Name	From	То	Con	Func. Class	Miles	Miles	Length	SQ/FT
0900AZ	104946		FR RD VISITOR CENTER LOOP PARKING A	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.43 (ON RIGHT)	TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.47 (ON RIGHT)			0.00	0.00	0.00	9,350
0900BZ	104946		FR RD VISITOR CENTER LOOP PARKING B	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.38 (ON RIGHT)	TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.41 (ON RIGHT)			0.00	0.00	0.00	7,685
0900CZ	104946		FR RD VISITOR CENTER LOOP PARKING C	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.34 (ON RIGHT)	TO PARKING			0.00	0.00	0.00	3,809




Section 5
Paved Route Condition Rating Sheets
(CRS)

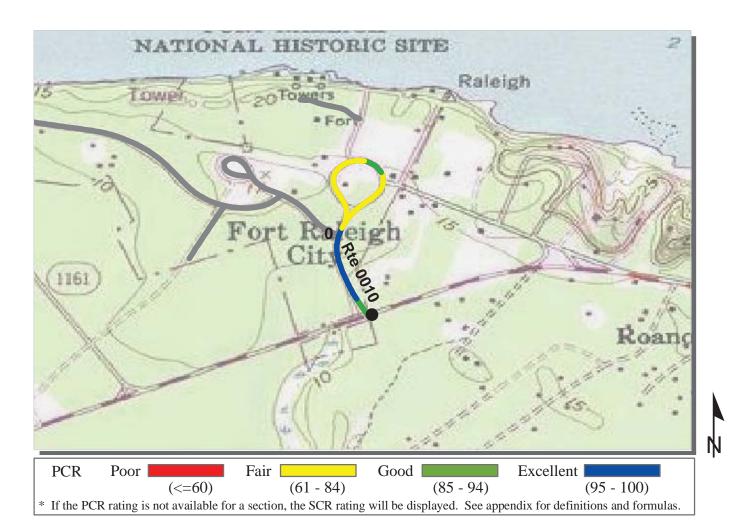

ROUTE: 0010 FR RD FORT I	RALEIGH ROAD	TOTAL LENGTH: 0.51 Miles						
Section Number	0							


Section Number	0							
Section Length (mi)	0.51							
Traffic AADT SADT ADT Date	Traffic data may be found at www.efl.fhwa.dot.gov Click on PROGRAMS / NPS Traffic Data (Note: Not all parks have traffic data)							
Cross Section Information								
Number of Lanes	2							
Paved Width (ft)	26							
Lane Width (ft)	15							
Shoulder Width Right (ft)**	0							
Shoulder Width Left (ft)**	4							
Roadway Condition Information								
SCR (Surface Condition Rating)	84							
PCR (Pavement Condition Rating)	84							
Distress Index Values								
Alligator Cracking Index	100							
Longitudinal Cracking Index	99							
Tranverse Cracking Index	98							
Patching Index	100							
Rutting Index	87							
Roughness Condition Index (RCI)	83							

^{**} Shoulder widths are measured from video at 0.50 mile intervals along route tangents. Visibility of actual shoulders in video images may affect accuracy of measured shoulder widths.

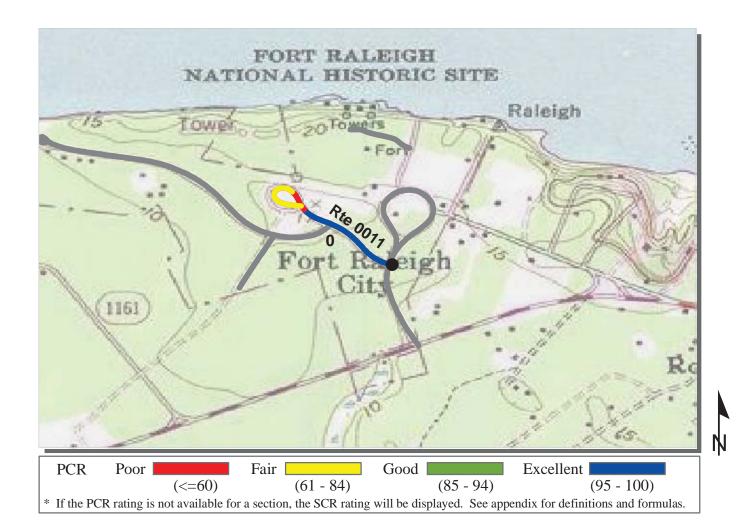


ROUTE: 0011 FR RD NATIONAL	PARK DRIVE	<u>C</u>	TO	TAL LENGT	H: 0.30 Miles
Section Number	0				
Section Length (mi)	0.30				
Traffic AADT SADT ADT Date	Traffic data may be found at www.efl.fhwa.dot.gov Click on PROGRAMS / NPS Traffic Data (Note: Not all parks have traffic data)				
Cross Section Information					
Number of Lanes	2				
Paved Width (ft)	23				
Lane Width (ft)	11				
Shoulder Width Right (ft)**	8				
Shoulder Width Left (ft)**	7				
Roadway Condition Information					
SCR (Surface Condition Rating)	83				
PCR (Pavement Condition Rating)	84				
Distress Index Values					
Alligator Cracking Index	99				
Longitudinal Cracking Index	99				
Tranverse Cracking Index	98				
Patching Index	100				
Rutting Index	87				
Roughness Condition Index (RCI)	81				

^{**} Shoulder widths are measured from video at 0.50 mile intervals along route tangents. Visibility of actual shoulders in video images may affect accuracy of measured shoulder widths.

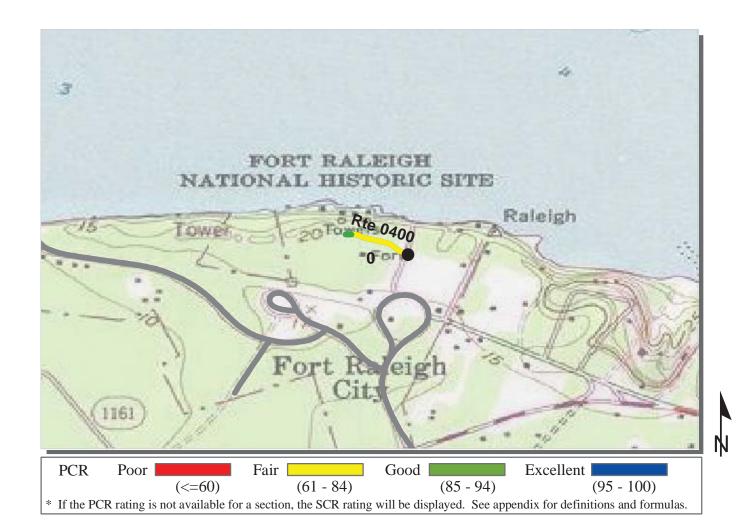


ROUTE: 0400 FR RD THEATER A	CCESS ROA	D	TO	TOTAL LENGTH: 0.11 Miles		
Section Number	0					
Section Length (mi)	0.11					
Traffic AADT SADT ADT Date	Traffic data may be found at www.efl.fhwa.dot.gov Click on PROGRAMS / NPS Traffic Data (Note: Not all parks have traffic data)					
Cross Section Information						
Number of Lanes	1					
Paved Width (ft)	13					
Lane Width (ft)	13					
Shoulder Width Right (ft)**	4					
Shoulder Width Left (ft)**	3					
Roadway Condition Information						
SCR (Surface Condition Rating)	84					
PCR (Pavement Condition Rating)	84					
Distress Index Values						
Alligator Cracking Index	98					
Longitudinal Cracking Index	98					
Tranverse Cracking Index	98					
Patching Index	100					
Rutting Index	89					
Roughness Condition Index (RCI)	NC					

^{**} Shoulder widths are measured from video at 0.50 mile intervals along route tangents. Visibility of actual shoulders in video images may affect accuracy of measured shoulder widths.

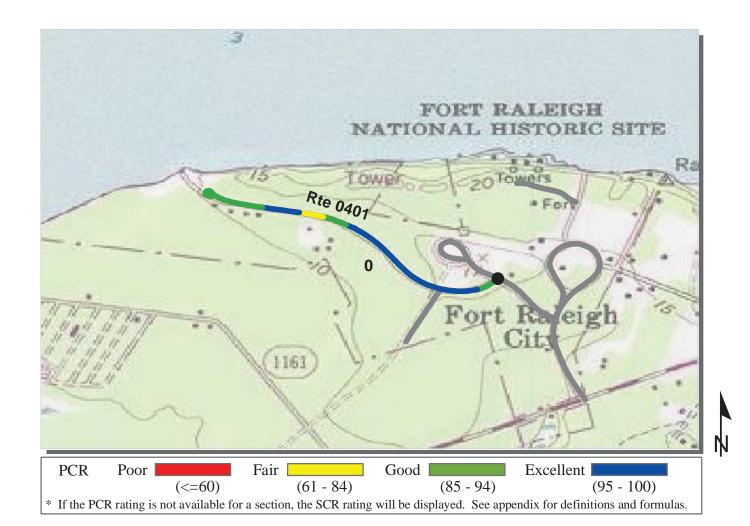

ROUTE: 0401 FR RD PEAR PAD R	OAD		TO	TOTAL LENGTH: 0.55 Miles		
Section Number	0					
Section Length (mi)	0.55					
Traffic AADT SADT ADT Date	Traffic data may be found at www.efl.fhwa.dot.gov Click on PROGRAMS / NPS Traffic Data (Note: Not all parks have traffic data)					
Cross Section Information						
Number of Lanes	2					
Paved Width (ft)	21					
Lane Width (ft)	11					
Shoulder Width Right (ft)**	3					
Shoulder Width Left (ft)**	4					
Roadway Condition Information						
SCR (Surface Condition Rating)	92					
PCR (Pavement Condition Rating)	92					
Distress Index Values						
Alligator Cracking Index	100					
Longitudinal Cracking Index	100					
Tranverse Cracking Index	100					
Patching Index	100					
Rutting Index	93					
Roughness Condition Index (RCI)	93					

^{**} Shoulder widths are measured from video at 0.50 mile intervals along route tangents. Visibility of actual shoulders in video images may affect accuracy of measured shoulder widths.

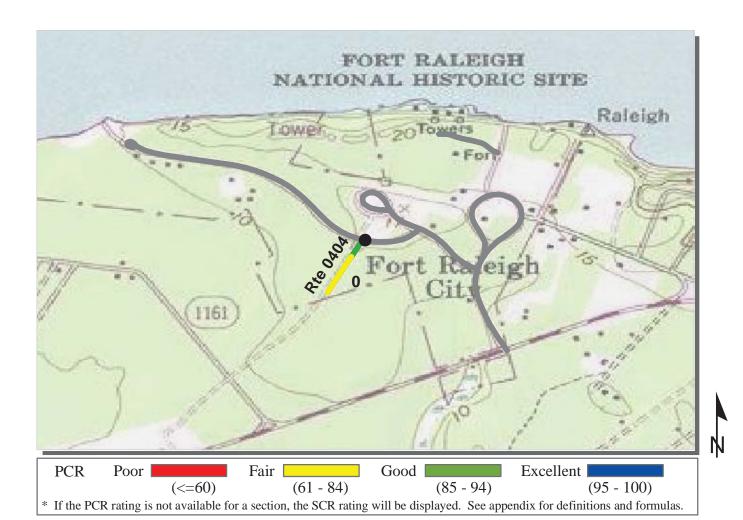

ROUTE: 0404 FR RD WATER TO	VER ROAD		TO	TOTAL LENGTH: 0.12 Miles		
Section Number	0					
Section Length (mi)	0.12					
Traffic AADT SADT ADT Date	Traffic data may be found at www.efl.fhwa.dot.gov Click on PROGRAMS / NPS Traffic Data (Note: Not all parks have traffic data)					
Cross Section Information						
Number of Lanes	1					
Paved Width (ft)	12					
Lane Width (ft)	12					
Shoulder Width Right (ft)**	6					
Shoulder Width Left (ft)**	8					
Roadway Condition Information						
SCR (Surface Condition Rating)	79					
PCR (Pavement Condition Rating)	75					
Distress Index Values						
Alligator Cracking Index	99					
Longitudinal Cracking Index	96					
Tranverse Cracking Index	92					
Patching Index	100					
Rutting Index	93					
Roughness Condition Index (RCI)	52					

^{**} Shoulder widths are measured from video at 0.50 mile intervals along route tangents. Visibility of actual shoulders in video images may affect accuracy of measured shoulder widths.



Section 6
Manually Rated Paved Route
Condition Rating Sheets (MRR)

Section 6: Manually Rated Paved Route Condition Rating Sheets

No data available for this section.



Section 7
Parking Area Condition Rating Sheets

FORT RALEIGH NATIONAL HISTORIC SITE **Route 0900ZZ**


FR RD VISITOR CENTER PARKING AREAS

FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.34 (ON RIGHT) TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.47 (ON RIGHT)

Summary Record

Route	Public /					
Number	NonPublic	Date Visited		Area (sq ft)	Lane Miles *	Surface Type
0900ZZ	PUBLIC	1/8/2007		20,844	0.36	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	SUMMARY/76.13

^{*} Lane miles are based on 11' lane widths

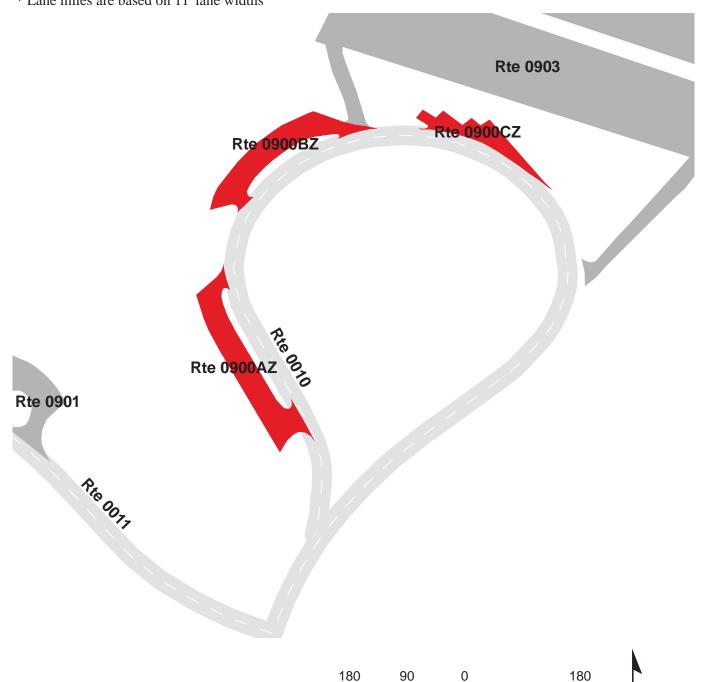

180

90

0

FORT RALEIGH NATIONAL HISTORIC SITE Route 0900AZ

FR RD VISITOR CENTER LOOP PARKING A

FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.43 (ON RIGHT) TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.47 (ON RIGHT)

Subcomponent Record

				1		
Route	Public /					
Number	NonPublic	Date Visited		Area (sq ft)	Lane Miles *	Surface Type
0900AZ	PUBLIC	1/8	3/2007	9,350	0.16	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	FAIR/73

^{*} Lane miles are based on 11' lane widths



FORT RALEIGH NATIONAL HISTORIC SITE Route 0900BZ


FR RD VISITOR CENTER LOOP PARKING B

FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.38 (ON RIGHT) TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.41 (ON RIGHT)

Subcomponent Record

Route	Public /					
Number	NonPublic	Date Visited		Area (sq ft)	Lane Miles *	Surface Type
0900BZ	PUBLIC	1/8	3/2007	7,685	0.13	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	FAIR/73

^{*} Lane miles are based on 11' lane widths

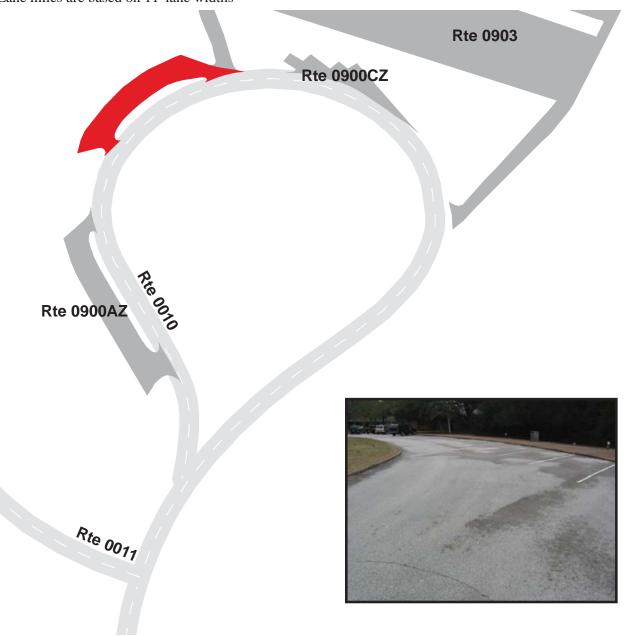

FORT RALEIGH NATIONAL HISTORIC SITE Route 0900CZ


FR RD VISITOR CENTER LOOP PARKING C

FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.34 (ON RIGHT) TO PARKING

Subcomponent Record

Route	Public /					
Number	NonPublic	Date Visited		Area (sq ft)	Lane Miles *	Surface Type
0900CZ	PUBLIC	1/8/2007		3,809	0.07	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	GOOD/90

^{*} Lane miles are based on 11' lane widths

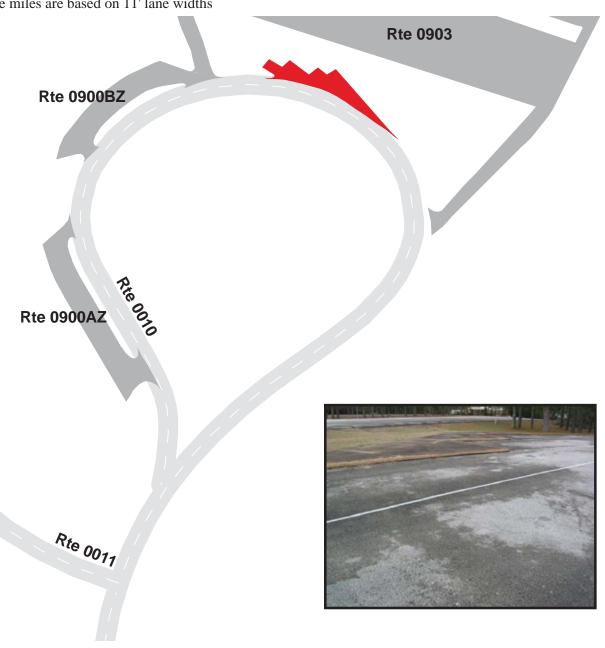

160

80

FORT RALEIGH NATIONAL HISTORIC SITE Route 0901

FR RD GROUP HEADQUARTERS PARKING


FROM ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.08 (ON RIGHT) TO ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.12 (ON RIGHT)

Route	Public /					
Number	NonPublic	Date Visited		Area (sq ft)	Lane Miles *	Surface Type
0901	NONPUBLIC	1/8/2007		12,548	0.22	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	GOOD/90

^{*} Lane miles are based on 11' lane widths





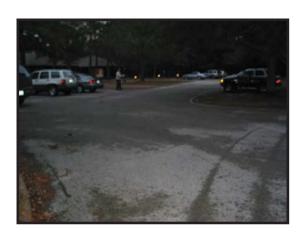




FORT RALEIGH NATIONAL HISTORIC SITE Route 0902

FR RD MAINTENANCE AREA PARKING FROM ROUTE 0401 (FR RD PEAR PAD ROAD) AT MP 0.29 (ON LEFT) TO PARKING

Route	Public /					
Number	NonPublic	Date Visited		Area (sq ft)	Lane Miles *	Surface Type
0902	NONPUBLIC	1/8/2007		32,154	0.55	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	FAIR/73

^{*} Lane miles are based on 11' lane widths



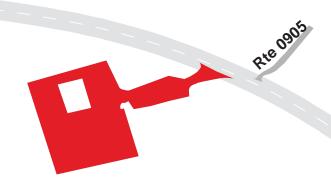



300

150



300


FORT RALEIGH NATIONAL HISTORIC SITE Route 0903

FR RD THEATER PARKING

FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.30 (ON RIGHT) TO ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.37 (ON RIGHT)

Route	Public /					
Number	NonPublic	Date	Visited	Area (sq ft)	Lane Miles *	Surface Type
0903	PUBLIC	1/8	3/2007	190,716	3.28	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	GOOD/90

^{*} Lane miles are based on 11' lane widths

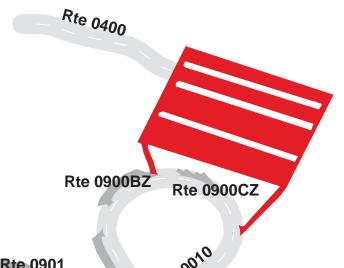



Rte 0901 Rte 0900AZ Rte 0010



FORT RALEIGH NATIONAL HISTORIC SITE Route 0904

FR RD ELIZABETHAN GARDEN PARKING


FROM ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.24 (ON RIGHT) TO PARKING

Route	Public /					
Number	NonPublic	Date	Visited	Area (sq ft)	Lane Miles *	Surface Type
0904	PUBLIC	1/8	3/2007	15,869	0.27	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	GOOD/90

^{*} Lane miles are based on 11' lane widths





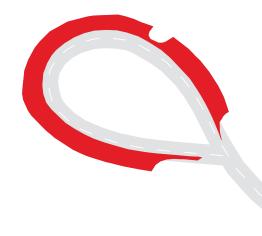

Rte 0011

Rte 0901


Rte 0401

FORT RALEIGH NATIONAL HISTORIC SITE Route 0905

ELIZABETHAN GARDEN MAINTENANCE FACILITY
FROM ROUTE 0401 (FR RD PEAR PAD ROAD) AT MP 0.28 (ON RIGHT)
TO MAINTENANCE FACILITY

Route	Public /					
Number	NonPublic	Date Visited		Area (sq ft)	Lane Miles *	Surface Type
0905	NONPUBLIC	1/10	0/2007	1,474	0.03	AS
			Fire			
Culverts	Drop Inlets	Gates	Hydrants	Curb & Gutter	Curb	PCR
				NO CURB AND		
0	0	0	0	GUTTER	NO CURB	POOR/45

^{*} Lane miles are based on 11' lane widths

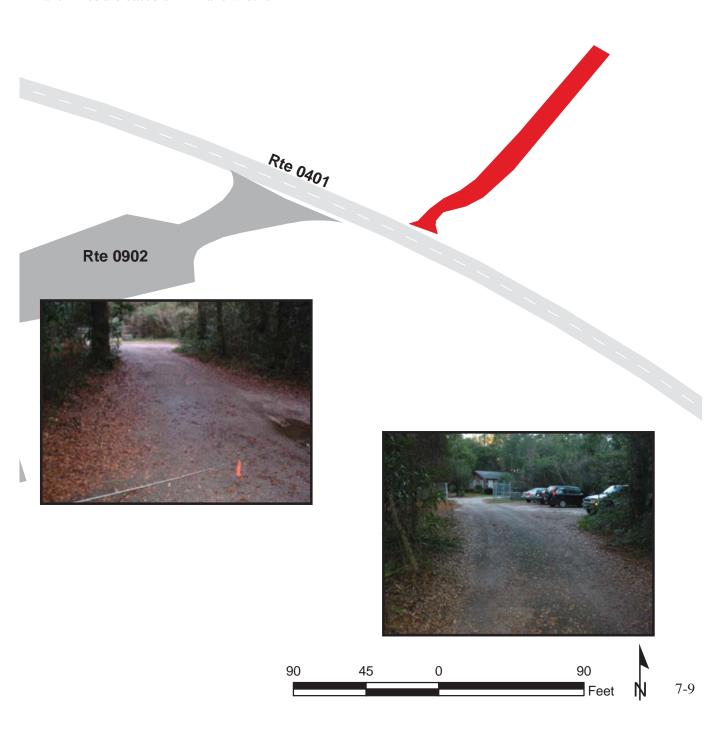

Fort Raleigh National Historic Site



Section 8
Parkwide / Route Maintenance
Features Summaries

FORA: PARKWIDE MAINTENANCE FEATURES SUMMARY

Notice: Culverts and drop inlets were marked by NPS and inventoried by RIP in Cycle 4, therefore the culvert and drop inlet count below includes those on ARAN-driven routes, Manually Rated Routes and in Paved Parking Areas.

FEATURE	LINEAR FEET	COUNT
BARRIER	0	
BOLLARD	0	
BRIDGE		0
CABLE	0	
CATTLE GUARD		0
CULVERT		3
CURB	982	
DROP INLET		0
FIRE HYDRANT		4
GATE		1
GUARD/GUIDE RAIL	0	
GUARD/GUIDE WALL	0	
INTERSECTION		37
LOW WATER CROSSING	0	0
MILE MARKER		0
OVERPASS		0
OVERHEAD SIGN		0
PARK BOUNDARY		0
PAVED DITCH	0	
PULLOUT		0
RAILROAD CROSSING		0
RETAINING WALL		0
SIGN		34
STATE BOUNDARY		0
TEMPORARY BARRIER	0	
TRAFFIC LIGHT		0
TUNNEL		0
TURNOUT	0	

FORA: ROUTE MAINTENANCE FEATURES SUMMARY

FEATURE	ROUTE 0010 FR RD FORT RALEIGH ROAD	ROUTE 0011 FR RD NATIONAL PARK DRIVE	ROUTE 0400 FR RD THEATER ACCESS ROAD	ROUTE 0401 FR RD PEAR PAD ROAD	ROUTE 0404 FR RD WATER TOWER ROAD	UNIT
BARRIER	0	0	0	0	0	LINEAR FEET
BOLLARD	0	0	0	0	0	LINEAR FEET
BRIDGE	0	0	0	0	0	EACH
CABLE	0	0	0	0	0	LINEAR FEET
CATTLE GUARD	0	0	0	0	0	EACH
CULVERT	2	1	0	0	0	EACH
CURB	908	74	0	0	0	LINEAR FEET
DROP INLET	0	0	0	0	0	EACH
FIRE HYDRANT	0	1	1	2	0	EACH
GATE	0	0	0	0	1	EACH
GUARD/GUIDE RAIL	0	0	0	0	0	LINEAR FEET
GUARD/GUIDE WALL	0	0	0	0	0	LINEAR FEET
INTERSECTION	17	9	1	8	2	EACH
LOW WATER CROSSING	0	0	0	0	0	EACH
LOW WATER CROSSING	0	0	0	0	0	LINEAR FEET
MILE MARKER	0	0	0	0	0	EACH
OVERHEAD SIGN	0	0	0	0	0	EACH
OVERPASS	0	0	0	0	0	EACH
PARK BOUNDARY	0	0	0	0	0	EACH
PAVED DITCH	0	0	0	0	0	LINEAR FEET
PULLOUT	0	0	0	0	0	EACH
RAILROAD CROSSING	0	0	0	0	0	EACH
RETAINING WALL	0	0	0	0	0	EACH
SIGN	14	12	3	5	0	EACH
STATE BOUNDARY	0	0	0	0	0	EACH
TEMPORARY BARRIER	0	0	0	0	0	LINEAR FEET
TRAFFIC LIGHT	0	0	0	0	0	EACH
TUNNEL	0	0	0	0	0	EACH
TURNOUT	0	0	0	0	0	LINEAR FEET

Notice: Culverts and drop inlets were marked by NPS and inventoried by RIP in Cycle 4, therefore the culvert and drop inlet count above includes those on ARAN-driven routes, Manually Rated Routes and in Paved Parking Areas.

FORA: STRUCTURE LIST

ROUTE FUNCTIONAL MILEPOST MILEPOST STRUCTURE
NUMBER CLASS START END FEATURE NUMBER

No data available for this section.

Fort Raleigh National Historic Site



Section 9
Park Route Maintenance Features
Road Logs

ROUTE 0010: FR RD FORT RALEIGH ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.000	0.000	ROUTE BEGIN	N/A	FROM STATE HIGHWAY 64
0.000	0.000	INTERSECTION	RIGHT	SR 64
0.000	0.000	SIGN	RIGHT	REGULATORY, STOP
0.000	0.000	INTERSECTION	LEFT	SR 64
0.004	0.018	CURB	RIGHT	
0.005	0.006	CURB	LEFT	
0.007	0.007	SIGN	RIGHT	GUIDE, FORT RALEIGH NATIONAL HISTORIC SITE
0.007	0.007	SIGN	RIGHT	GUIDE, LOST COLONY OUTDOOR DRAMA
0.007	0.007	SIGN	RIGHT	GUIDE, THE ELIZABETHAN GARDEN
0.010	0.010	CULVERT	N/A	
0.020	0.020	SIGN	RIGHT	GUIDE, ROANOKE ISLAND AQUARIUM WATERFRONT FESTIVAL PARK ELIZABETH II
0.023	0.023	INTERSECTION	RIGHT	ROUTE 0010 (FR RD FORT RALEIGH ROAD) SPUR
0.035	0.035	SIGN	RIGHT	GUIDE, NATIONAL PARK SERVICE
0.053	0.053	SIGN	RIGHT	WARNING, GRAPHIC SIGN, NO TEXT
0.066	0.066	SIGN	RIGHT	REGULATORY, SPEED LIMIT 20
0.131	0.131	SIGN	RIGHT	GUIDE, ELIZABETHAN GARDENS FT. RALEIGH VISITOR CENTER THE LOST COLONY
0.156	0.156	SIGN	RIGHT	REGULATORY, SPEED LIMIT 20
0.171	0.171	INTERSECTION	LEFT	ROUTE 0011 (FR RD NATIONAL PARK DRIVE)
0.195	0.195	INTERSECTION	LEFT	ROUTE 0010 (FR RD FORT RALEIGH ROAD)
0.197	0.215	CURB	LEFT	
0.199	0.199	SIGN	LEFT	REGULATORY, ONE WAY
0.218	0.218	INTERSECTION	LEFT	ROUTE 0010 (FR RD FORT RALEIGH ROAD) SPUR
0.232	0.232	INTERSECTION	LEFT	ROUTE 0010 (FR RD FORT RALEIGH ROAD) SPUR
0.262	0.262	CULVERT	N/A	
0.289	0.289	SIGN	RIGHT	GUIDE, THEATER PARKING & BOX OFFICE VISITOR CENTER CIVIL WAR MARKER
0.298	0.298	INTERSECTION	RIGHT	ROUTE 0903 (FR RD THEATER PARKING)
0.344	0.344	INTERSECTION	RIGHT	ROUTE 0900CZ (FR RD VISITOR CENTER LOOP PARKING C)
0.359	0.372	CURB	RIGHT	
0.372	0.372	INTERSECTION	RIGHT	ROUTE 0903 (FR RD THEATER PARKING)
0.376	0.376	INTERSECTION	RIGHT	ROUTE 0900BZ (FR RD VISITOR CENTER LOOP PARKING B)
0.379	0.406	CURB	RIGHT	
0.407	0.407	INTERSECTION	RIGHT	ROUTE 0900BZ (FR RD VISITOR CENTER LOOP PARKING B)

ROUTE 0010: FR RD FORT RALEIGH ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.410	0.425	CURB	RIGHT	COMMENT
0.429	0.429	INTERSECTION	RIGHT	ROUTE 0900AZ (FR RD VISITOR CENTER LOOP PARKING A)
0.431	0.468	CURB	RIGHT	
0.472	0.472	INTERSECTION	RIGHT	ROUTE 0900AZ (FR RD VISITOR CENTER LOOP PARKING A)
0.475	0.498	CURB	RIGHT	
0.479	0.479	INTERSECTION	LEFT	ROUTE 0010 (FR RD FORT RALEIGH ROAD) SPUR
0.482	0.488	CURB	LEFT	
0.483	0.483	SIGN	LEFT	REGULATORY, KEEP RIGHT
0.491	0.491	INTERSECTION	LEFT	ROUTE 0010 (FR RD FORT RALEIGH ROAD) SPUR
0.492	0.510	CURB	LEFT	
0.510	0.510	INTERSECTION	N/A	ROUTE 0010 (FR RD FORT RALEIGH ROAD)
0.510	0.510	SIGN	RIGHT	GUIDE, ELIZABETHAN GARDENS
0.510	0.510	ROUTE END	N/A	TO END OF LOOP

ROUTE 0011: FR RD NATIONAL PARK DRIVE

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.000	0.000	ROUTE BEGIN	N/A	FROM ROUTE 0010 (FR RD FORT RALEIGH ROAD) AT MP 0.17 (ON LEFT)
0.000	0.000	INTERSECTION	LEFT	ROUTE 0010 (FR RD FORT RALEIGH ROAD)
0.000	0.000	INTERSECTION	RIGHT	ROUTE 0010 (FR RD FORT RALEIGH ROAD)
0.000	0.000	SIGN	N/A	GUIDE, 64 EXIT TO HWY 64 WATERSIDE THEATRE VISITOR CENTER
0.000	0.000	SIGN	RIGHT	REGULATORY, STOP
0.006	0.006	SIGN	RIGHT	GUIDE, FORT RALEIGH RD
0.007	0.007	SIGN	RIGHT	GUIDE, ELIZABETHAN GARDENS FT. RALEIGH VISITOR CENTER THE LOST COLONY
0.007	0.007	SIGN	RIGHT	GUIDE, CIVIL WAR MARKER
0.025	0.025	SIGN	RIGHT	REGULATORY, SPEED LIMIT 20
0.073	0.078	CURB	RIGHT	
0.080	0.080	INTERSECTION	RIGHT	ROUTE 0901 (FR RD GROUP HEADQUARTERS PARKING)
0.087	0.087	SIGN	RIGHT	GUIDE, ELIZABETHAN GARDENS
0.092	0.092	CULVERT	N/A	
0.120	0.120	INTERSECTION	RIGHT	ROUTE 0901 (FR RD GROUP HEADQUARTERS PARKING)
0.126	0.126	INTERSECTION	LEFT	ROUTE 0401 (FR RD PEAR PAD ROAD)
0.134	0.134	SIGN	LEFT	GUIDE, UNABLE TO READ FROM VIDEO
0.135	0.135	SIGN	RIGHT	GUIDE, PEAR PAD RD
0.161	0.161	SIGN	RIGHT	REGULATORY, SPEED LIMIT 20
0.165	0.165	FIRE HYDRANT	RIGHT	
0.186	0.186	INTERSECTION	LEFT	ROUTE 0011 (FR RD NATIONAL PARK DRIVE)
0.220	0.224	CURB	RIGHT	
0.222	0.222	SIGN	RIGHT	GUIDE, PARKING GARDEN VISITORS ONLY
0.226	0.226	SIGN	LEFT	GUIDE, ELIZABETHAN GARDENS GARDENS VISITOR PARKING ONLY BUS DROP OFF
0.243	0.243	INTERSECTION	RIGHT	ROUTE 0904 (FR RD ELIZABETHAN GARDEN PARKING)
0.291	0.296	CURB	RIGHT	
0.300	0.300	INTERSECTION	LEFT	ROUTE 0011 (FR RD NATIONAL PARK DRIVE)
0.300	0.300	INTERSECTION	RIGHT	ROUTE 0011 (FR RD NATIONAL PARK DRIVE)
0.300	0.300	ROUTE END	N/A	TO END OF LOOP

ROUTE 0400: FR RD THEATER ACCESS ROAD

FROM	TO			
MILEPOST	MILEPOST	FEATURE	SIDE	COMMENT
0.000	0.000	ROUTE BEGIN	N/A	FROM ROUTE 0903 AT NORTHWEST CORNER
0.000	0.000	INTERSECTION	N/A	ROUTE 0903 (FR RD THEATER PARKING)
0.005	0.005	SIGN	RIGHT	GUIDE, NATIONAL PARK SERVICE
0.016	0.016	SIGN	RIGHT	GUIDE, AUTHORIZED VEHICLES ONLY
0.076	0.076	SIGN	RIGHT	GUIDE, VISITOR CENTER TICKET OFFICE PARKING LOT
0.086	0.086	FIRE HYDRANT	LEFT	
0.110	0.110	ROUTE END	N/A	TO END AT THEATER TURNAROUND AREA

ROUTE 0401: FR RD PEAR PAD ROAD

FROM MILEPOST	TO MILEPOST	FEATURE	SIDE	COMMENT
0.000	0.000	ROUTE BEGIN	N/A	FROM ROUTE 0011 (FR RD NATIONAL PARK DRIVE) AT MP 0.13 (ON LEFT)
0.000	0.000	INTERSECTION	LEFT	ROUTE 0011 (FR RD NATIONAL PARK DRIVE)
0.000	0.000	INTERSECTION	RIGHT	ROUTE 0011 (FR RD NATIONAL PARK DRIVE)
0.000	0.000	SIGN	RIGHT	REGULATORY, STOP
0.009	0.009	SIGN	RIGHT	GUIDE, SERVICE ROAD MAINTENANCE AND RESIDENCE AREA
0.057	0.057	SIGN	RIGHT	REGULATORY, SPEED LIMIT 15
0.057	0.057	SIGN	RIGHT	WARNING, SLOW CHILDREN AT PLAY
0.094	0.094	INTERSECTION	LEFT	ROUTE 0404 (FR RD WATER TOWER ROAD)
0.282	0.282	INTERSECTION	RIGHT	ROUTE 0905 (ELIZABETHAN GARDEN MAINTENANCE FACILITY)
0.294	0.294	INTERSECTION	LEFT	ROUTE 0902 (FR RD MAINTENANCE AREA PARKING)
0.307	0.307	FIRE HYDRANT	LEFT	
0.406	0.406	FIRE HYDRANT	LEFT	
0.519	0.519	INTERSECTION	LEFT	ROUTE 0401 (FR RD PEAR PAD ROAD)
0.535	0.535	SIGN	RIGHT	GUIDE, GRAPHIC SIGN, NO TEXT
0.550	0.550	INTERSECTION	LEFT	ROUTE 0401 (FR RD PEAR PAD ROAD)
0.550	0.550	INTERSECTION	RIGHT	ROUTE 0401 (FR RD PEAR PAD ROAD)
0.550	0.550	ROUTE END	N/A	TO END OF LOOP

ROUTE 0404: FR RD WATER TOWER ROAD

FROM	TO			
MILEPOST	MILEPOST	FEATURE	SIDE	COMMENT
0.000	0.000	ROUTE BEGIN	N/A	FROM ROUTE 0401 (FR RD PEAR PAD ROAD) AT MP 0.09 (ON LEFT)
0.000	0.000	INTERSECTION	LEFT	ROUTE 0401 (FR RD PEAR PAD ROAD)
0.000	0.000	INTERSECTION	RIGHT	ROUTE 0401 (FR RD PEAR PAD ROAD)
0.007	0.007	GATE	N/A	
0.120	0.120	ROUTE END	N/A	TO END AT SHED ON LEFT

Fort Raleigh National Historic Site



Section 10 Appendix

APPENDIX A: GLOSSARY OF TERMS AND ABBREVIATIONS

TERM OR

ABBREVIATION DESCRIPTION OR DEFINITION

AADT (Annual Average Daily Traffic) The estimate of typical daily traffic

on a road segment for all days of the week over the period of one

year.

CRS Condition Rating Sheets. (Section 5)

Excellent rating with an index value of 95 or greater

Fair rating with an index value from 61 to 84

Func. Class Funtional Classification (see Route ID, Section 4)

Good Good rating with an index value from 85 to 94

IRI International Roughness Index

Lane Width Width from road centerline to fogline, or from centerline to edge-of-

pavement when no fogline exists

MRR Manually Rated Route

N/A Not Applicable

NC Not Collected

Paved Width Width from edge-of-pavement to edge-of-pavement

PCR Pavement Condition Rating (Appendix B, Section 10)

Poor Poor Rating with an index value of 60 or less

RCI Roughness Condition Index

SADT (Seasonal Annual Daily Traffic) The AADT adjusted to represent

just the period of the year containing 80 percent of the total annual

traffic.

SCR Surface Condition Rating (Appendix B, Section 10)

Shoulder Width Distance from fogline to hinge point, or if no fogline, from edge-of-

pavement to hinge point.

APPENDIX B: DESCRIPTION OF RATING SYSTEM

A numerical roadway rating system is used to describe the overall condition of the paved roadways and paved parking areas. In this system, a numerical rating between 0 and 100 is ascribed to each 0.02 miles of road. This numerical rating is called a Pavement Condition Rating (PCR). A "perfect" road, newly constructed with no surface distresses and a smooth surface, would be assigned a PCR rating of 100. Based on the type, severity, and extent of surface distresses points are deducted from 100 to arrive at the final PCR.

Data is collected on the following distresses and conditions:

- Alligator Cracking a series of interconnecting cracks resembling alligator skin or chicken wire, which can occur anywhere in the lane.
- **Longitudinal Cracking** cracks which are parallel to the pavement centerline or asphalt lay-down direction.
- **Transverse Cracking** cracks perpendicular to the pavement centerline.
- **Pothole (patch)** a bowl-shaped hole in the pavement surface. May be patched or not.
- **Rutting** surface depressions in the wheel paths.
- Roughness is collected as International Roughness Index (IRI) and is used in the PCR formula. Roughness is measured in inches of vertical displacement of the vehicle per mile traveled.

A Distress Rating Index value is calculated for each of the individual distresses at the 0.02 mile, or every 105.6 feet.

Calculation of Index Values

Note: Index values < 0 default to 0. Index values > 100 default to 100.

For all indices, a higher value indicates a better road condition, and a lower value indicates a poorer road condition.

All severity protocols are taken from the SHRP Distress Identification Manual.

Condition Ranges for all Indices

Excellent >=95
Good >=85 and <95
Fair >60 and <85
Poor <=60

Alligator Crack Index

```
AC_{INDEX} = 100 - 40 * [(\%LOW / 70) + (\%MED / 30) + (\%HI / 10)]
```

Where:

The values %LOW, %MED and %HI describe the percent of the total WX measured area that is affected by alligator cracking of each severity level. These values range from ≥ 0 to ≤ 100 .

%LOW = (Total square area WX measured low severity alligator cracking) / (Section length * WX measured lane width)

%MED = (Total square area WX measured medium severity alligator cracking) / (Section length * WX measured lane width)

% HI = (Total square area WX measured high severity alligator cracking) / (Section length * WX measured lane width)

The denominators 70, 30, and 10 are the maximum allowable extents for the numerator value in the same units. For example, low severity alligator cracking totaling 70% of the measured section area would alone fail that section of road for this index.

The threshold for failure for this index is $AC_{INDEX} = 60$.

Severity Levels:

Low severity alligator cracking describes an area of cracks with no or only a few connecting cracks; cracks are not spalled (cracked, broken, chipped, frayed along the cracks); pumping (water seepage from beneath the pavement through the cracks) is not evident. Any sealed alligator cracks are low severity alligator cracks, as long as the sealant is still in good condition. If the sealant has reopened, and the crack is visible and can be measured, the crack severity is assigned according to that measurement.

Medium severity alligator cracking describes an area of interconnected cracks forming a complete pattern; cracks may be slightly spalled; pumping is not evident.

High severity alligator cracking describes an area of moderately or severely spalled interconnected cracks forming a complete pattern; pieces may move when subjected to traffic; pumping may be evident.

Longitudinal Crack Index

```
LC_{INDEX} = 100 - 40 * [(\%LOW / 350) + (\%MED / 200) + (\%HI / 75)]
```

Where:

The values %LOW, %MED and %HI describe the length of longitudinal cracking of each severity as a percent of the section length. These values are ≥ 0 and can exceed 100.

%LOW = (Total linear feet WX measured low severity longitudinal cracking) / (Section length in linear feet)

%MED = (Total linear feet WX measured medium severity longitudinal cracking) / (Section length in linear feet)

%HI = (Total linear feet WX measured high severity longitudinal cracking) / (Section length in linear feet)

The denominators 350, 200, and 75 are the maximum allowable extents for the numerator value in the same units. For example, medium severity longitudinal cracking with a total length that is 200% of the length of the section would alone fail that section of road for this index.

The threshold for failure for this index is $LC_INDEX = 60$.

Severity Levels:

Low severity longitudinal cracks have a mean width $\leq \frac{1}{4}$ ", or are sealed cracks of indeterminate width whose sealant material is in good condition.

Medium severity longitudinal cracks have a mean width $> \frac{1}{4}$ " and $\le \frac{3}{4}$ ".

High severity longitudinal cracks have a mean width $> \frac{3}{4}$ ".

Transverse Crack Index

```
TC_{INDEX} = 100 - \{ [20 * ((LOW / 15.1) + (MED / 7.5))] + [40 * (HI / 1.9)] \}
```

Where:

The values LOW, MED and HI describe a count of the total number of transverse cracks of each severity level, where one transverse crack unit is equal to the WX measured lane width. These values are ≥ 0 .

LOW = (Total linear feet WX measured low severity transverse cracking) / (WX measured lane width)
MED = (Total linear feet WX measured medium severity transverse cracking) / (WX measured lane width)
HI = (Total linear feet WX measured high severity transverse cracking) / (WX measured lane width)

The denominators 15.1, 7.5, and 1.9 are the maximum allowable extents for the numerator value in the same units. For example, high severity transverse cracking with a total length that amounts to 1.9 times the WX measured lane width would alone fail that section of road for this index.

The threshold for failure for this index is TC_INDEX = 60.

Severity Levels:

Low severity transverse cracks have a mean width $\leq \frac{1}{4}$ ", or are sealed cracks of indeterminate width whose sealant material is in good condition.

Medium severity transverse cracks have a mean width $> \frac{1}{4}$ " and $\leq \frac{3}{4}$ ".

High severity transverse cracks have a mean width $> \frac{3}{4}$ ".

Patching Index

```
PATCH_INDEX = 100 - 40 * (\% PATCHING / 80)
```

Where:

The value %PATCHING describes the percent of the total WX measured area that is affected by patching. This value ranges from ≥ 0 to ≤ 100 .

```
%PATCHING = (Total area WX measured patching) / (Section length * WX measured lane width)
```

The denominator 80 is the maximum allowable extent for the numerator value in the same units. Patching totaling 80% or more of the measured section area fails a section of road for this index.

The threshold for failure for this index is PATCH INDEX = 60.

There are no severity levels for patching.

Rutting Index

```
RUT_INDEX = 100 - 40 * [(%LOW / 160) + (%MED / 80) + (%HI / 40)]
```

Where:

10 ARAN rut depth measurements are taken per full .02 section for each of 2 wheel paths (left and right), resulting in a total of 20 measurements taken for both wheel paths. The values %LOW, %MED and %HI describe the number of ARAN rut depth measurements of both wheel paths in the section whose values are of each severity level, calculated as a percentage of the total number of ARAN rut depth measurements taken for a single wheel path in the section. These values range from ≥ 0 to ≤ 200 .

%LOW = (Total number of ARAN measured low severity ruts in section for both wheel paths) / (Total number of ARAN rut measurements in section for a single wheel path)

%MED = (Total number of ARAN measured medium severity ruts in section for both wheel paths) / (Total number of ARAN rut measurements in section for a single wheel path)

%HI = (Total number of ARAN measured high severity ruts in section for both wheel paths) / (Total number of ARAN rut measurements in section for a single wheel path)

The denominators 160, 80, and 40 are the maximum allowable extents for the numerator value in the same units. For example, low severity ruts recorded in 16 of the 20 total readings (or 160% of a full wheel path's worth of readings) for a full .02 section would fail that section for this index.

The threshold for failure for this index is $RUT_INDEX = 60$.

Severity Levels:

Ruts with an ARAN measured depth < 0.20" are not included in the distress calculations.

Low severity ruts have an ARAN measured depth ≥ 0.20 " and ≤ 0.49 ".

Medium severity ruts have an ARAN measured depth ≥ 0.50 " and ≤ 0.99 ".

High severity ruts have an ARAN measured depth ≥ 1.00 ".

Roughness Condition Index

```
RCI = 32 * [5 * (2.718282 ^ (-0.0041 * AVG IRI))]
```

Where:

The value AVG IRI describes the average value of the Left IRI and Right IRI measurements for the section. This value can range from approximately 40 to over 1000.

```
AVG IRI = (ARAN measured Left IRI + ARAN measured Right IRI) / 2
```

There is no applicable threshold for failure for this index.

NOTE: Collection of roughness data is dependent on the data collection vehicle traveling at a minimum speed of 12 mph. In the event that a route cannot be safely traveled at this minimum speed, and results in no roughness data, the SCR only will be calculated.

Surface Condition Rating Index

```
\mathbf{SCR} = 100 - [(100 - AC\_INDEX) + (100 - LC\_INDEX) + (100 - TC\_INDEX) + (100 - PATCH\_INDEX) + (100 - RUT\_INDEX)]
```

Where:

See above for determinations of AC_INDEX, LC_INDEX, TC_INDEX, PATCH_INDEX and RUT_INDEX.

The threshold for failure for this index is SCR = 60.

Pavement Condition Rating Index Asphaltic Concrete Pavement (AS)

```
PCR = (0.60 * SCR) + (0.40 * RCI)
```

Where:

See above for determinations of SCR and RCI.

The values 0.60 and 0.40 function as weights within the formula.

If SCR equals zero (which means that the road surface condition is very poor), then the formula simply reduces to: PCR = 0.40 * RCI.

If RCI equals zero (which means that this value was not available for some reason), then the formula becomes: PCR = SCR.

The threshold for failure for this index is PCR = 60.

Pavement Condition Rating Index Portland Cement Concrete Pavement (CO)

Concrete PCR = $-0.0012(IRI^2)+0.0499(IRI)+99.542$

Where:

The threshold for failure for this index is PCR = 60.

Parking Lot and Manually Rated Road Condition Rating

Surface Condition Distresses- Chip Seal:

Raveling – loss of surface rock chips revealing previous surface

Bleeding – asphalt or tar is bleeding through to the surface where surface looks slick with asphalt

Rutting

Potholes/Patching

Ratings - Chip Seal:

Excellent – None of the surface affected by the above (recently constructed)

Good – Less than 10% of surface affected by the above

Fair – Between 10% and 40% of surface affected by the above

Poor – More than 40% of surface affected by the above

Surface Condition - Asphalt:

Cracking of any type

Rutting

Potholes/Patching

Ratings - Asphalt:

Excellent – None of the surface affected by the above (recently constructed)

Good – Less than 10% of surface affected by the above

Fair – Between 10% and 40% of surface affected by the above

Poor – More than 40% of surface affected by the above

Index Values of Visual Ratings on Parking Lots and Manually Rated Roads

Under Construction 100

Excellent 97

Good 90

Fair 73

Poor 45

APPENDIX C: GENERAL INFORMATION ON RIP SYSTEMS

DMI (Distance Measuring Instrument)

The DMI (Distance Measuring Instrument) obtains road length measurements that are highly accurate (to 0.001 miles). The DMI is connected to the outside of the rear wheel on the driver's side, and is wired into the antilock braking system (ABS). The number of pulses recorded for each wheel rotation by the ABS is registered by the DMI, which transmits a measurement of distance traveled to the processing computers in the ARAN. The DMI distance measurements are the foundation to which all the other subsystems are tied.

Digital Image Information

All images collected in Cycle 4 are digital images in .jpg format. These images provide adequate resolution for identifying sign and feature inventories and pavement evaluations. The images can be viewed with an interactive software program called VisiData. Each park will receive a copy of the VisiData program. Cycle 4 data, as well as Cycle 3 data, can be viewed using the Visi-Data software program. This program is a data presentation and analysis tool that can be accessed either at the individual park, park region or at NPS headquarters. The data is organized in a hierarchical manner and presented in tabular and graphical formats. The user is able to perform queries and drill down through the data to find the particular information they are looking for. Associated digital right-of-way images from either the LAN, USB port, individual DVD can be presented along with GPS locations.

Right-of-way (ROW) Video

Three digital cameras are mounted above the vehicle's windshield that point directly forward and slightly to the left and right. These cameras each collect one image every 0.002 miles (10.56 feet) in the primary-direction lane, to give a panoramic field-of-view of about 160 degrees. (Forward-facing video from the center camera only is collected in the opposite-direction lane of travel.)

If data collection speed exceeds 35-40 mph, the network and storage computers may become overwhelmed and may begin to drop individual video frames. Occasional common video quality issues include sun glare and rapid changes between sunlight and shadow. The camera system is equipped with auto risers that sometimes cannot adjust quickly enough to collect optimal video images.

FHWA ARAN CAMERA SPECIFICATIONS Forward Fooing Company (POW)				
Forward-Facing Cameras (ROW) Focal length	10 mm			
Chip size	8.71mm X 6.90mm			
Naming convention of each image	chainage.jpg			
Image resolution	1300 X 1030			
Image pixel size	depends on distance			
Relative position of the GPS unit to each	2.104 meters from front-center rutbar to			
camera	camera			
The ARAN has a lever arm setting which te	ells the POS system where the center of the			

The ARAN has a lever arm setting which tells the POS system where the center of the rutbar is with respect to the GPS antennas.

Pavement Video

Pavement video images are collected by the data collection vehicle to use in later analysis to determine extents and severities of different types of pavement distress. The pavement in the primary-direction road lane is filmed continuously by two analog cameras attached to booms extended from the rear of the ARAN on the left and right sides. Strobe lights fire synchronously with the opening of the camera shutters to eliminate shadows and motion blur. The images from the two cameras overlap, and are stitched together in real time to create a continuous strip image of the pavement in the primary direction lane. This strip has a maximum width of 3.0 meters (actual width depends on pavement camera calibration) and is sectioned for ease of file management every 0.010 miles (52.8 feet).

The cameras both have a resolution of 640 x 480, making the threshold of visible pavement cracks about 3 mm. Because the cameras are triggered by time and not distance traveled, this subsystem requires a minimum operating speed of 6 mph, otherwise images are taken on top of one another and result in checkered or black pavement video.

FHWA ARAN CAMERA SPECIFICATIONS Pavement Cameras					
Image Pixel size	3.135 mm /side				
Image Resolution	640 X 480				
Area that images cover	1.5 m X 1.2 m				
Full color or grayscale	grayscale				
Vehicle speed limitations	80km/h				
Aperture setting Auto-iris					
Exposure setting	1/50000				

FHWA ARAN GPS & Inertial System

GPS is collected by a NovAtel MiLLenium, 12 channel, dual frequency L1/L2, DGPS ready receiver with a MiLLennium 502 GPS antenna. An OmniStar 3000 LR provides real-time differential correction. An Applanix POS/LV is the inertial system that fills in when GPS is unavailable. The antenna is mounted in the center of the roof, slightly toward the rear of the vehicle, but a lever arm is applied to place the operational location of GPS recording at the center of the rutbar on the front bumper of the vehicle. Expected accuracy under ideal conditions is sub meter.

GPS Collected on Manually Rated Routes

Parking areas and roads that are not fully drivable with the ARAN data collection vehicle are collected manually by field technicians. GPS is collected for these routes using GPS field data collection utilizes Trimble ProXRS or ProXH Receivers matched with Trimble TSC1 or Ranger handheld Data Loggers, connected to Trimble Hurricane Antennas giving sub meter accuracy in ideal conditions. This collection equipment has varied as technology has improved over the years of RIP data collection. Some GPS files collected as early as 1998 have been verified for accuracy and perpetuated through the current cycle of data collection.

GPS SHAPEFILES

Type of Route and Collection Shape Filename		
Roads driven by ARAN	Line	park_road_04.dbf/.shp/.shx
Parking Areas	Polygon	park_pkg_04.dbf/.shp/.shx
Roads Manually Rated as Lines	Line	park_mrl_04.dbf/.shp/.shx
(not in every park)		
Roads Manually Rated as Polygons	Polygon	park_mrp_04.dbf/.shp/.shx
(not in every park)		

- Datum for all GPS shapefiles is LL_WGS84_DD (Latitude Longitude _World Geodetic Survey 1984_Decimal Degrees)
- In filename, "park" is NPS four-letter alphabetic code.
- The source for route data required for data processing and report production is the PARK RouteInfo.mdb.

Condition Photos Taken of Manually Rated Roads

One or more digital photos are taken by Canon Power Shot G2 4.0 Mega Pixel digital camera for each manually rated route in a National Park. They are stored in .jpg format named with the four-letter NPS park alphabetic code, route number, and the photo number assigned by the camera. For example, YOSE_0900_4434.jpg is the filename of the photo named 4434 by the camera that was taken of Yosemite National Park route 0900.

Scenic Photos

Scenic photos are taken by Canon Power Shot G2 4.0 Mega Pixel digital camera throughout each park and are named with the four-letter NPS park alphabetic code and the count of the photo taken in that park. For example, GRCA003.jpg is the filename of the third scenic photo taken in Grand Canyon National Park. The number of scenic photos provided will vary between parks.

APPENDIX D: METADATA

FHWA – NPS Road Inventory Program Cycle 4 Metadata

The purpose of these sheets is to provide users of the Road Inventory Program's data with data accuracies and tolerances to help users define ways in which the RIP data can and cannot be used. For further information on specifics of data collection equipment, data collection procedures, equipment calibrations, or quality control/quality assurance procedures, please contact Jim Kennedy, Project Manager, Data Quality Assurance, at 720-963-3560 or jim.kennedy@fhwa.dot.gov.

All Road Inventory Program data undergoes quality control and quality assurance testing. This document represents the known data accuracies and tolerances for the data collection equipment, data collection procedures, and data processing procedures currently in use. Many additional tests conducted on the park databases during the quality assurance phase to ensure data integrity are not listed as a part of this document. Before it is delivered, a park database undergoes a large set of table design consistency, field data format consistency, data completeness, uniqueness of key fields, data reasonableness, acceptable data range, within-field data consistency, between-field data consistency, and between-table data consistency tests. Additional data sampling checks are conducted to ensure proper data upload from raw files into the park database and to quality check the pavement crack analysis. Further information is detailed in the FHWA – NPS RIP Quality Assurance Manual, available upon request.

This description of metadata includes only the known accuracies with which a data field matches its expected value. The tables that follow this page show each database field's:

- Field field name
- Format data type and number of characters of field
- Expected Value meaning of value assigned to field
- Source when in process field value obtained
- Validation how field value obtained
- Expected Accuracy accuracy with which contents of field match Expected Value

Verifying and continually improving the accuracy of Road Inventory Program data is an ongoing goal of the Federal Highway Administration and the National Park Service. Field testing and post-collection analysis of ARAN (Automatic Road ANalyzer) -collected data will continue in Cycle 4. Data quality is expected to improve as the FHWA – NPS Road Inventory Program continues to operate, due to the fact that future data collection cycles will consist in large part of data updates. Also, technological improvements are expected to render the data increasingly consistent with actual roadway conditions as data collection cycles progress.

Specific Caveats

- MUTCD based on contents & colors of sign, not on size
- Database records that show a Portland Cement Concrete (CO) surface type sometimes include distress
 index values that seem to show a perfect roadway. Condition assessments on concrete pavements are not
 conducted for Alligator Cracking, Transverse or Longitudinal Cracking, Patching, or Rutting. Perfect
 values for concrete road sections for these indexes are default values and do not represent a condition
 assessment of the concrete surfaces.
- On the USB drive, in the Database folder, parks are provided with intersection lists and exceptions lists. These documents should be treated as raw files and are not accurate. Refer to the final database for accurately post-processed intersection data.
- Most roadway data is collected in the primary direction lane of a roadway. To save data storage space and to reduce data analysis efforts, the assumption was made that the paved surface condition of a route's primary lane adequately represents the surface condition of the full roadway. Therefore, in the database, opposite-direction records in the PMS_Tenth table do not include assessed values for roadway surface distresses. Values such as 0, N/A, -1, or a repeat of the primary-direction assessed value indicate that no assessment was performed. The PMS_20 and PMS_Mile tables simply exclude all opposite routes.

- Roadway Data is collected in intervals of 0.010 miles (52.8feet) constituting a "station".
- Most roadway features are collected relative to the primary direction lane of a roadway, using the primary
 direction video and mileage. Signs and Mile Markers are the only features collected using the oppositedirection video with mileage location referenced to the primary direction lane of the roadway.
- Route_GPS table contains GPS positional information collected by the ARAN and post processed with Applanix POSPac Land 5.0 post-processing software. No manual adjustments have occurred on this table.
- Modifications to the Park ROAD 04.dbf/.shp/.shx files may have been necessary for report esthetics.
- Modifications to the Park_PKG_04. dbf/.shp/.shx files may have been necessary for report esthetics.
- Cycle 4 utilizes the Microsoft Office 2003 suite of products and Crystal Reports XI for document and data file generation and reporting.
- All PDF files are in Adobe Acrobat 7.0 Professional format.
- All ArcGIS files are created using ESRI Version 9.x software.
- Thumbnail images are created at 1/10 original image size for Right-of-Way and Pavement Images.
- FHWA is investigating the rutting methodology and calculated values it currently reports. Equipment limitations and analysis methods may be over reporting, low severity rutting.

Key to Notes in Tables

- (1): Note that only one value fits in field, so even if this value varies throughout the route, only predominant value is recorded here.
- (2): Shoulder width is measured at route start and every half-mile along the route in the primary direction. Width is the entire width of the drivable shoulder, regardless of the presence or absence of pavement, from the fog line to the shoulder hinge point, or if no fog line exists, from the edge of pavement to the hinge point. Identification of shoulder hinge point can be problematic using video analysis. Some paved ditches may be mistakenly recorded as shoulders where the shoulder hinge point and change in slope are not easily distinguished from the video.
- (3): Mileage is measured by the ARAN (Automatic Road ANalyzer) data collection vehicle out to the 0.001 decimal place. The DMI (distance measuring instrument) is very accurate, with extremely slight variations in measurement due to air temperature, tire inflation, curves, hills, and equipment calibration.
- (4): Features are measured differently depending on whether they are visible in the forward-facing video of the roadway, but every feature milepost measurement depends on the baseline measurement of the data collection vehicle's mileage. The ARAN (Automatic Road ANalyzer) data collection vehicle's mileage is measured by the DMI (distance measuring instrument) out to the 0.001 decimal place. The DMI is very accurate, with extremely slight variations in measurement due to air temperature, tire inflation, curves, hills, and equipment calibration. If a feature will not be visible in the forward-facing video, its milepost is determined by the data collectors' key press tagging the milepost when the ARAN passes the feature. Key presses are entered into the ARAN software when the vehicle travels typically between 15 and 45 miles/hour, so a delay of a single second as the vehicle passes a feature would result in an inaccuracy of 0.004 miles (22 feet) to 0.012 miles (66 feet). If a feature is visible in the video, its milepost is determined during post-processing using a video measurement software called Surveyor.
- (5): Condition assessments on concrete (PCC) pavements are not conducted for Alligator Cracking, Transverse or Longitudinal Cracking, Patching, or Rutting. Perfect values for concrete road sections for these indexes are default values and do not represent a condition assessment of the concrete surfaces.
- (6): Roadway cracking presence, type, severity, and extent are determined by filming the roadway in the primary lane continuously with two overlapping analog cameras of 640 x 480 resolutions. The images from both cameras are stitched together in real time to create a continuous strip image of the roadway pavement in the primary lane. Cracks 3 mm or greater in width are visible in this video. A semi-automatic process running the WiseCrax software with additional input by human operators provides the cracking quantities recorded in these database fields. Quality checks have determined that a consistent 80% or better of the visible cracks are recorded.

Access Database Metadata

MASTER Table Metadata:

						EXPECTED
	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	ACCURACY
						100% Referenced to
1	RIP_CYCLE	XX	4, for data collection cycle 4	Route ID Meeting	FHWA Determination	other tables
	GT 4 TT	****				100%, Referenced to
2	STATE	XX	State where route is located	Route ID Meeting	Park Input / FHWA Determination	other tables (1)
	DADIZ ALDIJA	WWW	Ded of the colo	Desta ID Markins	NIDC D. C	100%, Referenced to
3	PARK_ALPHA	XXXX	Park alpha code	Route ID Meeting	NPS References	other tables 100%, Referenced to
4	PARK_NO	XXXX	Park numeric code	Route ID Meeting	NPS References	other tables
4	FARK_NO	ΛΛΛΛ	Fark numeric code	Route ID Weeting	NFS References	100%, Referenced to
5	RTE_NO	9999XXX	Route number	Route ID Meeting	Park Input / FHWA Classification	other tables
	KIL_IVO))))/AAA	Route number	Route 1D Weeting	Tark input / TTWA Classification	100%, Referenced to
						other tables. 100
6	RTE_NAME	(Text)	Route name	Route ID Meeting	Park Input	characters fit in field
		(/				100%, Referenced to
7	FUNCT_CLASS	X	Route functional classification	Route ID Meeting	Park Input / FHWA Classification	other tables
			Survey lane: PRI (primary) or			
8	DIRECTION	XXX	OPP (opposite)	Route ID Meeting	Park Input / FHWA Determination	100%,
						Estimated before data
9	BEG_MP_EST	999.999 (miles)	Estimated starting MP	Route ID Meeting	Park Input / FHWA Determination	collected
						Estimated before data
10	END_MP_EST	999.999 (miles)	Estimated ending MP	Route ID Meeting	Park Input / FHWA Determination	collected
11	RTE_LENGTH	999.999 (miles)	Collected route length	ARAN Data Collection	Automatic Output	100%
						100% Referenced to
12	FROM_DESC	(Text)	Beginning terminus of route	Route ID Meeting	Park Input / FHWA Determination	other tables
1.0	TO DEGG	(T)		B I B W	D 1 I . (FINIA D	100% Referenced to
13	TO_DESC	(Text)	Ending terminus of route	Route ID Meeting	Park Input / FHWA Determination	other tables
14	NO_LANES	X	Number of lanes in route	ARAN Data Collection	Survey Crew Input	Untested. (1)
1.5	CLIDE TYPE	3737		ADAND (CIL)		100%, Referenced to
15	SURF_TYPE	XX	Surface type of route	ARAN Data Collection	Survey Crew Input	other tables (1)
			Compass direction of route's			
16	COMP DIR	XX	primary lane (nearest cardinal direction)	Route ID Meeting	Park Input / FHWA Determination	Untested
17	COMP_DIR COMMENTS	(Text)	Special information, if any	Contractor Post-processing	Contractor Input	Untested
18	FILENAME	` ′	Filename of raw data files	ARAN Data Collection		100%
18	FILENAME	(Text)	rhename of raw data mes		Automatic Output Survey Crew Input/Automatic	100%
19	SECTION	(Text)	Route section ID	Route ID Meeting/ARAN Data Collection	Output Output	100%
19	SECTION	(Text)	Route section ID	Data Collection	Output	10070

20	FKEY	9999999	Unique record ID	Contractor Post-processing	Database Processing	100%
21	DATE	MM/DD/YY	Data collection date	ARAN Data Collection	Automatic Output	100%
22	BEG_MP	999.999 (miles)	Beginning MP collected	ARAN Data Collection	Automatic Output	100% (3)
23	END_MP	999.999 (miles)	Ending MP collected	ARAN Data Collection	Automatic Output	100% (3)

PMS_FEATURE Table Metadata:

				g 0 + 1 + 0 + 0 + 0 + 0 + 0 + 0 + 0 + 0 +		EXPECTED
	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	ACCURACY
1	DID CYCLE	3737	4.6.1.11.11.11.11.11	D (IDM)	EINMA D	100% Referenced to
1	RIP_CYCLE	XX	4, for data collection cycle 4	Route ID Meeting	FHWA Determination	other tables
	CTLA TEC	WW	State of home was to de la set of	Daniel ID Markins	Park Input / FHWA	H-4-4-1(1)
2	STATE	XX	State where route is located	Route ID Meeting	Determination	Untested (1) 100% Referenced to
3	DADK ALDHA	XXXX	Dorle alpha anda	Route ID Meeting	NPS References	other tables
3	PARK_ALPHA	ΛΛΛΛ	Park alpha code	Route ID Meeting	NPS References	100% Referenced to
4	PARK_NO	XXXX	Park numeric code	Route ID Meeting	NPS References	other tables
4	FARK_NO	ΛΛΛΛ	Fark numeric code	Route ID Meeting	Park Input / FHWA	100% Referenced to
5	RTE_NO	9999XXX	Route number	Route ID Meeting	Classification	other tables
5	KIE_NO	JJJJAAA	Facility Management	Route ID Meeting	Classification	other tables
			Software System Equipment			
6	FMSS_EQUIP	XXXXXXX	number	NPS FMSS application	NPS References	Untested
	TWISS_EQUI		number	THE THISE application	Park Input / FHWA	100% Referenced to
7	FUNCT_CLASS	X	Route functional class	Route ID Meeting	Classification	other tables
			Survey lane: PRI (primary)		Park Input / FHWA	
8	DIRECTION	XXX	or OPP (opposite)	Route ID Meeting	Determination	100%
				ARAN Data		
				Collection/Contractor Post-		
9	MP	999.999 (miles)	Feature location along route	processing	Video Analysis	<=0.001 mile
			Feature Beginning location			
10	BEG_MP	999.999 (miles)	along route	Contractor Post-processing	Video Analysis	<=0.001 mile
			Feature Ending location			
11	END_MP	999.999 (miles)	along route	Contractor Post-processing	Video Analysis	<=0.001 mile
12	FEATURE_LENGTH	999.99 (Feet)	Linear Feature Length	Contractor Post-processing	Database Processing	100%
13	EVENT	XXXX	Event category of feature	Contractor Post-processing	Video Analysis	Untested
			Event sub-category of			
14	EVENT_CODE	XXXX	feature	Contractor Post-processing	Video Analysis	Untested
			Feature designation:			
15	FEATURE_TYPE	(Text)	LINEAR or POINT	Contractor Post-processing	Video Analysis	Untested
1	ELIENT DEGG	(T)	Description of		X7' 1	T
16	EVENT_DESC	(Text)	feature/contents of sign	Contractor Post-processing	Video Analysis	Untested
17	MUTCD	(Text)	MUTCD Code of Sign	Contractor Post-processing	Database Processing	95%
1.0	GOVIDALIAON	(OT / A 33	Sign condition. N/A. Not to		X7'1 4 1 '	Values inaccurate,
18	CONDITION	"N/A"	be populated	Contractor Post-processing	Video Analysis	defaulted to "N/A"
19	COMMENT	(T4)	Sign label, intersecting	Contractor Doct	Dotoboso Ducassina	Untested
19	COMMENT	(Text)	route, etc. Offset from Road Edge.	Contractor Post-processing	Database Processing	Values inaccurate,
20	OFFSET	"N/A"	N/A. Not to be populated	Contractor Post-processing	Database Processing	defaulted to "N/A"
20	OFFSEI	1N/A	IN/A. Not to be populated	Contractor Post-processing	Database Processing	uerauneu to IN/A

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
	TIEED	TORMIT	Side of route relative to lane	SOURCE	VILLIDITION	necemiei
21	SIDE	(Text)	driven	Contractor Post-processing	Video Analysis	95%
		, ,	FHWA bridge structure			
22	STR_NUMBER	(Text)	number	FHWA Post-processing	Database Processing	Untested
23	BARR_MAT	(Text)	Barrier Material Type	Contractor Post-processing	Video Analysis	Untested
24	BARR_TYPE	(Text)	Barrier Type	Contractor Post-processing	Video Analysis	Untested
25	BARR_POST_MAT	(Text)	Barrier Post Materials	Contractor Post-processing	Video Analysis	Untested
26	BARR_BEG_TERM	(Text)	Barrier Approach Treatment	Contractor Post-processing	Video Analysis	Untested
27	BARR_END_TERM	(Text)	Barrier End Treatment	Contractor Post-processing	Video Analysis	Untested
28	CURB_MAT	(Text)	Curb Material Type	Contractor Post-processing	Video Analysis	Untested
29	PAVED_DITCH_MAT	(Text)	Paved Ditch Material Type	Contractor Post-processing	Video Analysis	Untested (2)
30	GATE_MAT	(Text)	Gate Material Type	Contractor Post-processing	Video Analysis	Untested
31	GATE_STYLE	(Text)	Gate Style	Contractor Post-processing	Video Analysis	Untested
32	BEG_GPS_LAT	999.999999	GPS Latitude Co-ordinate (decimal degrees)	Contractor Post-processing	Video Analysis	<= 3.00 feet
33	BEG_GPS_LON	-999.999999	GPS Longitude Co-ordinate (-decimal degrees)	Contractor Post-processing	Video Analysis	<= 3.00 feet
34	BEG_GPS_ELEV	99999.9	GPS Elevation Feet	Contractor Post-processing	Video Analysis	Untested
35	BEG_GPS_MODE	(Text)	GPS Satellite Mode	Contractor Post-processing	Video Analysis	Untested
			GPS Latitude Co-ordinate			
36	END_GPS_LAT	999.999999	(decimal degrees)	Contractor Post-processing	Video Analysis	<= 3.00 feet
27	END CDC LON	-999.999999	GPS Longitude Co-ordinate	Control Doct many continu	77' 1 A 1 '.	2.00 5
37	END_GPS_LON END GPS ELEV	9999999	(-decimal degrees) GPS Elevation Feet	Contractor Post-processing	Video Analysis Video Analysis	<= 3.00 feet Untested
-		(Text)	GPS Elevation Feet GPS Satellite Mode	Contractor Post-processing	Video Analysis Video Analysis	Untested
39 40	END_GPS_MODE DATUM	` /		Contractor Post-processing	,	100%
40	DATUM	(Text)	LL_WGS84_DD Removable USB video hard	Contractor Post-processing	Database Processing	100%
41	VIDEO	< <i>Park</i> >C04VID<#>	drive number	Contractor Post-processing	Database Processing	Untested
	, IDEO	T WIND COTTED (II)	Filename of .jpg image	Contractor 1 ost processing	Butuouse 110ccssing	Chrested
42	IMAGE	(Text)	showing feature	Contractor Post-processing	Automatic Output	Untested
43	DATE	MM/DD/YY	Data collection date	ARAN Data Collection	Automatic Output	100%
44	FILENAME	(Text)	Filename of raw data files	ARAN Data Collection	Automatic Output	100%
				Route ID Meeting/ARAN	Survey Crew	
45	SECTION	(Text)	Route section ID	Data Collection	Input/Automatic Output	100%
46	FKEY	(Numeric)	Unique record ID	Contractor Post-processing	Database Processing	100%
1.			Raw MP of first video frame			
47	VISI_FROM	999999 (millimiles)	showing feature	Contractor Post-processing	Database Processing	Untested
48	VISI_TO	999999 (millimiles)	Raw MP of last video frame showing feature	Contractor Post-processing	Database Processing	Untested

						EXPECTED
	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	ACCURACY
			Unique record ID used by			
49	IDKEY	(Text)	VisiData	Contractor Post-processing	Database Processing	Untested
			Range of mileage to play in			
50	MP_REF	(Text)	VisiData	Contractor Post-processing	Database Processing	Untested

	List of Roadway Features								
#	EVENT	EVENT_CODE	FEATURE_TYPE	EVENT_DESC	STRUCTURE #	COLLECTED BY			
1	BRIDGE	BRDG	LINEAR	BRIDGE	ALWAYS	ARAN			
2	CATTLE GUARD	CGD	POINT	CATTLE GUARD	-	VIDEO RATING			
3	CONSTRUCTION	CNST	LINEAR	CONSTRUCTION WORK ZONE	-	ARAN			
4	CULVERT	CUL	POINT	CULVERT	SOMETIMES	ARAN			
5	CURB	CRBL	LINEAR	CURB ON LEFT	-	VIDEO RATING			
	""	CRBR	LINEAR	CURB ON RIGHT	-	VIDEO RATING			
6	CURB-AND- GUTTER	CAGL	LINEAR	CURB-AND-GUTTER ON LEFT	-	VIDEO RATING			
	""	CAGR	LINEAR	CURB-AND-GUTTER ON RIGHT	-	VIDEO RATING			
7	DROP INLET	DINL	POINT	DROP INLET ON LEFT	-	ARAN			
	""	DINR	POINT	DROP INLET ON RIGHT	-	ARAN			
8	GATE	GATE	POINT	GATE	-	VIDEO RATING			
9	FIRE HYDRANT	FHDL	POINT	FIRE HYDRANT ON LEFT	-	VIDEO RATING			
	""	FHDR	POINT	FIRE HYDRANT ON RIGHT	-	VIDEO RATING			
10	GUARD/GUIDE WALL	GGWL	LINEAR	GUARD/GUIDE WALL ON LEFT	-	VIDEO RATING			
	""	GGWR	LINEAR	GUARD/GUIDE WALL ON RIGHT	-	VIDEO RATING			
11	GUARD/GUIDE RAIL	GGRL	LINEAR	GUARD/GUIDE RAIL ON LEFT	-	VIDEO RATING			
	""	GGRR	LINEAR	GUARD/GUIDE RAIL ON RIGHT	-	VIDEO RATING			
12	INTERSECTION	INTL	POINT	INTERSECTION ON LEFT	-	ARAN			
	""	INTR	POINT	INTERSECTION ON RIGHT	-	ARAN			
	""	INTN	POINT	INTERSECTION SIDE N/A	-	ARAN			

	LANE					
13	DEVIATION	LADV	LINEAR	LANE DEVIATION	-	ARAN
14	LOW WATER CROSSING	LWCR	LINEAR	LOW WATER CROSSING	SOMETIMES	VIDEO RATING
15	MILE MARKER	MML	POINT	MILE MARKER ON LEFT	-	VIDEO RATING
	""	MMR	POINT	MILE MARKER ON RIGHT	-	VIDEO RATING
16	OVERPASS	OPV	POINT	OVERPASS VEHICULAR	SOMETIMES	ARAN
	""	OPP	POINT	OVERPASS PEDESTRIAN	SOMETIMES	ARAN
	""	OPRX	POINT	OVERPASS RAILROAD CROSSING	SOMETIMES	ARAN
17	PARK BOUNDARY	PRK	POINT	PARK BOUNDARY	-	ARAN
18	PAVED DITCH	PVDL	LINEAR	PAVED DITCH ON LEFT	-	VIDEO RATING
	""	PVDR	LINEAR	PAVED DITCH ON RIGHT	-	VIDEO RATING
19	PULLOUT	PLOL	LINEAR	PULLOUT ON LEFT	-	VIDEO RATING
	""	PLOR	LINEAR	PULLOUT ON RIGHT	-	VIDEO RATING
20	RAILROAD CROSSING	RRX	POINT	RAILROAD CROSSING	-	VIDEO RATING
21	RETAINING WALL	RTWL	LINEAR	RETAINING WALL ON LEFT	-	VIDEO RATING
	""	RTWR	LINEAR	RETAINING WALL ON RIGHT	-	VIDEO RATING
22	ROUTE BEGIN	RBEG	POINT	ROUTE BEGIN	-	ARAN
23	ROUTE END	REND	POINT	ROUTE END	-	ARAN
24	SIGN	REGU, WARN, GUID, UNKN	POINT	DOCUMENT CONTENTS OF SIGN. (WHAT THE SIGN SAYS) FOR GRAPHICS ONLY SIGNS POPULATED WITH ("GRAPHIC SIGN, NO TEXT") FOR UNREADABLE TEXT POPULATED WITH ("UNABLE TO READ FROM VIDEO")	-	VIDEO RATING
24	STATE	GUID, UNKN	FOINT	TROW VIDEO)	-	VIDEO KATINO
25	BOUNDARY	STB	POINT	STATE BOUNDARY	-	ARAN
26	TRAFFIC LIGHT	TRF	POINT	TRAFFIC LIGHT	-	VIDEO RATING
27	TUNNEL	TUN	LINEAR	TUNNEL	ALWAYS	ARAN

PMS_20, PMS_MILE, & PMS_TENTH Tables Metadata:

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
			4, for RIP data collection			100% Referenced to other
1	RIP_CYCLE	XX	Cycle 4	Route ID Meeting	FHWA Determination	tables
					Park Input/FHWA	
2	STATE	XX	State where route is located	Route ID Meeting	Determination	Untested. (1)
						100% Referenced to other
3	PARK_ALPHA	XXXX	Park alpha code	Route ID Meeting	NPS References	tables
						100% Referenced to other
4	PARK_NO	XXXX	Park numeric code	Route ID Meeting	NPS References	tables
					Park Input/FHWA	100% Referenced to other
5	RTE_NO	9999XXX	Route number	Route ID Meeting	Classification	tables
					Park Input/FHWA	100% Referenced to other
6	FUNCT_CLASS	X	Route functional class	Route ID Meeting	Classification	tables
			Survey lane: PRI (primary)		Park Input/FHWA	
7	DIRECTION	XXX	or OPP (opposite)	Route ID Meeting	Determination	100%
			MP at start of road interval			
	DEC 10	000 000 (11)	described by database			1000/ (2)
8	BEG_MP	999.999 (miles)	record	Contractor Post-processing	Database Processing	100% (3)
			MP at end of road interval			
9	END MP	999.999 (miles)	described by database record	Contractor Post-processing	Database Processing	100% (3)
9	END_MF	999.999 (IIIIles)	Length of road interval as	Collitación Fost-processing	Database Flocessing	100% (3)
10	INT_LENGTH	999.9 (ft)	aggregated for data table	Contractor Post-processing	Database Processing	100%
11	RTE LENGTH	999.999 (miles)	Collected route length	ARAN Data Collection	Automatic Output	100% (3)
12	NO LANES	99	Number of lanes in route	ARAN Data Collection	Survey Crew Input	Untested. (1)
13	_	99	Data collection lane	 	Database Processing	Untested. (1)
13	LANE_NO	99	WiseCrax (crack detection	Contractor Post-processing	Database Processing	Untested
14	D_LANE_WIDTH	99.999 (ft)	software) analysis width	Contractor Post-processing	Automatic Output	Untested
15	LANE_WIDTH	99.9 (ft)	Width of lane	Contractor Post-processing	Video Analysis	95%, <=1.0 foot
16	PAVE_WIDTH	99.9 (ft)		Contractor Post-processing Contractor Post-processing	Video Analysis Video Analysis	95%, <=1.0 foot
-	_	` ′	Full pavement width	1 0	ž	
17	SHLD_WIDTH_L	99.9 (ft)	Left shoulder width	Contractor Post-processing	Video Analysis	95%, <=1.0 foot (2)
18	SHLD_WIDTH_R	99.9 (ft)	Right shoulder width	Contractor Post-processing	Video Analysis	95%, <=1.0 foot (2)
1.0	CITED COND I	NT/A	N/A. Intended to be Left	ADAND (CIL C		Values inaccurate, defaulted
19	SHLD_COND_L	N/A	shoulder condition	ARAN Data Collection	Survey Crew Input	to "N/A"
20	CHI D COND D	NT/A	N/A. Intended to be Right	AD AN Data Calledian	Comment Comment	Values inaccurate, defaulted
20	SHLD_COND_R	N/A	shoulder condition N/A. Intended to be Left	ARAN Data Collection	Survey Crew Input	to "N/A"
21	DDAIN COND I	NT/A		APAN Data Callaction	Survey Cray Innut	Values inaccurate, defaulted to "N/A"
21	DRAIN_COND_L	N/A	drainage condition N/A. Intended to be Right	ARAN Data Collection	Survey Crew Input	Values inaccurate, defaulted
22	DRAIN_COND_R	N/A	drainage condition	ARAN Data Collection	Survey Crew Input	to "N/A"
22	DRAIN_COND_R	1 V / <i>F</i> 1	dramage condition	ANAN Data Collection	Survey Crew Input	io IN/A

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
23	SURF_TYPE	XX	Surface type of route	ARAN Data Collection	Survey Crew Input	Untested. (1)
24	PCR	999	Pavement Condition Rating	Contractor Post-processing	Database Processing	100% for calculation (6)
			Roughness Condition Index;			
25	RCI	999	-1 if invalid IRI	Contractor Post-processing	Database Processing	100% for calculation
26	SCR	999	Surface Condition Rating	Contractor Post-processing	Database Processing	100% for calculation (5) (6)
27	IRI_AVG	999.9 (inches/mile)	Average IRI	Contractor Post-processing	Database Processing	Untested
28	IRI_SD	999.9 (inches/mile)	IRI standard deviation	Contractor Post-processing	Database Processing	Untested
29	IRI_L	999.9 (inches/mile)	Left wheel path IRI	ARAN Data Collection	Automatic Output	Untested
30	IRI_R	999.9 (inches/mile)	Right wheel path IRI	ARAN Data Collection	Automatic Output	Untested
31	IRI_FLAG	0 or -1	-1 if invalid IRI data	Contractor Post-processing	Database Processing	Untested
32	RUT_INDEX	999	Rut index	Contractor Post-processing	Database Processing	100% for calculation (5)
			Average rut depth of both			
33	RUT_AVG	99.99 (inches)	wheelpaths	Contractor Post-processing	Database Processing	Untested (5)
			Maximum rut depth of both			
34	RUT_MAX	99.99 (inches)	wheelpaths	Contractor Post-processing	Database Processing	Untested (5)
35	RUT_SD	9.9	Rut depth standard deviation	Contractor Post-processing	Database Processing	Untested (5)
			Percent of low severity ruts			
36	RUT_LOW	999 (%)	(on a 0-200% scale) in both wheelpaths	Contractor Post-processing	Database Processing	Untested (5)
30	KU1_LOW	999 (%)	Percent of medium severity	Contractor Post-processing	Database Processing	Official (3)
			ruts (on a 0-200% scale) in			
37	RUT MED	999 (%)	both wheelpaths	Contractor Post-processing	Database Processing	Untested (5)
		222 (14)	Percent of high severity ruts			(2)
			(on a 0-200% scale) in both			
38	RUT_HI	999 (%)	wheelpaths	Contractor Post-processing	Database Processing	Untested (5)
			Cross fall at start of road			
39	XFALL	999.9 (% slope)	interval	ARAN Data Collection	Automatic Output	Untested
40	GRADE	000 0 (0/ -1)	Grade at start of road	ARAN Data Collection	A damentic O day	TI-4-4-4
40		999.9 (% slope)	interval		Automatic Output	Untested
41	AC_INDEX	999	Alligator cracking index Percent of WiseCrax	Contractor Post-processing	Database Processing	100% for calculation (5) (6)
			measured lane area with			
			low-severity alligator			As a Computed 95%
42	AC LOW	999.9999 (%)	cracking	Contractor Post-processing	Pavement Video Analysis	Confidence Level (5) (6)
	_	. ,	Percent of WiseCrax			
			measured lane area with			
			medium-severity alligator			As a Computed 95%
43	AC_MED	999.9999 (%)	cracking	Contractor Post-processing	Pavement Video Analysis	Confidence Level (5) (6)
			Percent of WiseCrax			1050
1 4 4	AC III	000 0000 (0/)	measured lane area with	Company of the Dord Company of the C	Design and Wide A and a de	As a Computed 95%
44	AC_HI	999.9999 (%)	high-severity alligator	Contractor Post-processing	Pavement Video Analysis	Confidence Level (5) (6)

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
			cracking			
45	LC_INDEX	999	Longitudinal cracking index	Contractor Post-processing	Database Processing	100% for calculation (5) (6)
46	LC_LOW	999.99 (%)	Low-severity longitudinal cracking in lane as a percentage of road interval length	Contractor Post-processing	Pavement Video Analysis	As a Computed 95% Confidence Level (5) (6)
47	LC_MED	999.99 (%)	Medium-severity longitudinal cracking in lane as a percentage of road interval length High-severity longitudinal	Contractor Post-processing	Pavement Video Analysis	As a Computed 95% Confidence Level (5) (6)
48 49	LC_HI TC_INDEX	999.99 (%) 999	cracking in lane as a percentage of road interval length Transverse cracking index	Contractor Post-processing Contractor Post-processing	Pavement Video Analysis Database Processing	As a Computed 95% Confidence Level (5) (6) 100% for calculation (5) (6)
50	TC_LOW	999.99 (cracks)	Count of low-severity transverse cracks, where one crack unit equals the WiseCrax measured lane width	Contractor Post-processing	Pavement Video Analysis	As a Computed 95% Confidence Level (5) (6)
51	TC_MED	999.99 (cracks)	Count of medium-severity transverse cracks, where one crack unit equals the WiseCrax measured lane width	Contractor Post-processing	Pavement Video Analysis	As a Computed 95% Confidence Level (5) (6)
52	TC_HI	999.99 (cracks)	Count of high-severity transverse cracks, where one crack unit equals the WiseCrax measured lane width	Contractor Post-processing	Pavement Video Analysis	As a Computed 95% Confidence Level (5) (6)
53	PATCH_INDEX	999	Patching index	Contractor Post-processing	Database Processing	100% for calculation (5) (6)
54	PATCHING	999.9999 (%)	Percent of WiseCrax measured lane area affected by patching	Contractor Post-processing	Pavement Video Analysis	As a Computed 95% Confidence Level (5) (6)
55	GPS_LAT	999.999999	Latitude coordinate	ARAN Data Collection	Automatic Output	<= 3.00 feet
56	GPS_LON	-999.999999	Longitude coordinate	ARAN Data Collection	Automatic Output	<= 3.00 feet
57	GPS_ELEV	99999.9	Elevation	ARAN Data Collection	Automatic Output	Untested
58	GPS_MODE	XXX	GPS Satellite Mode during collection	ARAN Data Collection	Automatic Output	Untested
59	DATUM	(Text)	LL_WGS84_DD	ARAN Data Collection	Database Processing	100%
60	VIDEO	< <i>Park</i> >C04VID<#>	Removable USB video hard	Contractor Post-processing	Database Processing	Untested

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
			drive number			
			Filename of .jpg image			
61	IMAGE	(Text)	showing road interval	Contractor Post-processing	Automatic Output	Untested
			Average ARAN speed			
62	SPEED	999 (miles/hour)	during data collection	ARAN Data Collection	Automatic Output	Untested
			Flag indicating presence of			
63	BRIDGE_FLAG	0 or 1	bridge in interval	ARAN Data Collection	Survey Crew Input	Untested
			Flag indicating construction			
64	CONSTR_FLAG	0 or 1	in interval	ARAN Data Collection	Survey Crew Input	Untested
			Flag indicating lane			
65	LANEDEV_FLAG	0 or 1	deviation in interval	ARAN Data Collection	Survey Crew Input	Untested
66	DATE	MM/DD/YY	Data collection date	ARAN Data Collection	Automatic Output	100%
			Flag indicating absence of			
67	NODISTRESS	0 OR 1	pavement distress	Contractor Post-processing	Database Processing	100%
68	FILENAME	(Text)	Filename of raw data files	ARAN Data Collection	Automatic Output	100%
				Route ID Meeting/ARAN Data	Survey Crew Input/Automatic	
69	SECTION	(Text)	Route section ID	Collection	Output	100%
70	FKEY	(Numeric)	Unique record ID	Contractor Post-processing	Database Processing	100%
			Raw MP of first video frame		-	
71	CONTRACTOR1	(Numeric)	in section	Contractor Post-processing	Database Processing	Untested
			Raw MP of last video frame			
72	CONTRACTOR2	(Numeric)	in section	Contractor Post-processing	Database Processing	Untested
			Unique record ID used by			
73	CONTRACTOR3	(Text)	VisiData	Contractor Post-processing	Database Processing	Untested
			Range of mileage to play in			
74	CONTRACTOR4	(Text)	VisiData	Contractor Post-processing	Database Processing	Untested

ROUTE_GPS table metadata:

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
						100% referenced to other
1	RIP_CYCLE	XX	4, for RIP data collection Cycle 4	Route ID Meeting	FHWA Determination	tables
					Park Input/FHWA	
2	STATE	XX	State where route is located	Route ID Meeting	Determination	Untested
	DADIZ ALDILA	VVVV	Dowle alaba and a	Danta ID Mastina	NIDC Defenses	100% Referenced to other
3	PARK_ALPHA	XXXX	Park alpha code	Route ID Meeting	NPS References	tables 100% Referenced to other
4	PARK_NO	XXXX	Park numeric code	Route ID Meeting	NPS References	tables
H	17HKK_110	71777	Tark numeric code	Route 15 Weeting	Park Input/FHWA	100% Referenced to other
5	RTE_NO	9999XXX	Route number	Route ID Meeting	Classification	tables
					Park Input/FHWA	100% Referenced to other
6	FUNCT_CLASS	X	Route functional classification	Route ID Meeting	Classification	tables
						100% Referenced to other
						tables . 100 characters fit in
7	RTE_NAME	(Text)	Route name	Route ID Meeting	Park Input	field
8	LANE_NUMBER	99	Data collection lane	Contractor Post-processing	Database Processing	Untested
	DIDECTION	373737	Survey lane: PRI (primary) or		Park Input/FHWA	TT 1
9	DIRECTION	XXX	OPP (opposite)	Route ID Meeting	Determination	Untested
10	MP	999.999	Mile Post (at 0.01 record)	ARAN Data Collection, Contractor Post-processing	Survey Crew Input/GPS Processing	Untested (3)
10	IVII	777.777	GPS Latitude Co-ordinate	ARAN Data Collection,	Trocessing	Ontested (3)
11	GPS LAT	999.999999	(decimal degrees)	Contractor Post-processing	Automatic Output	<= 3.00 feet
	00%_====		GPS Longitude Co-ordinate	ARAN Data Collection,		
12	GPS_LON	-999.999999	(-decimal degrees)	Contractor Post-processing	Automatic Output	<= 3.00 feet
				ARAN Data Collection,		
13	GPS_ELEV	99999.9	Elevation	Contractor Post-processing	Automatic Output	Untested
			GPS Satellite Mode	ARAN Data Collection,		
14	GPS_MODE	XXX	during collection	Contractor Post-processing	Automatic Output	Untested
			Cross Fall: % Slope at GPS	ADAMB CHI C		
1.5	VEALI	000.0	Location (Caution, Data not	ARAN Data Collection,	A	I Interest of
15	XFALL	999.9	Validated) Grade: % Slope at GPS Location	Contractor Post-processing ARAN Data Collection,	Automatic Output	Untested
16	GRADE	999.9	(Caution, Data not Validated)	Contractor Post-processing	Automatic Output	Untested
17	HEADING	999.9	Heading Relative to True North	ARAN Data Collection	Automatic Output	Untested
18	DATUM		LL_WGS84_DD	ARAN Data Collection ARAN Data Collection	•	_
		(Text)			Database Processing	Untested
19	FILENAME	(Text)	Filename of raw data files	ARAN Data Collection	Automatic Output	Untested
20	FKEY	9999999	Unique record ID	Contractor Post-processing	Database Processing	Untested

21	DATE	MM/DD/YY	ARAN Data Collection Date	ARAN Data Collection	Automatic Output	Untested
22	COMMENT	(Text)	Source of Any Digitized Data	ARAN Data Collection	Database Processing	Untested
23	CONTRACTOR1	(Numeric)	Visi_from	Contractor Post-processing	Database Processing	Untested
24	CONTRACTOR2	(Numeric)	Visi_to	Contractor Post-processing	Database Processing	Untested
25	CONTRACTOR3	(Text)	Visi_dir (ipdated to chapter 1)	Contractor Post-processing	Database Processing	Untested
26	CONTRACTOR4	(Text)	Comments/exceptions	Contractor Post-processing	Database Processing	Untested

FHWA "Route ID Program" Database Database Name: ROUTEINFO.mdb Table Name: ROUTE_ID

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
. 1			The Park's Alpha Code + "-" +			100%, Reference source for all
1	ROUTE_IDENT	XXXX-9999XXX	RTE_NO (below).	Route ID Meeting	Automatic Output	tables
						100%, Reference source for all
2	RIP_CYCLE	99	4, for RIP data collection Cycle 4	Route ID Meeting	FHWA Determination	tables
						100%, Reference source for all
3	PARK_ALPHA	XXXX	Park Alpha Code	Route ID Meeting	NPS References	tables
	111111_11111	717171	Tun Tipiu Code	Troute 12 Treeting	THE References	100%, Reference source for all
4	GROUP_ALPHA	XXXX	Group Alpha Code	Route ID Meeting	NPS References	tables
	_		• •	, and the second		100%, Reference source for all
5	PARK_NO	9999	Park Numeric Code	Route ID Meeting	NPS References	tables
						100%, Reference source for all
6	PARK_NAME	(text)	NPS Name of Park	Route ID Meeting	NPS References	tables
						100%, Reference source for all
7	RTE NO	9999XXX	Route Number	Route ID Meeting	Park Input	tables
$\stackrel{\prime}{-}$	KIL_NO	<i>,,,,,</i> ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	Rode Pullion	Route 1D Weeting	Tuk iiput	100%, Reference source for all
8	RTE_NAME	(Text)	Route Name	Route ID Meeting	Park Input	tables
	_			Ŭ		100%, Reference source for all
9	FROM_DESC	(Text)	Beginning terminus of route	Route ID Meeting	Park Input/FHWA Determination	tables
						100%, Reference source for all
10	TO_DESC	(Text)	Ending terminus of route	Route ID Meeting	Park Input/FHWA Determination	tables
	nyan nyan			ARAN Data		100%, Reference source for all
11	INSP_DATE	MM/DD/YYYY	Collection Date	Collection	FHWA Determination	tables
12	FUNCT_CLASS	XX	Functional Class	Route ID Meeting	Park Input/FHWA Determination	100%, Reference source for all tables
					<u> </u>	
13	STATE	XX	State where route is located	Route ID Meeting	Park Input/FHWA Determination	Untested (1)
	CE A EEC	3737	Additional State Park Route	D (ID M (D 11 (FINAD : : :	11.4.4.171
14	STATE2	XX	traverses	Route ID Meeting	Park Input/FHWA Determination	Untested (1)
			NPS's Facility Management Software System (FMSS) Asset			100%, Reference source for all
15	FMSS_NO	(Text)	number	Route ID Meeting	Park Input	tables
15	11.100_110	(10At)	FMSS Surface Equipment	Troute ID Miceting	I mix iliput	the state of the s
16	FMSS_SUR_EQP	(Text)	Number	Route ID Meeting	Park Input	Untested
	`	` '	Park Maintenance District Route		1	100%, Reference source for all
17	M_DISTRICT	(Text)	resides in	Route ID Meeting	Park Input	tables (1)
18	TOPOGRAPHY	(Text)	Predominate Terrain condition for	Route ID Meeting	FHWA Determination	100%, Reference source for all

FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
		Route. (FLAT, ROLLING, MOUNTAINOUS, or URBAN)			tables (1)
		Posted Speed Limit for Route			
POSTED_SPEED	99	Limit along Route)	Route ID Meeting	Park Input/FHWA Determination	Untested (1)
_					100%, Reference source for all
ARAN_ROUTE	XXX	Yes/No	Route ID Meeting	Park Input/FHWA Determination	tables 100%, Reference source for all
PARKING_AREA	XXX	Yes/No	Route ID Meeting	Park Input/FHWA Determination	tables
CONCESSION	XXX	Yes/No	Route ID Meeting	Park Input	100%, Reference source for all tables
COTTELESSIOTT	717171		ARAN Data	T tak Input	100%, Reference source for all
PAVED_MI	999.999	0.001)	Collection	Automatic Output	tables
UNPAVED_MI	999.999	Unpaved mileage (to the nearest 0.001)	Route ID Meeting	Automatic Output	100%, Reference source for all tables
			Contractor Post-		100%, Reference source for all
RTE_LENGTH	999.999	<u> </u>	processing	Automatic Output	tables
		(concrete), BR (brick/pavers), CB			100%, Reference source for all
SURF_TYPE	XX	(cobblestone), OT (other))	Route ID Meeting	Survey Crew Input	tables (1)
UNPAVED	XXXX	Unpaved Route (Yes/No/Both)	Route ID Meeting	Automatic Output	100%, Reference source for all tables
UNPAVED_CAT	XXX	Unpaved Road Category	Route ID Meeting	Automatic Output	Untested
CLIDD	(T1)		Day to ID Markins	D. I. I (FINVA D. (coming)	Haradad
CURB	(1ext)		Route ID Meeting	Park Input/FHWA Determination	Untested
CURB_GUTTER	(Text)	Gutter around perimeter.	Route ID Meeting	Park Input/FHWA Determination	Untested
					100%, Reference source for all
ADJ_ROUTE	9999XXX	Route number	Route ID Meeting	Automatic Output	tables
USER ACCESS	(Text)	Access Designation for Parking	Route ID Meeting	Park Input/FHWA Determination	100%, Reference source for all tables
_	, ,	1			100%, Reference source for all
PHOTO_NO	(Text)	Photo or Image	Route ID Meeting	Survey Crew Input	tables
PLOT SIZE	(Text)	Unpayed Parking Area Size	Route ID Meeting	Automatic Output	100%, Reference source for all tables
	(2010)		Contractor Post-	stomate - stylet	100%, Reference source for all
SQ_FEET	999.999	Route Square Footage	processing	Automatic Output	tables
M RATING	(Text)	Manual Rating	Route ID Meeting	Automatic Output	100%, Reference source for all tables
	POSTED_SPEED ARAN_ROUTE PARKING_AREA CONCESSION PAVED_MI UNPAVED_MI RTE_LENGTH SURF_TYPE UNPAVED UNPAVED CURB CURB CURB_GUTTER ADJ_ROUTE USER_ACCESS PHOTO_NO PLOT_SIZE	POSTED_SPEED 99 ARAN_ROUTE XXX PARKING_AREA XXX CONCESSION XXX PAVED_MI 999.999 UNPAVED_MI 999.999 RTE_LENGTH 999.999 SURF_TYPE XX UNPAVED XXXX UNPAVED_CAT XXX CURB (Text) CURB_GUTTER (Text) ADJ_ROUTE 9999XXX USER_ACCESS (Text) PHOTO_NO (Text) PLOT_SIZE (Text) SQ_FEET 999.999	Route. (FLAT, ROLLING, MOUNTAINOUS, or URBAN) Posted Speed Limit for Route (Value is Predominate Speed Limit along Route) ARAN_ROUTE XXX Yes/No PARKING_AREA XXX Yes/No CONCESSION XXX Yes/No PAVED_MI 999.999 Paved mileage (to the nearest 0.001) UNPAVED_MI 999.999 Official Route Length Surface type (PAVED: AS (asphalt, includes composite), CO (concrete), BR (brick/pavers), CB (cobblestone), OT (other)) UNPAVED XXXX Unpaved Road Category PARKING_AREA XXX Unpaved Road Category PARKING_AREA WITH Curb and Gutter around perimeter. ADJ_ROUTE 9999XXX Route number USER_ACCESS (Text) Access Designation for Parking PHOTO_NO (Text) Photo or Image PLOT_SIZE (Text) Unpaved Parking Area Size SQ_FEET 999.999 Route Square Footage	Route. (FLAT, ROLLING, MOUNTAINOUS, or URBAN) Posted Speed Limit for Route (Value is Predominate Speed Limit along Route) Route ID Meeting ARAN_ROUTE XXX Yes/No Route ID Meeting PARKING_AREA XXX Yes/No Route ID Meeting PARKING_AREA XXX Yes/No Route ID Meeting PAVED_MI 999.999 0.001) Collection UNPAVED_MI 999.999 O.001) Collection UNPAVED_MI 999.999 Official Route Length Processing RTE_LENGTH 999.999 Official Route Length Processing SURF_TYPE XX (cobblestone), OT (other)) Route ID Meeting UNPAVED_CAT XXX Unpaved Road Category Route ID Meeting UNPAVED_CAT XXX Unpaved Road Category Route ID Meeting CURB (Text) Parking Area with Curb around perimeter. Route ID Meeting CURB_GUTTER (Text) Access Designation for Parking Route ID Meeting USER_ACCESS (Text) Access Designation for Parking Route ID Meeting PARKING_AREA XXX Ves/No Route ID Meeting Route ID Meeting	Route (FLAT, ROLLING, MOUNTAINOUS, or URBAN) Posted Speed Limit for Route (Value is Predominate Speed Limit along Route) Route ID Meeting Park Input/FHWA Determination ARAN_ROUTE XXX Yes/No Route ID Meeting Park Input/FHWA Determination ARAN_ROUTE XXX Yes/No Route ID Meeting Park Input/FHWA Determination PARKING_AREA XXX Yes/No Route ID Meeting Park Input/FHWA Determination CONCESSION XXX Yes/No Route ID Meeting Park Input/FHWA Determination PAVED_MI 999.999 Park Input PAVED_MI 999.999 Unpaved mileage (to the nearest Oolection Automatic Output UNPAVED_MI 999.999 Official Route Length Processing Automatic Output RTF_LENGTH 999.999 Official Route Length Processing Automatic Output UNPAVED_MS (asphalt, includes composite), CO (concrete, BR (brick/pavers), CB (cobblestone), OT (other)) ROUTE ID Meeting Survey Crew Input UNPAVED XXXX Unpaved Route (Yes/No/Both) Route ID Meeting Automatic Output UNPAVED_CAT XXX Unpaved Road Category Route ID Meeting Automatic Output UNPAVED_CAT XXX Unpaved Road Category Route ID Meeting Park Input/FHWA Determination CURB_GUTTER (Text) Parking Area with Curb and Gutter around perimeter. Route ID Meeting Park Input/FHWA Determination ADJ_ROUTE 9999XXX Route number Route ID Meeting Park Input/FHWA Determination PHOTO_NO (Text) Photo or Image Route ID Meeting Survey Crew Input PLOT_SIZE (Text) Unpaved Parking Area Size Route ID Meeting Survey Crew Input Contractor Post-processing Survey Crew Input Contractor Post-processing Automatic Output Contractor Post-processing Survey Crew Input PLOT_SIZE (Text) Unpaved Parking Area Size Route ID Meeting Automatic Output Contractor Post-processing Survey Crew Input Automatic Output Contractor Post-processing Automatic Output Contractor Post-processing Automatic Output Contractor Post-processing Automatic Output

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
				Contractor Post-		100%, Reference source for all
37	SQ_YARDS	999.999	Route Square Yardage	processing	Automatic Output	tables
38	LANES	XX	Route travel lanes	Route ID Meeting	Automatic Output	Untested (1)
39	PAVE_WIDTH	999.99	Pavement Width (Weighted average)	RIP Post-processing	Automatic Output	100% Referenced to other tables
39	TAVE_WIDTH	777.77	average)	Kii Tost-processing	Automatic Output	100% Referenced to other tables
40	LANE_MILES	999.999	Route Equivalent Lane Miles	RIP Post-processing	Automatic Output	100%, Reference source for all tables
41	AREA_MAP	(Text)	1 or 2-digit number	Contractor Post- processing	FHWA/Contractor Input	100%, Reference source for all tables
42	REMARKS	(Memo)	General remarks on Park route and data collection operations.	Contractor Post- processing	FHWA/Contractor Input	Untested
43	SUMMARY_REC	XXXX-9999XXX	ROUTE_IDENT of summary Park Asset	Route ID Meeting	Park Input/FHWA Determination	100%, Reference source for all tables
44	NPS_REGION	(Text)	Park Region	Route ID Meeting	Park Input/FHWA Determination	100%, Reference source for all tables
45	DIVISION	(Text)	FHWA Division	Route ID Meeting	Park Input/FHWA Determination	100%, Reference source for all tables
46	PCR	999.99	Route Weighted Average PCR value	RIP Post-processing	Automatic Output	100% Referenced to other tables
47	SCR	999.99	Route Weighted Average SCR value	RIP Post-processing	Automatic Output	100% Referenced to other tables
48	AADT	999	Average Adjusted Daily Traffic	RIP	Automatic Output	Untested
49	SADT	999	Seasonal Adjusted Daily Traffic	RIP	Automatic Output	Untested
50	ADT_DATE	MM/DD/YYYY	Traffic Date of Collection	RIP	Automatic Output	Untested
51	BEG_LAT	999.999999	Route Begin GPS Latitude Co- ordinate (decimal degrees)	ARAN Data Collection	Automatic Output	<= 3.00 feet, Referenced from other tables
52	BEG_LON	-999.999999	Route Begin GPS Longitude Co- ordinate (-decimal degrees)	ARAN Data Collection	Automatic Output	<= 3.00 feet, Referenced from other tables
53	BEG_ELEV	99999.9	Route Begin Elevation	ARAN Data Collection	Automatic Output	100% Referenced to other tables
54	BEG_MODE	XXX	Route Begin GPS Satellite Mode during collection	ARAN Data Collection	Automatic Output	100% Referenced to other tables
55	END_LAT	999.999999	Route End GPS Latitude Co- ordinate (decimal degrees)	ARAN Data Collection	Automatic Output	<= 3.00 feet, Referenced from other tables

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
56	END_LON	-999.999999	Route End GPS Longitude Co- ordinate (-decimal degrees)	ARAN Data Collection	Automatic Output	<= 3.00 feet, Referenced from other tables
57	END_ELEV	99999.9	Route End Elevation	ARAN Data Collection	Automatic Output	100% Referenced to other tables
58	END_MODE	XXX	Route End GPS Satellite Mode during collection	ARAN Data Collection	Automatic Output	100% Referenced to other tables
59	DATUM	(Text)	LL_WGS84_DD	ARAN Data Collection	Automatic Output	100% Referenced to other tables
60	CHILD_ROUTE	XXX	Yes/No	Route ID Meeting	Automatic Output	100% Reference source for all tables
61	CULVERT_CNT	999	Route Culvert Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
62	DROP_INLET_CNT	999	Route Drop Inlet Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
63	GATE_CNT	999	Route Gate Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
64	TRAFLIGHT_CNT	999	Route Traffic Light Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
65	SIGN_CNT	999	Route Sign Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
66	LWCROSS_CNT	999	Route Low Water Crossing Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
67	BRIDGE_CNT	999	Route Bridge Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
68	TUNNEL_CNT	999	Route Tunnel Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
69	PULLOUT_CNT	999	Route Pullout Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
70	INTERSEC_CNT	999	Route Intersection Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
71	ST_BNDRY_CNT	999	Route State Boundary Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
72	PRK_BNDRY_CNT	999	Route Park Boundary Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
73	RETWALL_CNT	999	Route Retaining Wall Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
74	RR_CROSS_CNT	999	Route RR Crossing Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
75	CATTLE_CNT	999	Route Cattle Guard Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
76	OVHDSIGN_CNT	999	Route Overhead Sign Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
77	MILEMARK_CNT	999	Route Mile Marker Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
78	FHYD_CNT	999	Route Fire Hydrant Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
79	OVERPASS_CNT	999	Route Overpass Count	RIP Post-processing	Automatic Output	100% Referenced to other tables
80	CABLE_TLNG	9999.999 (ft)	Route Total Length Cable Barriers	RIP Post-processing	Automatic Output	100% Referenced to other tables

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
			Route Total Length Guard/Guide			
81	GDRAIL_TLNG	9999.999 (ft)	Rail Barriers	RIP Post-processing	Automatic Output	100% Referenced to other tables
			Route Total Length Guard/Guide			
82	GDWALL_TLNG	9999.999 (ft)	Wall Barriers	RIP Post-processing	Automatic Output	100% Referenced to other tables
			Route Total Length Temporary		1	
83	TEMP_BARR_TLNG	9999.999 (ft)	Barriers	RIP Post-processing	Automatic Output	100% Referenced to other tables
			Route Total Length Bollard		1	
84	BOLLARD_TLNG	9999.999 (ft)	Barriers	RIP Post-processing	Automatic Output	100% Referenced to other tables
85	BARRIER_TLNG	9999.999 (ft)	Route Total Length All Barriers	RIP Post-processing	Automatic Output	100% Referenced to other tables
			Route Total Length Curbing			
86	CURB_TLNG	9999.999 (ft)	(excludes Parking Areas)	RIP Post-processing	Automatic Output	100% Referenced to other tables
			Route Total Length Low Water			
87	LWCROSS_TLNG	9999.999 (ft)	Crossings	RIP Post-processing	Automatic Output	100% Referenced to other tables
						100% Referenced to other tables
88	PAVDITCH_TLNG	9999.999 (ft)	Route Total Length Paved Ditch	RIP Post-processing	Automatic Output	(2)
89	TURNOUT_TLNG	9999.999 (ft)	Route Total Length Turnouts	RIP Post-processing	Automatic Output	100% Referenced to other tables
90	LANE_NUMBER	99	Number of Lane Tested	RIP Post-processing	Automatic Output	100% Referenced to other tables
						100% Reference source for all
91	LOCAL_FACTOR	9.9999	Park Location Factor	NPS Partner	Automatic Output	tables
						100% Reference source for all
92	E_ZONE	XXX	Route Environmental Zone	FHWA HPMA	Automatic Output	tables
						100% Reference source for all
93	PAVEMENT_DM	\$99,999,999.99	Pavement Deferred Maintenance	FHWA HPMA	Automatic Output	tables
						100% Reference source for all
94	CRV	\$99,999,999.99	Current Replacement Value	RIP Post-processing	Automatic Output	tables

Database Name: ROUTEINFO.mdb Table Name: PARK_TOTALS

	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	EXPECTED ACCURACY
						100% Referenced to other
1	RIP_CYCLE	99	4, for RIP data collection Cycle 4	Route ID Meeting	FHWA Determination	tables
						100% Referenced to other
2	PARK_ALPHA	XXXX	Park Alpha Code	Route ID Meeting	FHWA Determination	tables
						100% Referenced to other
3	GROUP_ALPHA	XXXX	Group Alpha Code	Route ID Meeting	NPS References	tables
						100% Referenced to other
4	PARK_NO	9999	Park Numeric Code	Route ID Meeting	NPS References	tables
						100% Referenced to other
5	PARK_NAME	XXXX	NPS Name of Park	Route ID Meeting	NPS References	tables
				Route ID Meeting and		100015
	DIGD DATE		Date that data was collected in the park	ARAN Data		100% Referenced to other
6	INSP_DATE	MM/DD/YYYY	(completion date).	Collection	FHWA Determination	tables
						100% Referenced to other
7	NPS_REGION	XXXX	Park Region	Route ID Meeting	Park Input	tables
						100% Referenced to other
8	DIVISION	XXXX	FHWA Division	Route ID Meeting	FHWA Determination	tables
						100% Referenced to other
9	T_PAVED_MI	999.999	Total Park Paved Miles	RIP Post-processing	Automatic Output	tables
1.0						100% Referenced to other
10	T_UNPAVED_MI	999.999	Total Park Unpaved Miles	RIP Post-processing	Automatic Output	tables
1.1	T DOLLTE MILES	000 000	T . 1 D . 1 D 1 C .	DIDD		100% Referenced to other
11	T_ROUTE_MILES	999.999	Total Park Route Miles	RIP Post-processing	Automatic Output	tables
10	T ADAM DDIVEN	000 000	Tetal Deal ADANI Delega Miles	DID Dead areas and	A	100% Referenced to other
12	T_ARAN_DRIVEN	999.999	Total Park ARAN Driven Miles	RIP Post-processing	Automatic Output	tables 100% Referenced to other
13	T ADAN I MILES	999.999	Total Park ARAN Lane Miles	DID Doct mecoscing	Automotic Output	tables
13	T_ARAN_LMILES	999.999	Total Park ARAN Lane Wiles	RIP Post-processing	Automatic Output	100% Referenced to other
14	T_CONCESS_PAVED	999.999	Total Park Concession Paved Miles	RIP Post-processing	Automatic Output	tables
14	1_CONCESS_FAVED	777.777	Total Fark Concession Faved willes	Kir rost-processing	Automatic Output	100% Referenced to other
15	T_CONCESS_UNPAVED	999.999	Total Park Concession Unpaved Miles	RIP Post-processing	Automatic Output	tables
13	1_CONCESS_UNIAVED	222.222	Total Lark Concession Onpaved Willes	Kii Tost-processing	Automatic Output	100% Referenced to other
16	T_PRK_PAVEDSQFT	999.999	Total Park Parking Paved Square Feet	RIP Post-processing	Automatic Output	tables
10	1_1111_1111000011	777.777	Total Park Parking Unpaved Square Total Park Parking Unpaved Square	Tar 1 ost processing	Tatomane Output	100% Referenced to other
17	T_PRK_UNPAVEDSQFT	999.999	Feet	RIP Post-processing	Automatic Output	tables
1			Total Park Concession Parking Paved		and the state of t	100% Referenced to other
18	T_CPRK_PAVEDSQFT	999.999	Square Feet	RIP Post-processing	Automatic Output	tables

						EXPECTED
	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	ACCURACY
1.0			Total Park Concession Parking Unpaved			100% Referenced to other
19	T_CPRK_UNPAVEDSQFT	999.999	Square Feet	RIP Post-processing	Automatic Output	tables
20		000 000				100% Referenced to other
20	T_PARKING_SQFT	999.999	Total Park Parking Square Feet	RIP Post-processing	Automatic Output	tables
		000 000	Total Park Parking Equivalent Lane			100% Referenced to other
21	T_PARKING_LMILES	999.999	Miles	RIP Post-processing	Automatic Output	tables
22	T MDD GOET	000 000	Total Park Manually Rated Road Square	DIDD		100% Referenced to other
22	T_MRR_SQFT	999.999	Feet	RIP Post-processing	Automatic Output	tables
22	T CMPP COET	000 000	Total Park Concession Manually Rated	DID D		100% Referenced to other
23	T_CMRR_SQFT	999.999	Road Square Feet	RIP Post-processing	Automatic Output	tables
2.4	T MDD ANGER	000 000	Total Park Manually Rated Road	DIDD		100% Referenced to other
24	T_MRR_LMILES	999.999	Equivalent Lane Miles	RIP Post-processing	Automatic Output	tables
2.5		000 000				100% Referenced to other
25	T_LMILES	999.999	Total Park Lane Miles	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
26	T_CULVERT_CNT	999	Total Park Culvert Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
27	T_DROP_INLET_CNT	999	Total Park Drop Inlet Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
28	T_GATE_CNT	999	Total Park Gate Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
29	T_TRAFLIGHT_CNT	999	Total Park Traffic light Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
30	T_SIGN_CNT	999	Total Park Sign Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
31	T_LWCROSS_CNT	999	Total Park Low Water Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
32	T_BRIDGE_CNT	999	Total Park Bridge Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
33	T_TUNNEL_CNT	999	Total Park Tunnel Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
34	T_PULLOUT_CNT	999	Total Park Pullout Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
35	T_INTERSEC_CNT	999	Total Park Intersections Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
36	T_ST_BNDRY_CNT	999	Total Park State Boundaries Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
37	T_PRK_BNDRY_CNT	999	Total Park Boundaries Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
38	T_RETWALL_CNT	999	Total Park Retaining Wall Count	RIP Post-processing	Automatic Output	tables
20		000		DID De star de la constant de la con	A (1000/ D. C. 17 /
39	T_RR_CROSS_CNT	999	Total Park RR Crossing Count	RIP Post-processing	Automatic Output	100% Referenced to other

	EIELD	EODMAT		COLIDGE	WALIDATION	EXPECTED
	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	tables
						tables
						100% Referenced to other
40	T_CATTLE_CNT	999	Total Park Cattle Guard Count	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
41	T_OVHDSIGN_CNT	999	Total Park Overhead Sign Count	RIP Post-processing	Automatic Output	tables
40	T MH EMARK COM	000	T 1 D 1 M 1 G	DID D		100% Referenced to other
42	T_MILEMARK_CNT	999	Total Park Mile Marker Count	RIP Post-processing	Automatic Output	tables
12	T ELIVE CNT	999	Total Dada Fina Hardwart Count	DID Doot annouse in a	Automotic Outout	100% Referenced to other
43	T_FHYD_CNT	999	Total Park Fire Hydrant Count	RIP Post-processing	Automatic Output	tables 100% Referenced to other
44	T_OVERPASS_CNT	999	Total Park Overpass Count	RIP Post-processing	Automatic Output	tables
	1_0VERTASS_CIVI	777	Total Lark Overpass Count	Kii Tost-processing	Automatic Output	100% Referenced to other
45	T_CABLE_TLNG	9999.999 (ft)	Total Length Park Cable Barriers	RIP Post-processing	Automatic Output	tables
-15	T_GTBEE_TET(G))))))))(It)	Total Length Park Guard/Guide Rail	Tan Tost processing	Tutomatic output	100% Referenced to other
46	T_GDRAIL_TLNG	9999.999 (ft)	Barriers	RIP Post-processing	Automatic Output	tables
		()	Total Length Park Guard/Guide Wall			100% Referenced to other
47	T_GDWALL_TLNG	9999.999 (ft)	Barriers	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
48	T_TEMP_BARR_TLNG	9999.999 (ft)	Total Length Park Temporary Barriers	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
49	T_BOLLARD_TLNG	9999.999 (ft)	Total Length Park Bollard Barriers	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
50	T_BARRIER_TLNG	9999.999 (ft)	Total Length All Park Barriers	RIP Post-processing	Automatic Output	tables
-1	T. CURD. TILVIC	0000 000 (6)		DIDD		100% Referenced to other
51	T_CURB_TLNG	9999.999 (ft)	Total Length Park Curbing	RIP Post-processing	Automatic Output	tables
50	T I WCDOSS TI NO	0000 000 (ft)	Total I anoth Don't I am Water Coopings	DID Doot annouse in a	A	100% Referenced to other
52	T_LWCROSS_TLNG	9999.999 (ft)	Total Length Park Low Water Crossings	RIP Post-processing	Automatic Output	tables 100% Referenced to other
53	T_PAVDITCH_TLNG	9999.999 (ft)	Total Length Park Paved Ditches	RIP Post-processing	Automatic Output	tables (2)
- 55	I_IAVBITEII_IENG)))),)))(It)	Total Length Lark Laved Ditelles	Kii Tost-processing	Automatic Output	100% Referenced to other
54	T_TURNOUT_TLNG	9999.999 (ft)	Total Length Park Turnouts	RIP Post-processing	Automatic Output	tables
-		,,,,,,,,(11)				100% Referenced to other
55	PARK_PCR	99.99	Overall Park PCR Rating	RIP Post-processing	Automatic Output	tables
	_				1	100% Referenced to other
56	PARK_RCI	99.99	Overall Park RCI Rating	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
57	PARK_SCR	99.99	Overall Park SCR Rating	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
58	PARK_RUT_INDEX	99.99	Overall Park Rutting Index Rating	RIP Post-processing	Automatic Output	tables
	DADK AG DEST	00.00	Overall Park Alligator Cracking Index	DID D		100% Referenced to other
59	PARK_AC_INDEX	99.99	Rating	RIP Post-processing	Automatic Output	tables

						EXPECTED
	FIELD	FORMAT	EXPECTED VALUE	SOURCE	VALIDATION	ACCURACY
			Overall Park Longitudinal Cracking			100% Referenced to other
60	PARK_LC_INDEX	99.99	Index Rating	RIP Post-processing	Automatic Output	tables
			Overall Park Transverse Cracking Index			100% Referenced to other
61	PARK_TC_INDEX	99.99	Rating	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
62	PARK_PATCH_INDEX	99.99	Overall Park Patching Index Rating	RIP Post-processing	Automatic Output	tables
						100% Referenced to other
63	PARK_CONC_PCR	99.99	Overall Park Concession PCR Rating	RIP Post-processing	Automatic Output	tables